



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	26/02/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	26/02/2026		BOKSBURG -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	FIAT	Registration Number	CY282326
Model	PALIO 1.6	Register Number	DXJ161S
VIN	AFZ178F7101531110	Date Of First Licensing	
Engine Number	178D20110713477	Last COR	04/02/2026
Doors	4	License Expiry Date	
Color	WHITE	Power / Displacement	74KW/1581CCM
Year Model	2005	Paint Finish	C - COMMON
Km Reading	91,015 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items


1 airbag; 2x electrical windows; Airconditioning; Central locking; Power steering; Radio cd;

VEHICLE INSPECTION



Damage

Repair Way

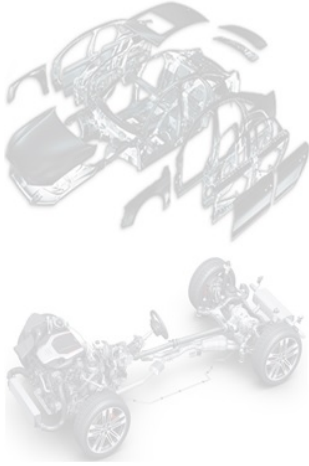

Brakes

Brake Test Results

Brake efficiency tested during road test.

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.0	2.6	-	
Rear	1.0	0.8	-	
Emergency / Parking	1	0.8	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/65/14	82T	Hilo	Genyses	V	3825	5 mm
Front Right	175/65/14	86T	Hilo	Genyses	V	2025	5 mm
Rear Left	175/65/14	82T	Hilo	Genyses	V	3825	6 mm
Rear Right	175/65/14	82T	Hilo	Genyses	V	3825	0 mm
Spare	175/65/14	82T	Davanti	DX390	V	0000	2 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKINGS ARE VISIBLE ON THE EXTERIOR, INTERIOR, ELECTRICAL, AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches on various body panels. Visible traces of cosmetic repairs have been done to the vehicle.

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

David Olwagen

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

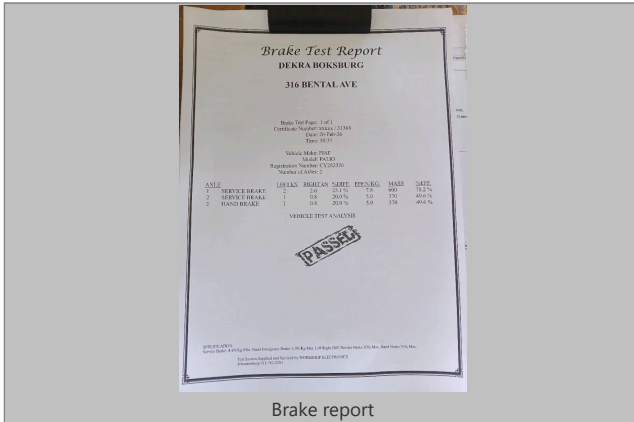

Brake report



Oil cap and dipstick




Expansion bottle



Spare wheel



Chassis2

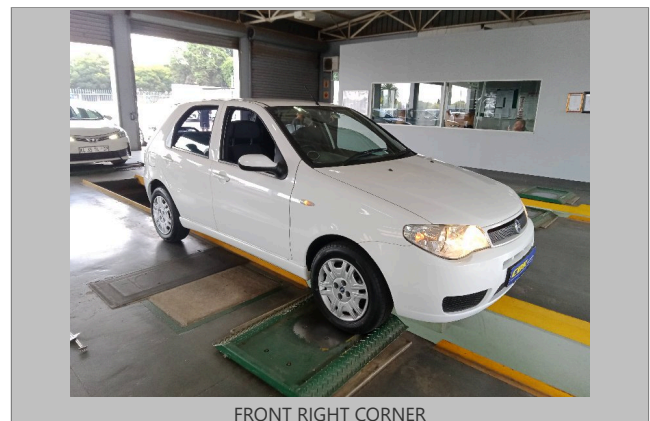

FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



CHASSIS



ENGINE 2



ENGINE 1