



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	02/06/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	02/06/2026		BOKSBURG - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	ISUZU	Registration Number	CR76DXGP
Model	KB300 LX D-CAB CLOTH DSL PU [2013-2014]	Register Number	FRY058K
VIN	ADMURCERXC4655136	Date Of First Licensing	
Engine Number	4JJ1LB3131	Last COR	02/06/2026
Doors	4	License Expiry Date	31/10/2026
Color	SILVER	Power / Displacement	130Kw. 2999Ccm
Year Model	2013	Paint Finish	M - METALLIC
Km Reading	155,504 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	MANUAL

Vehicle Options & Accessories


Items

VEHICLE INSPECTION



Damage

Repair Way

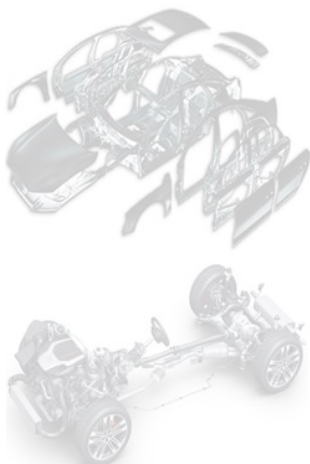

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.9	3.5	-	
Rear	3.5	3.4	-	
Emergency / Parking	2.8	2.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/65R17	112T	Goodyear	Wrangler	V	3321	6 mm
Front Right	265/65R17	112T	Goodyear	Wrangler	V	2821	6 mm
Rear Left	255/65R17	110T	Goodyear	Wrangler	V	2613	3 mm
Rear Right	255/65R17	110T	Goodyear	Wrangler	V	4917	4 mm
Spare	255/65R17	110T	Goodyear	Wrangler	V	0000	7 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents scratches and stone chips Cosmetic spray work various panels

Options & Accessories

NUDGE BAR TONNEAU COVER ROO BAR SIDE STEPS MUDFLAPS LOADING BIN RUBBERIZED

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician


This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

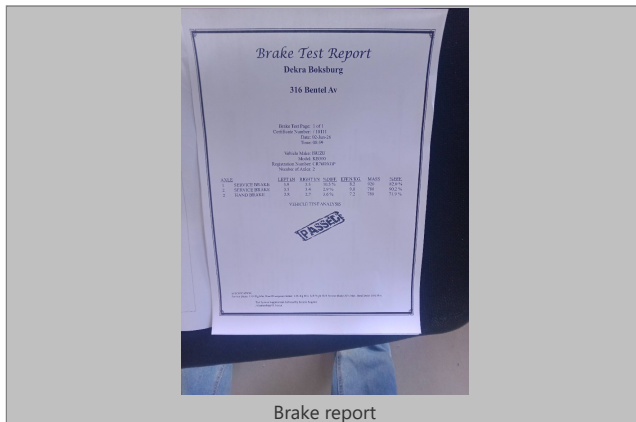

Brake report

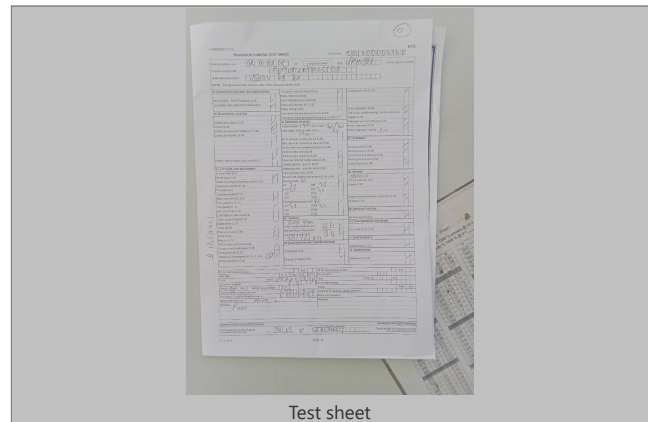


Test sheet



FRONT RIGHT CORNER



REAR LEFT CORNER

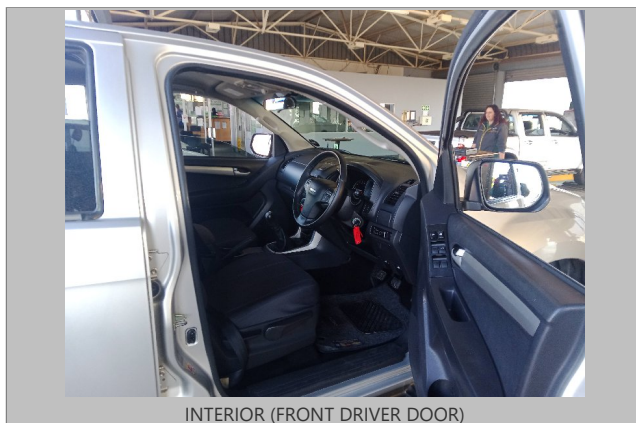

INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD




RF TYRE TREAD



Spare tyre



LICENSE DISC

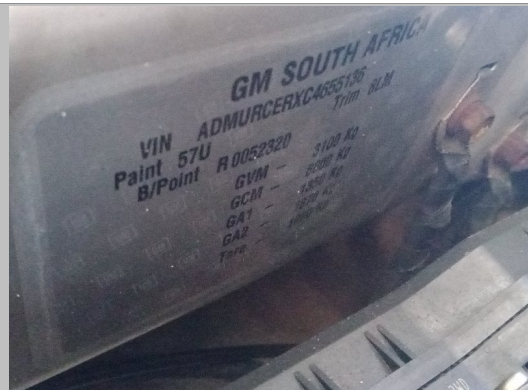

VIN PLATE OR STICKER



ENGINE 1



Engine covered



CHASSIS



Chassis 2



Oil cap and dipstick



Coolant level