



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	25/05/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	25/05/2026		BOKSBURG -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	FORD	Registration Number	LV22ZYGP
Model	FIESTA 1.0 ECOBOOST TREND 5-DR POWERSHIFT [2013-2018]	Register Number	TTW018W
		Date Of First Licensing	
VIN	WF0DXXGAKDET16068	Last COR	25/05/2026
Engine Number	ET16068	License Expiry Date	
Doors	5	Power / Displacement	74kw 995ccm
Color	RED	Paint Finish	M - METALLIC
Year Model	2014	Fuel	PETROL
Km Reading	68,429 KM	Transmission	AUTOMATIC
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items


4 airbags; 4x electrical windows; ABS; Airconditioning; Alarm system; Alloy Wheels; Central locking; El. mirrors; ESP (el. stability progr.); Fog lights; Handsfree car kit; Multifunction steering wheel; Power steering; Radio cd; Traction control system;

VEHICLE INSPECTION



Damage

Repair Way

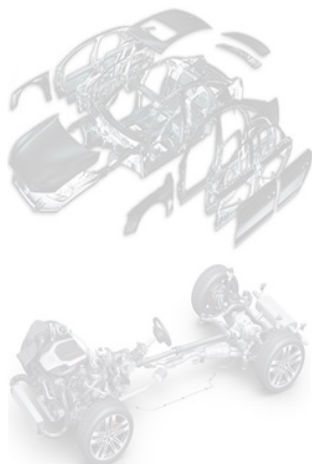

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.8	2.1	-	
Rear	2.0	1.7	-	
Emergency / Parking	1.3	1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/50R15	82V	Falken	Ziex	V	1622	3 mm
Front Right	195/50R15	82V	Falken	Ziex	V	1622	3 mm
Rear Left	195/50R15	82V	Falken	Ziex	V	1022	5 mm
Rear Right	195/50R15	82V	Falken	Ziex	V	1622	5 mm
Spare	175/65R14	82T	Continental	Contact 3	V	1214	7 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Inspection conditions for the vehicle inspection were sufficient



Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Electrical Components and Instruments: Front washer jets not spraying at time of inspection.
Body • Exterior: Minor dents, scratches and stone chips on some body panels. Cosmetical enhancements done to some body panels.
Axle and Suspension: Rear rebound rubber seats slightly perished.
Undercarriage: Lower gearbox mounting bush slightly perished.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




Sparewheel




Oil cap and dipstick




Expansion bottle

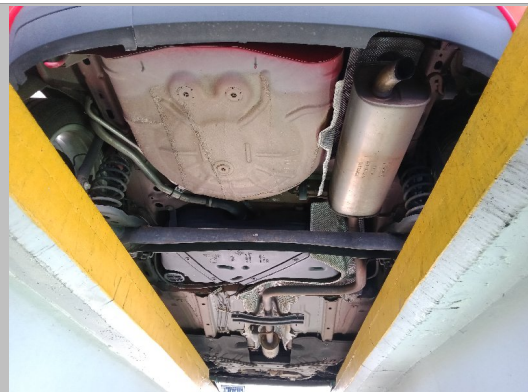

Chassis 2

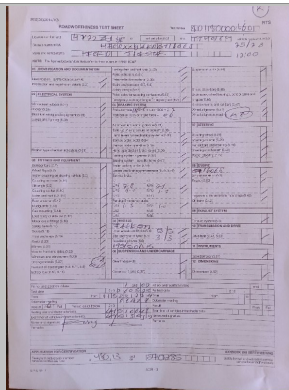

Roadworthy test sheet

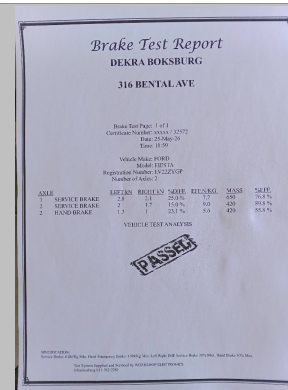

AXLE	DRIVE	BRAKE	WHEEL	REAR	MASS	WHEEL
1	FRONT	2.1	1.2	1.2	200	70.5 %
2	FRONT	1.7	1.5	1.5	420	80.5 %
3	FRONT	1.3	1.3	1.3	420	55.5 %

VEHICLE TEST ANALYSIS

PASSED

Brake test report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



CHASSIS



ENGINE 2