




Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386

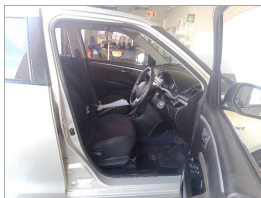

Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	21/08/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	21/08/2026		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	SUZUKI	Registration Number	DW87ZKGP
Model	SWIFT	Register Number	WCP035W
VIN	MA3GZC62S00889626	Date Of First Licensing	
Engine Number	K12MN1579727	Last COR	21/08/2026
Doors	5	License Expiry Date	31/08/2026
Color	SILVER	Power / Displacement	64kw 1197ccm
Year Model	2015	Paint Finish	M - METALLIC
Km Reading	162,894 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

2 airbags; 4x electrical windows; ABS; Airconditioning; Alarm system; Central locking; El. mirrors; Fog lights; Handsfree car kit; Hubcaps; Multifunction steering wheel; Power steering; Radio cd;


VEHICLE INSPECTION



Damage

Repair Way

Mirror Adjusters Malfunction
Rim Spare Wheel Dented

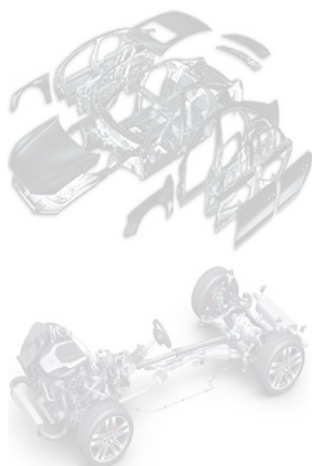

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.7	2.0	-	
Rear	1.1	1.5	-	
Emergency / Parking	0.8	0.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/70R14	88H	Goodyear	Efficient	V	2823	5 mm
Front Right	185/70R14	88H	Goodyear	Efficient	V	3723	5 mm
Rear Left	185/70R14	88H	Goodyear	Efficient	V	3723	5 mm
Rear Right	185/70R14	88H	Goodyear	Efficient	V	3729	5 mm
Spare	175/65R14	82H	Firemax	FM601		3425	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Inspection conditions for the vehicle inspection were sufficient



Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Cosmetic enhancements done to some body panels.
Axle and Suspension: Front lower control arm bushes slightly perished and appears to be soft.
Undercarriage: Lower gearbox mounting soft.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

[illegible]

Brake test report

[illegible]

Roadworthy test sheet



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER




90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

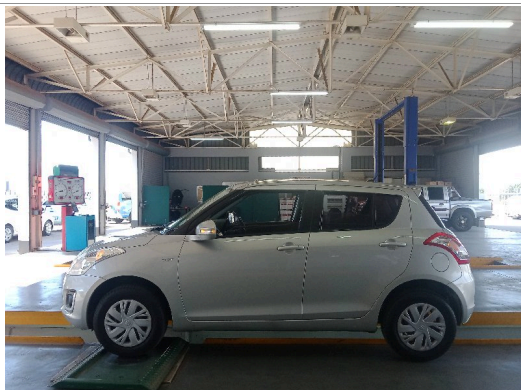

90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



LF TYRE TREAD



Sparewheel



LICENSE DISC




VIN PLATE OR STICKER



ENGINE 1




ENGINE 2

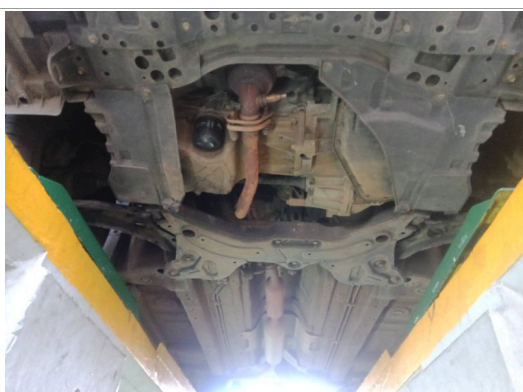

CHASSIS



Chassis 2

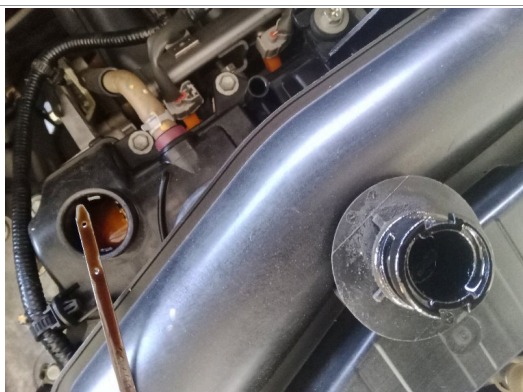

Oil cap and dipstick



Coolant bottle



Rim Spare Wheel



Mirror Adjusters

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3GZC62S00889626