



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	13/01/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	13/01/2026		BOKSBURG -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS
Manufacturer	TOYOTA	Registration Number	DP82FCGP
Model	ETIOS CROSS 1.5 5-DR [2014-2015]	Register Number	FYB524L
VIN	MBJM29BT402022118	Date Of First Licensing	
Engine Number	2NRD076562	Last COR	13/01/2026
Doors	5	License Expiry Date	30/09/2026
Color	GREY	Power / Displacement	66kw 1496ccm
Year Model	2015	Paint Finish	M - METALLIC
Km Reading	87,448 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

2 airbags; 4x electrical windows; ABS; Airconditioning; Alarm system; Alloy Wheels; Central locking; Fog lights; Power steering; Radio cd;


VEHICLE INSPECTION



Damage

Repair Way

Spare Tyre Worn

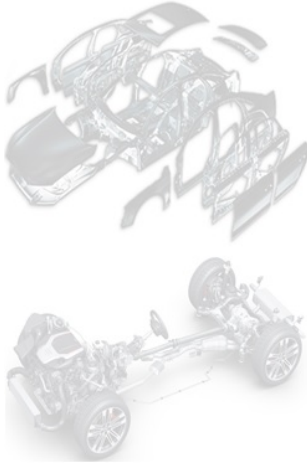

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.3	1.7	-	
Rear	1.3	1.5	-	
Emergency / Parking	1	1.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R15	88H	Dunlop	SP Sport	V	2918	3 mm
Front Right	185/60R15	88H	Dunlop	SP Sport	V	2918	3 mm
Rear Left	185/60R15	84H	Bridgestone	Turanza	V	3614	4 mm
Rear Right	185/60R15	84H	Bridgestone	Turanza	V	3514	4 mm
Spare	185/60R15	84H	Bridgestone	Turanza	V	3714	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Inspection conditions for the vehicle inspection were sufficient



Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents, scratches and stone chips on some body panels. Cosmetic spray work done to some body panels.

Axle and Suspension: Rear axle trailing arm bushes slightly perished and appears to be soft.

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician


Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

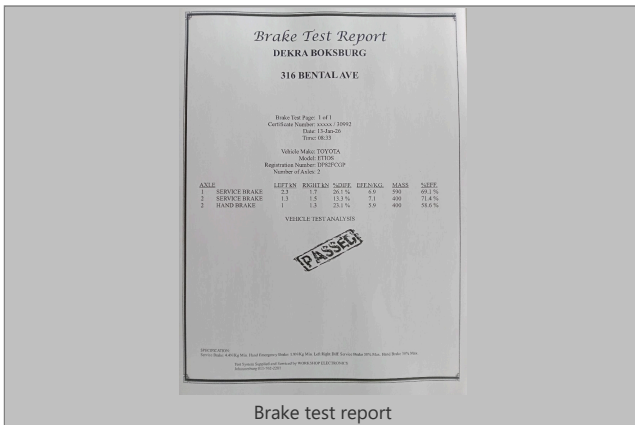


Brake test report

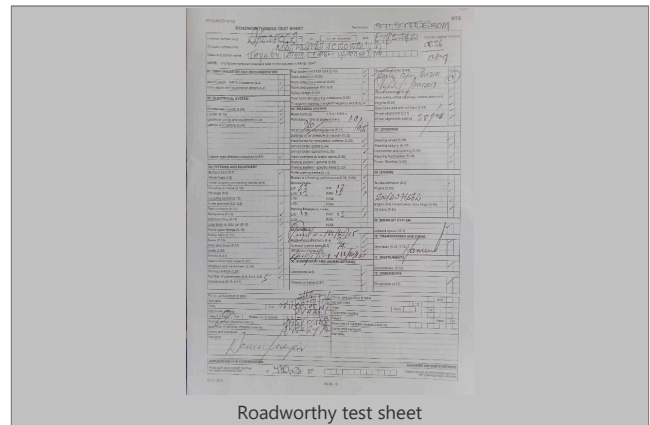


Roadworthy test sheet



FRONT RIGHT CORNER

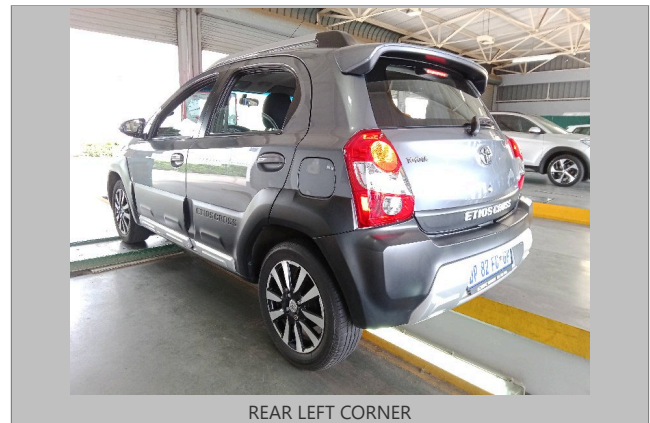

REAR LEFT CORNER

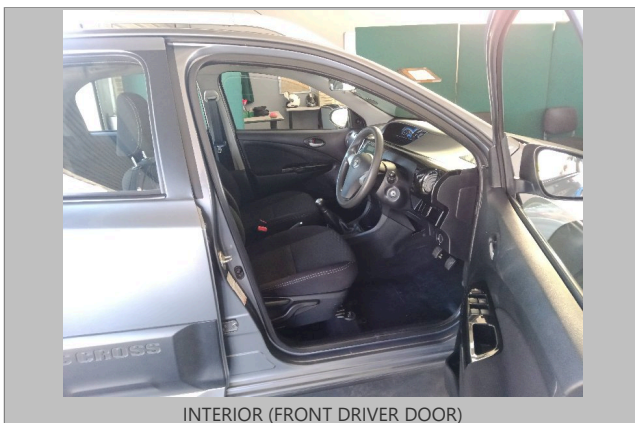

INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD




RF TYRE TREAD



Sparewheel



LICENSE DISC

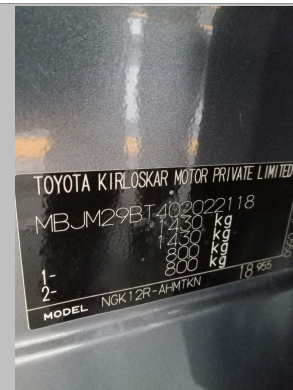

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS




Chassis 2



Coolant bottle



Oil cap and dipstick

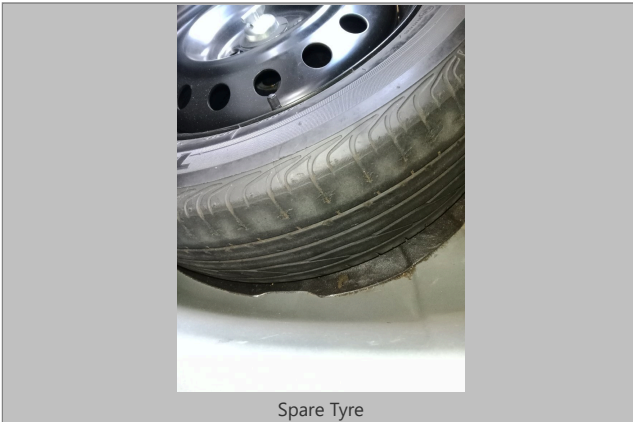

Spare Tyre

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBJM29BT402022118