



Private Client

DEKRA Boksburg  
Bentel Ave - 1459  
BOKSBURG - GT  
011 826 4386



**Assignment**

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	26/01/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	26/01/2026		BOKSBURG - GT

**Vehicle Data**

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS
Manufacturer	BMW	Registration Number	FK14DMGP
Model	420D GRAN COUPE DSL AT [2015-2017]	Register Number	XBT336W
VIN	WBA4E920X0G428683	Date Of First Licensing	
Engine Number		Last COR	26/01/2026
Doors	4	License Expiry Date	
Color	BLUE	Power / Displacement	140kw 1995ccm
Year Model	2016	Paint Finish	M - METALLIC
Km Reading	121,474 KM	Fuel	DIESEL
Cab / Body Type	COUPE	Transmission	AUTOMATIC

**Vehicle Options & Accessories**

**Items**


6 airbags; 4x electrical windows; ABS; Airconditioning auto.; Alarm system; Alloy Wheels; Central locking; Cruise control; El. mirrors; ESP (el. stability progr.); Fog lights; Handsfree car kit; Headlamp washer; Leather interior; Leather steering wheel; Multifunction steering wheel; On-board computer; Park sensor; Radio cd; Rain sensor; Sliding roof el.; Traction control system; Xenon headlights;

**VEHICLE INSPECTION**



Damage

Repair Way

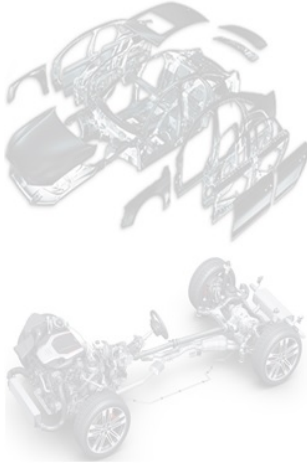

**Brakes**

**Brake Test Results**

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
Front	2.7	2.8	-	
Rear	3.6	3.7	-	
Emergency / Parking	2.5	2.4	-	

**Tyres and Rims**

**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/40ZRF19	93Y	Radar	Dimax	V	3525	6 mm
Front Right	225/40ZRF19	93Y	Radar	Dimax	V	3225	6 mm
Rear Left	255/35R19	96Y	Bridgestone	Potenza	V	4422	3 mm
Rear Right	255/35R19	96Y	Bridgestone	Potenza	V	1824	4 mm

\* Tyre Legend: V=Virgin, R=Recap

**Diagnostic**

A vehicle diagnostic has not been conducted.

**Inspection Conditions**

Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient



### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE,NORMAL WEAR AND TEAR MARKS ON INTERIOR, EXTERIOR AND MECHANICAL PARTS.Engine Compartment: Engine, transmission and undercarriage mostly covered underneath.  
Body • Exterior: Minor dents,scratches and stone chips on some body panels. Cosmetic spray work done to some body panels.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



No sparewheel




Oil cap no dipstick



Coolant bottle



Chassis 2

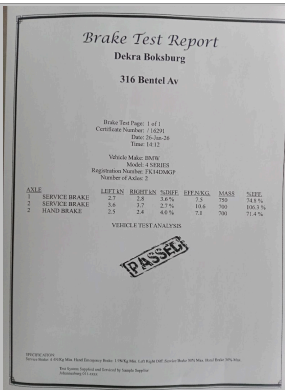

Brake test report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT




90 DEGREE REAR



90 DEGREE LEFT



LICENSE DISC

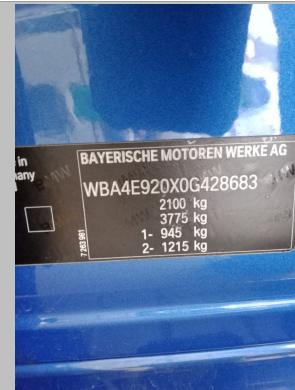

VIN PLATE OR STICKER



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



ENGINE 1



CHASSIS



ENGINE 2