



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	09/03/2026		573 TRICHARD ROAD - 1459
Inspection Date	09/03/2026		BOKSBURG DEKRA - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS
Manufacturer	HYUNDAI	Registration Number	KK79TNGP
Model	I10	Register Number	XKT321W
VIN	MALAN51BLHM692020	Date Of First Licensing	
Engine Number	G4HGGM945768	Last COR	2023/08/10
Doors	4	License Expiry Date	
Color	WHITE	Power / Displacement	49kW/1086cc
Year Model	2017	Paint Finish	C - COMMON
Km Reading	82,797 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items


1 airbag; 4x electrical windows; ABS; Airconditioning; Alarm system; Central locking; Fog lights; Hubcaps; Multifunction steering wheel; Power steering; Radio cd;

VEHICLE INSPECTION



Damage

Repair Way

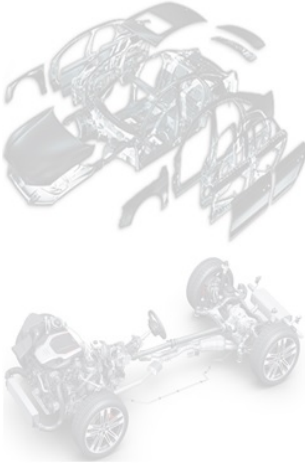

Brakes

Brake Test Results

Brake efficiency tested during road test.

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.1	2.1	-	
Rear	1.4	1.4	-	
Emergency / Parking	1.3	1.4	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/60/14	75H	Velocity	Rota Eco	V	4123	4 mm
Front Right	165/60/15/4	75H	Velocity	Rota Eco	V	4123	4 mm
Rear Left	165/60/14	75H	Velocity	Rota Eco	V	4123	4 mm
Rear Right	165/60/14	75H	Velocity	Rota Eco	V	4123	4 mm
Spare	165/60/14	75T	Khumo	Solus	V	0000	1 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Interior: According to the age and mileage of the vehicle normal wear and tear on the interior of the vehicle
Body • Exterior: According to the age and mileage of the vehicle minor dents and scratches visible on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

David Olwagen

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE REAR



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE LEFT



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel



Expansion bottle




Oil cap and dipstick



Chassis2



CHASSIS

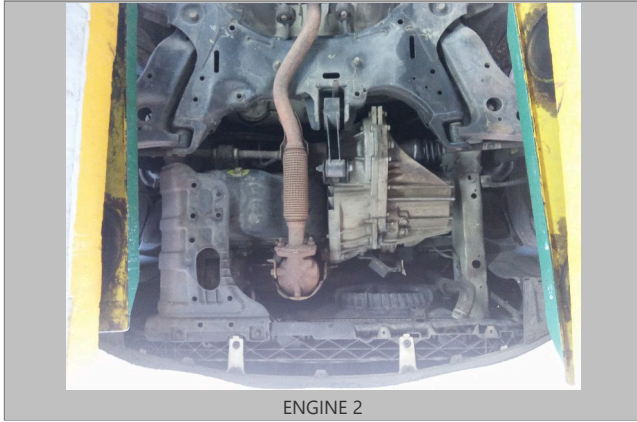

ENGINE 2




ENGINE 1




VIN PLATE OR STICKER



LICENCE DISC

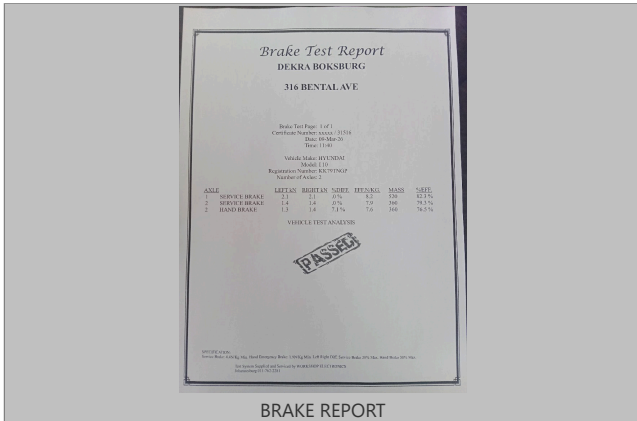

BRAKE REPORT

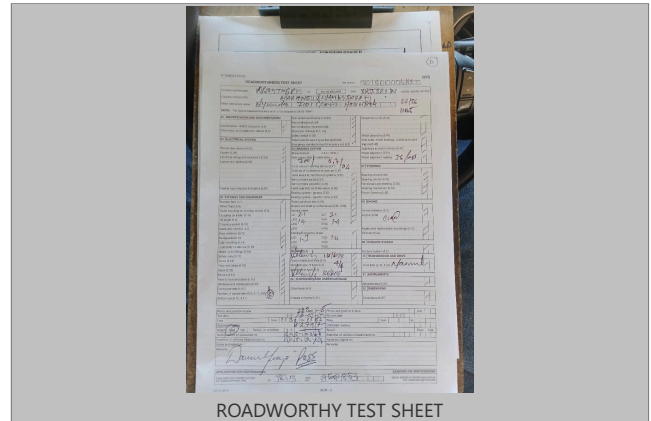

ROADWORTHY TEST SHEET

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALAN51BLHM692020