



Private Client

DEKRA Boksburg  
Bentel Ave - 1459  
BOKSBURG - GT  
011 826 4386



**Assignment**

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	17/06/2026		316 Bentel Ave - 1459
Inspection Date	17/06/2026		DEKRA Boksburg - GT

**Vehicle Data**

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	CBK CBK MOTORS
Manufacturer	NISSAN	Registration Number	KF59MLGP
Model	NAVARA	Register Number	DBD853X
VIN	ADNACAD23Z0002819	Date Of First Licensing	
Engine Number		Last COR	17/06/2026
Doors	2	License Expiry Date	28/02/2026
Color	WHITE	Power / Displacement	120kw 2488cm
Year Model	2021	Paint Finish	C - COMMON
Km Reading	67,260 KM	Fuel	DIESEL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

**Vehicle Options & Accessories**

**Items**


(Fixed) tow bar; 2 airbags; ABS; Airconditioning; Headlamp washer; Power steering; Radio cd;

VEHICLE INSPECTION



Damage

Repair Way

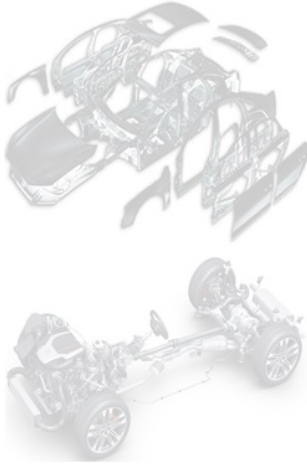

**Brakes**

**Brake Test Results**

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
Front	4.2	4.0	-	
Rear	3.8	3.7	-	
Emergency / Parking	2.8	3	-	

**Tyres and Rims**

**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205R16C	110/108S	Continental	Worldcontact	V	0623	7 mm
Front Right	205R16C	110/108S	Dunlop	Grandtrek	V	3021	6 mm
Rear Left	205R16C	110/108S	Royalblack	Royal A/T	V	2825	7 mm
Rear Right	205R16C	110/108S	Royalblack	Royal A/T	V	2825	7 mm
Spare	205R16C	110/108S	Dunlop	Grandtrek	V	0000	2 mm

\* Tyre Legend: V=Virgin, R=Recap



### Diagnostic

A vehicle diagnostic has not been conducted.

### Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Engine mostly covered underneath, visible area wet, not dripping.  
Body • Exterior: Minor dents, scratches and stonechips on some body panels. Cosmetic enhancements done to some body panels.

### Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician


Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

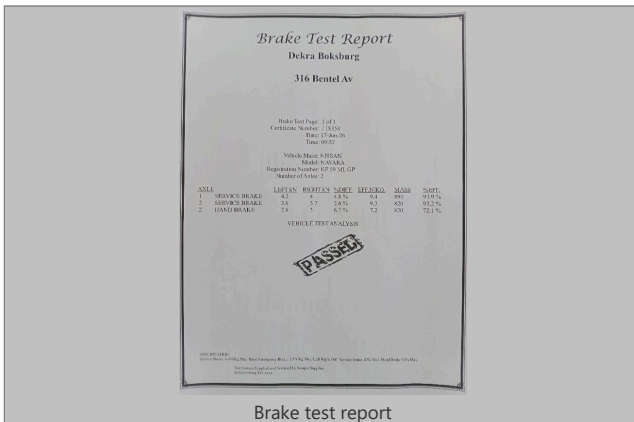

Brake test report

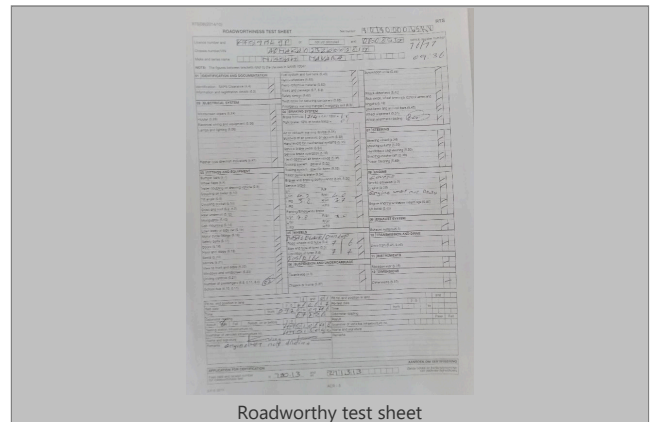


Roadworthy test sheet



FRONT RIGHT CORNER



REAR LEFT CORNER

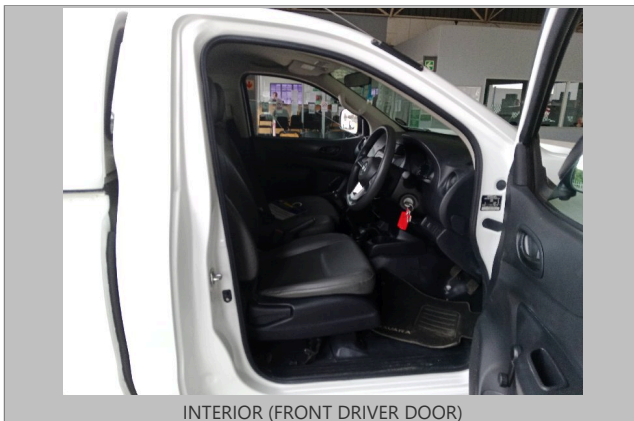

INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD




RR TYRE TREAD



RF TYRE TREAD



Sparewheel

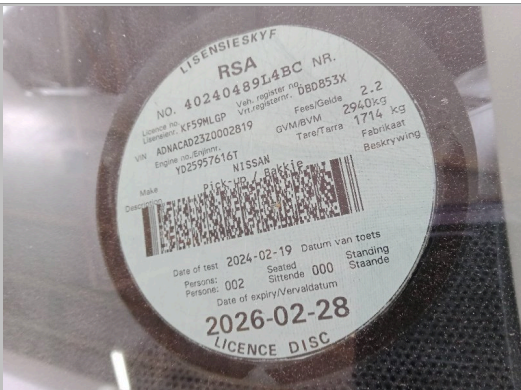


LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

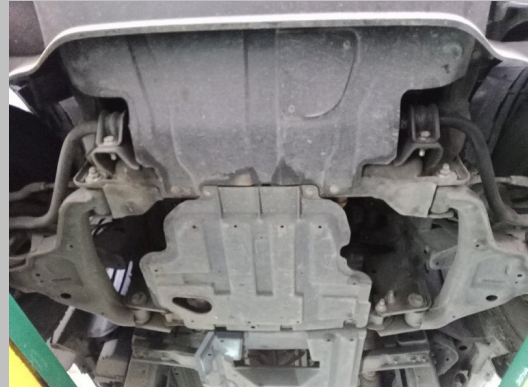

ENGINE 2



CHASSIS




Chassis 2



Coolant bottle



Trailer plug cover missing

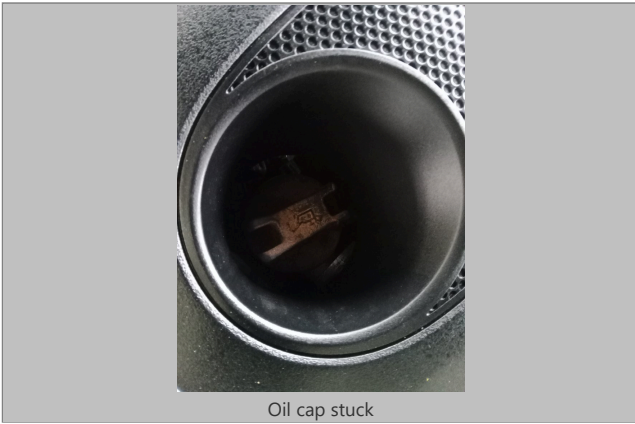

Oil cap stuck

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: ADNACAD23Z0002819