



Private Client

DEKRA Boksburg  
Bentel Ave - 1459  
BOKSBURG - GT  
011 826 4386



**Assignment**

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	04/05/2026		316 Bentel Ave - 1459
Inspection Date	04/05/2026		Boksburg Dekra - GT

**Vehicle Data**

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK CBK MOTORS
Manufacturer	MERCEDES BENZ	Registration Number	1611ZN
Model	CLA200	Register Number	YZB279W
VIN	WDD1173432N686564	Date Of First Licensing	
Engine Number		Last COR	04/05/2026
Doors	4	License Expiry Date	31/10/2026
Color	RED	Power / Displacement	115KW/1595CCM
Year Model	2018	Paint Finish	M - METALLIC
Km Reading	114,203 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

**Vehicle Options & Accessories**

**Items**


8 airbags; 4x electrical windows; ABS; Airconditioning; Alarm system; Alloy Wheels; Central locking; Cruise control; El. fold-away mirrors; ESP (el. stability progr.); Handsfree car kit; Leather interior; Leather steering wheel; Multifunction steering wheel; Park sensor; Power steering; Radio cd; Rain sensor; Sliding roof el.; Traction control system; Xenon headlights;

**VEHICLE INSPECTION**



Damage

Repair Way

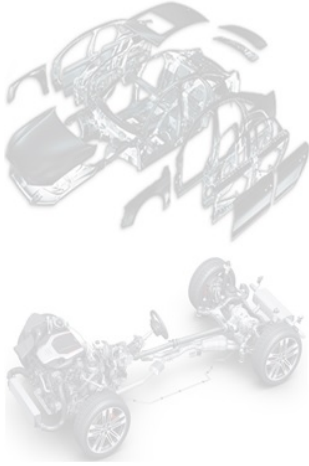

**Brakes**

**Brake Test Results**

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
Front	3.9	3.3	-	
Rear	2.2	2.0	-	
Emergency / Parking	1.4	1.3	-	

**Tyres and Rims**

**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/40R18	92W	Goodyear	Eagle	V	0925	5 mm
Front Right	225/40R18	92W	Goodyear	Eagle	V	0724	5 mm
Rear Left	225/40R18	92W	Continental	Contact 5	V	3525	6 mm
Rear Right	225/40R18	92W	Goodyear	Eagle	V	0925	6 mm

\* Tyre Legend: V=Virgin, R=Recap

**Diagnostic**

A vehicle diagnostic has not been conducted.

**Inspection Conditions**

Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient



## Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL, AND MECHANICAL PARTS. Body • Exterior: Minor dents, scratches, and stone chips on some body panels. Cosmetic spraywork done to some body panels.

Undercarriage: Limited access to the undercarriage. Mostly covered underneath.

## Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

## Technician

Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.





FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



CHASSIS



ENGINE 2