




Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386

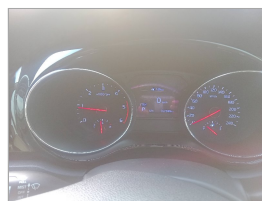

Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	23/07/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	23/07/2026		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	KIA	Registration Number	HX87FHGP
Model	SEDONA	Register Number	ZLJ508W
VIN	KNAMC81AMK6479552	Date Of First Licensing	
Engine Number	D4HBJH886423	Last COR	
Doors	5	License Expiry Date	28/02/2027
Color	SILVER	Power / Displacement	142Kw. 2199Ccm
Year Model	2019	Paint Finish	M - METALLIC
Km Reading	101,598 KM	Fuel	DIESEL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items


(Fixed) tow bar; 10 airbags; 4x electrical windows; ABS; Airconditioning; Alarm system; Alloy Wheels; Car phone preparation; Central locking; Cruise control; El. fold-away mirrors; ESP (el. stability progr.); Fog lights; Front armrest; Handsfree car kit; Leather interior; Leather steering wheel; Multifunction steering wheel; Navigation system; On-board computer; Park sensor; Power steering; Radio / Cassette; Rain sensor; Traction control system; Xenon headlights;

VEHICLE INSPECTION



Damage

Repair Way

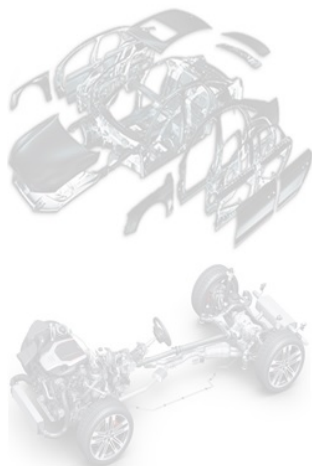

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	5.0	4.3	-	
Rear	3.3	2.6	-	
Emergency / Parking	0.2	0	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/60R18	107V	Landsail	LS588	V	4423	5 mm
Front Right	235/60R18	107V	Landsail	LS588	V	4323	5 mm
Rear Left	235/60R18	107W	General	Grabber	V	4722	4 mm
Rear Right	235/60R18	107W	General	Grabber	V	4722	4 mm
Spare	T135/80R18	104M	Kumho	Temporary	V	0000	3 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents scratches and stone chips Cosmetic spray work some panels

Undercarriage: Under carriage mostly covered

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE


Technician

IAN WHITTAKER


This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

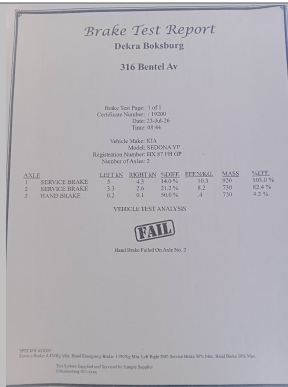

Brake report

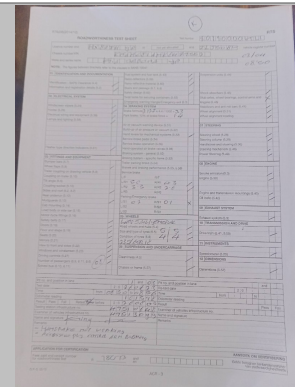

Test sheet



FRONT RIGHT CORNER




REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

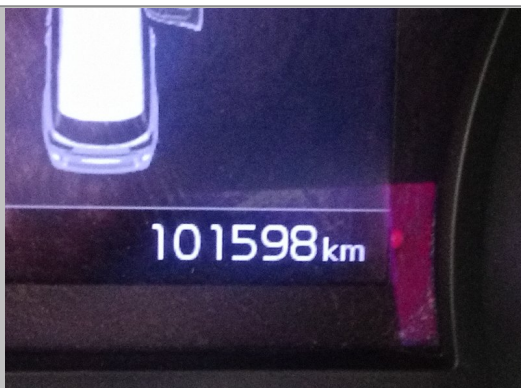

ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT




LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

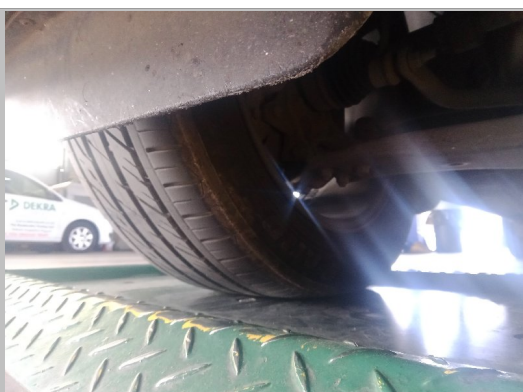

RF TYRE TREAD



Spare tyre




LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

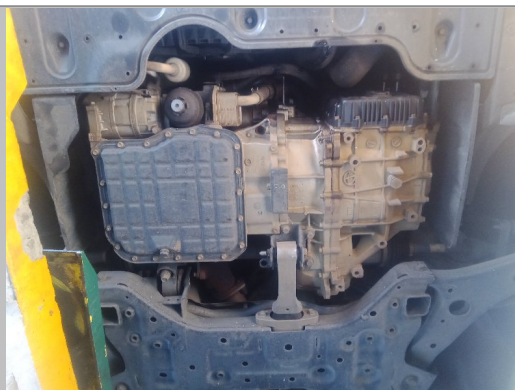

ENGINE 2



CHASSIS



Chassis 2




Coolant level



Air-conditioning



ADDITIONAL 10

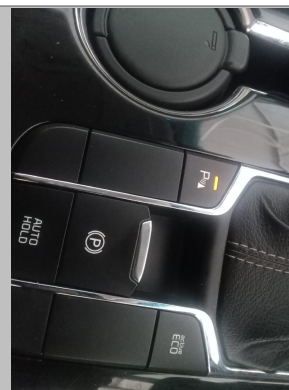

Parking Brake Performance



Control Arm Bush(es) Front Axle Left



Control Arm Bush(es) Front Axle Right