



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	04/03/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	04/03/2026		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS
Manufacturer	RENAULT	Registration Number	JD88KDGP
Model	SANDERO	Register Number	ZYB796W
VIN	VF15SRAAC62697775	Date Of First Licensing	
Engine Number		Last COR	04/03/2026
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	66kw 898ccm
Year Model	2019	Paint Finish	C - COMMON
Km Reading	90,144 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items


(Fixed) tow bar; 2 airbags; 2x electrical windows; ABS; Airconditioning; Alarm system; Central locking; ESP (el. stability progr.); Fog lights; Handsfree car kit; Power steering; Radio cd; Traction control system;

VEHICLE INSPECTION



Damage

Repair Way

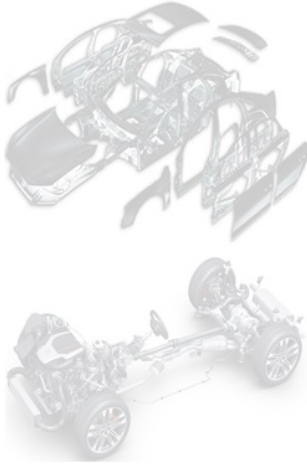

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.1	2.0	-	
Rear	1.8	1.5	-	
Emergency / Parking	1.5	1.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55R16	91V	Dunlop	SP Sport	V	0224	3 mm
Front Right	205/55R16	91V	Dunlop	SP Sport	V	0824	3 mm
Rear Left	205/55R16	91H	Continental	Contact 5	V	0919	4 mm
Rear Right	205/55R16	91H	Continental	Contact 5	V	0919	4 mm
Spare	205/55R16	91W	Atlas	Sport Green	V	0117	1 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Engine and gearbox partly covered underneath.
Electrical Components and Instruments: Washer jets not spraying at time of inspection.
Body • Exterior: Minor dents, scratches, and stonechips on some body panels. Cosmetic spraywork done to some body panels.
Tyres and Rims: Hubcaps damaged

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Oil cap and dipstick



Coolant bottle




Sparewheel



Chassis 2



Hubcaps damaged

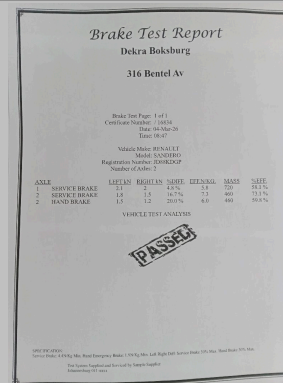

Brake test report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC




VIN PLATE OR STICKER



ENGINE 1



CHASSIS

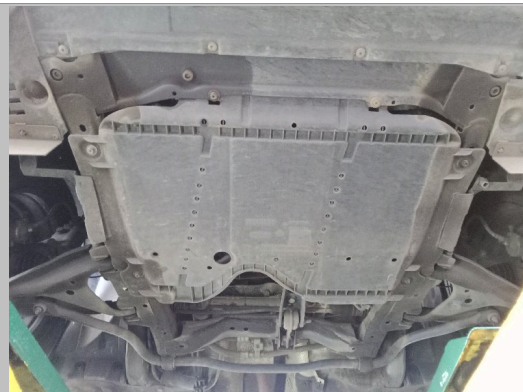

ENGINE 2