



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	24/08/2026		316 Bentel Ave - 1459
Inspection Date	24/08/2026		Boksburg - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	CBK CBK MOTORS
Manufacturer	GWM	Registration Number	MW69XJGP
Model	P-SERIES	Register Number	JPk153L
VIN	LGWCBF194NJ626442	Date Of First Licensing	
Engine Number		Last COR	24/08/2026
Doors	4	License Expiry Date	28/02/2027
Color	RED	Power / Displacement	120kw 1996ccm
Year Model	2022	Paint Finish	M - METALLIC
Km Reading	99,703 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

(Fixed) tow bar; 8 airbags; 4x electrical windows; ABS; Airconditioning auto.; Alarm system; Alloy Wheels; Central locking; Cruise control; El. mirrors; ESP (el. stability progr.); Fog lights; Handsfree car kit; Leather interior; Leather steering wheel; Multifunction steering wheel; Park sensor; Power steering; Radio / Cassette; Rain sensor; Traction control system; Xenon headlights;


VEHICLE INSPECTION



Damage

Repair Way

Bonnet Dented
Roof Dented
Load Body Dented

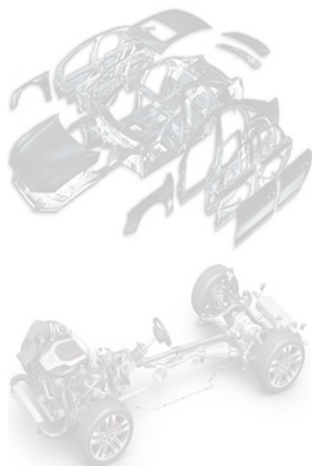

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.1	3.5	-	
Rear	3.5	3.2	-	
Emergency / Parking	3.8	3.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/65R17	112T	Bridgestone	Dueler	V	3625	7 mm
Front Right	265/65R17	112T	Bridgestone	Dueler	V	3625	7 mm
Rear Left	265/65R17	112T	Bridgestone	Dueler		3625	7 mm
Rear Right	265/65R17	112T	Bridgestone	Dueler	V	3625	7 mm
Spare	265/60R18	110H	Cooper	Discoverer	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Electrical Components and Instruments: Trailer plug cover broken

Options & Accessories

SIDESTEPS, ARMDILLO, NUDGE BAR

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE


Technician

Tumelo Molekoa


This document was created electronically and is valid without signature.

General Remarks:


The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

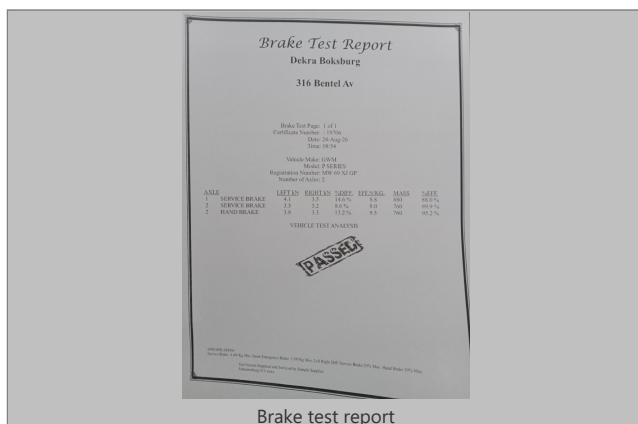


Brake test report

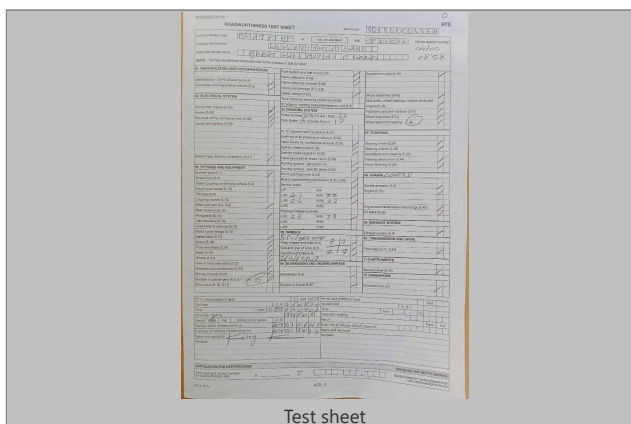

Test sheet

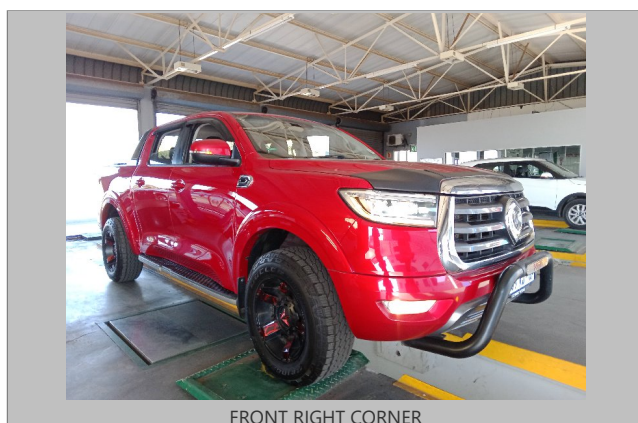

FRONT RIGHT CORNER

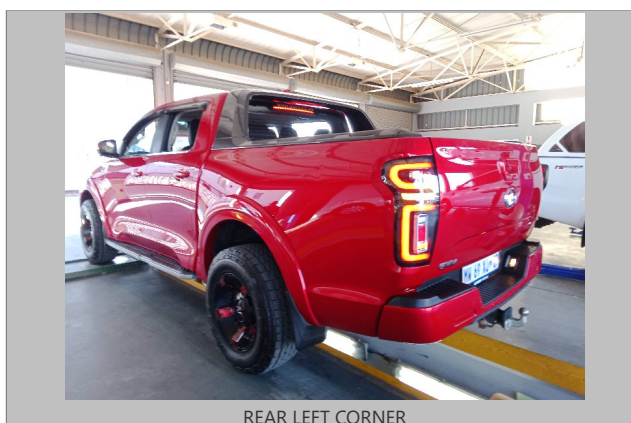

REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)




DASHBOARD (W/ ENGINE RUNNING)



ODOMETER




90 DEGREE FRONT

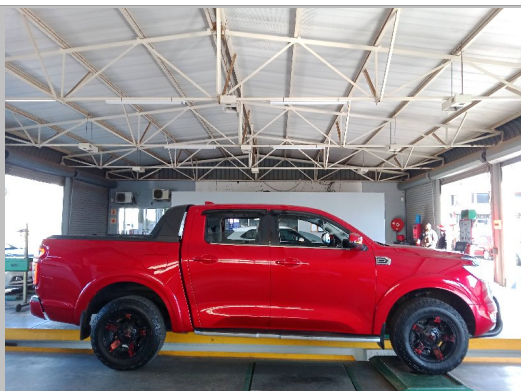

90 DEGREE RIGHT



90 DEGREE REAR

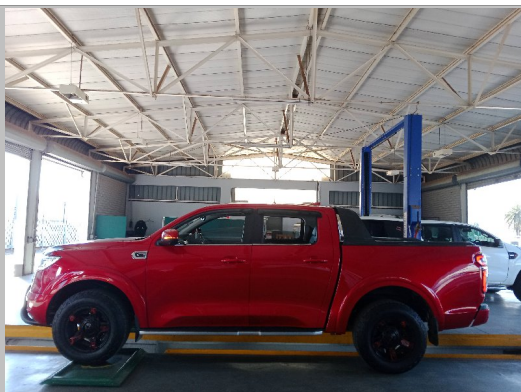

90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD




RR TYRE TREAD



RF TYRE TREAD



Sparewheel

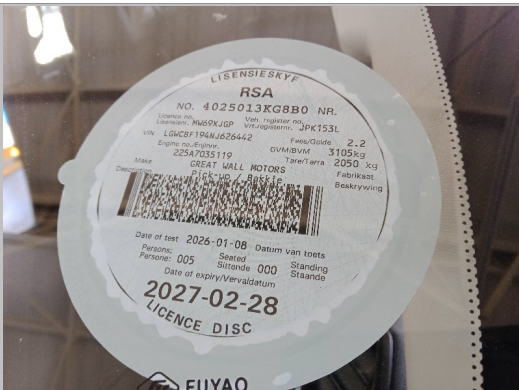

LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Chassis 2



Aircon working



Coolant bottle



Oil cap covered



Load Body



Load Body



Bonnet



Roof