



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	15/07/2025		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	15/07/2025		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	VOLKSWAGEN	Registration Number	JM78WFGP
Model	TIGUAN ALLSPACE 1.4 TSI 110KW COMFORTLINE DSG [2019-2021]	Register Number	HTG511K
VIN	WVGZZZ5NZKM197439	Date Of First Licensing	
Engine Number	CZDA49127	Last COR	15/07/2025
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	110Kw. 1395Ccm
Year Model	2020	Paint Finish	C - COMMON
Km Reading	83,987 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

(Fixed) tow bar; 6 airbags; 4x electrical windows; ABS; Airconditioning auto.; Alarm system; Alloy Wheels; Car phone preparation; Central locking; Cruise control; Driver's seat elec.; Driver's seat with memory; El. fold-away mirrors; ESP (el. stability progr.); Fog lights; Front armrest; Handsfree car kit; Headlamp washer; Leather interior; Leather steering wheel; Multifunction steering wheel; Navigation system; On-board computer; Park sensor; Power steering; Radio / Cassette; Rain sensor; Seat heating; Sliding roof el.; Sun roof; Traction control system; Xenon headlights;



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.6	2.7	-	
Rear	3.4	2.7	-	
Emergency / Parking	1.8	2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	255/45R19	104Y	Sunwide	Rs-one	V	4624	5 mm
Front Right	2545R19	104Y	Sunwide	Rs-one	V	4624	5 mm
Rear Left	255/45R19	100W	Continental	Contact 5	V	0324	6 mm
Rear Right	255/45R19	100E	Continental	Contact 5	V	0324	6 mm
Spare	T 145/85R19	108M	Ling Long	Temporary	V	0000	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: Body • Exterior: Minor dents scratches and stone chips

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

IAN WHITTAKER

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Spare tyre



Oil cap and dipstick




Coolant level




Engine covered



Chassis 2

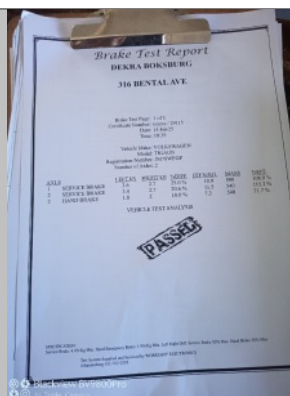


Brake report

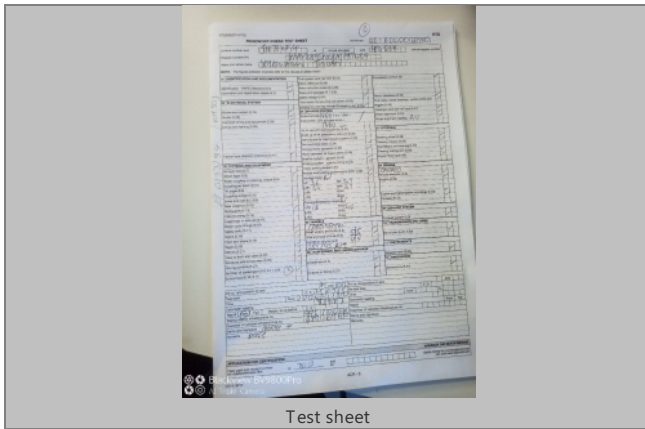


Test sheet




FRONT RIGHT CORNER

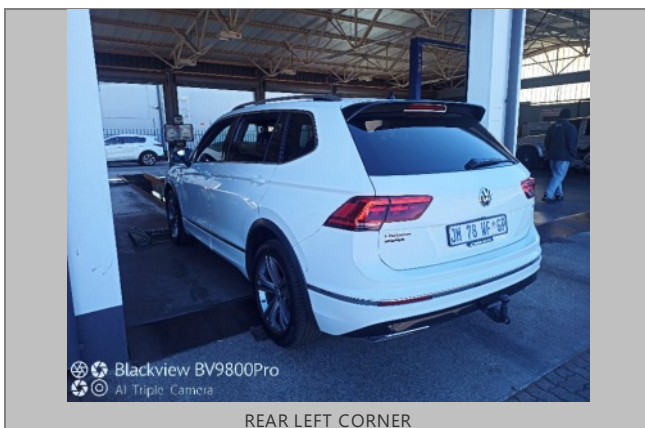


REAR LEFT CORNER

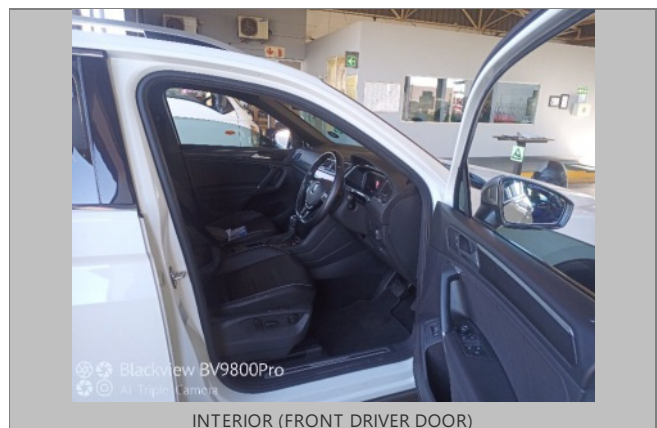

INTERIOR (FRONT DRIVER DOOR)

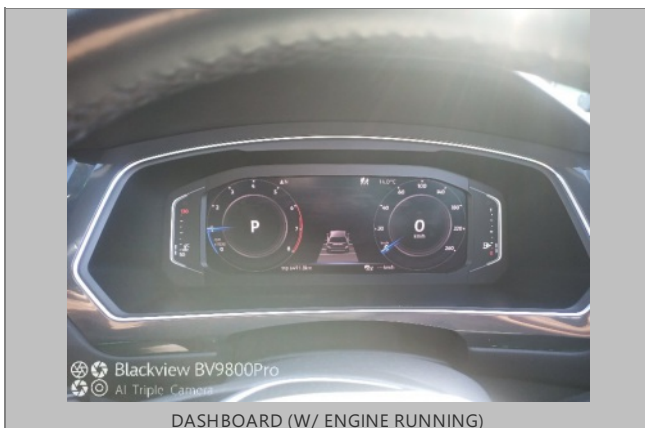

DASHBOARD (W/ ENGINE RUNNING)

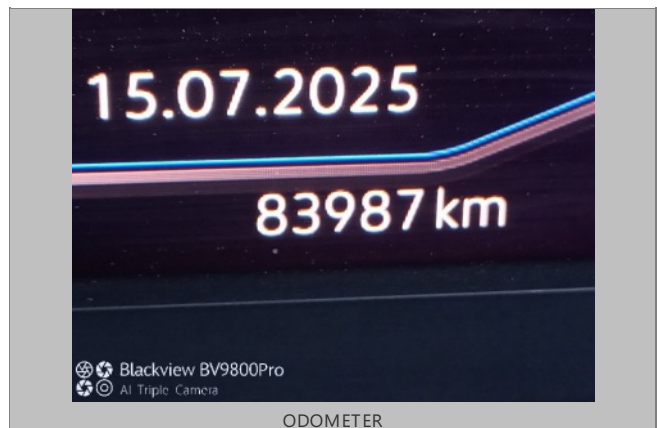


ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT

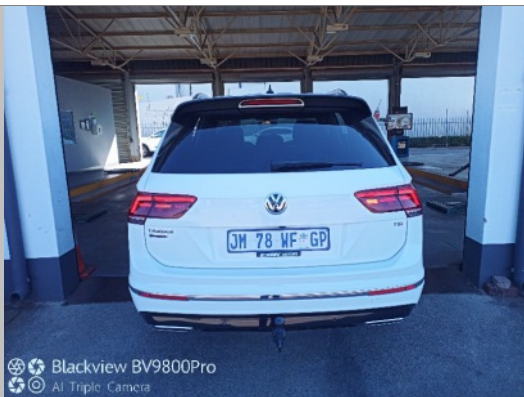


90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

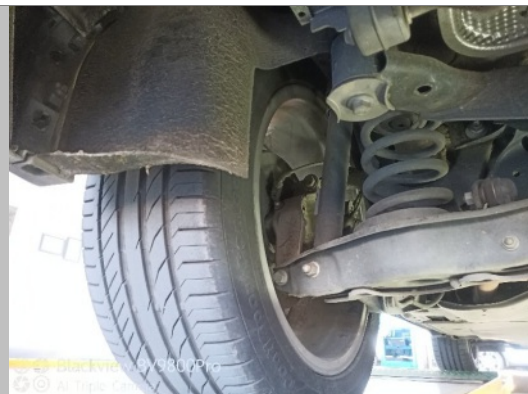


LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

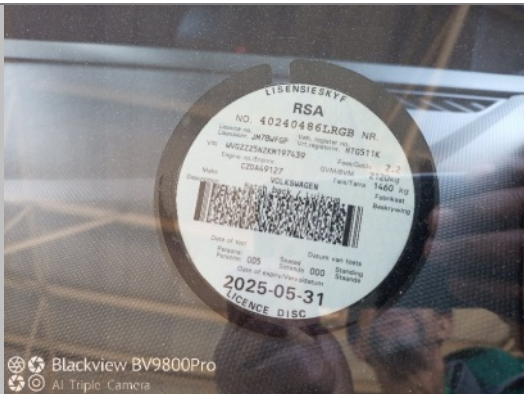

LICENSE DISC



VIN PLATE OR STICKER



CHASSIS



ENGINE 1