



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	04/09/2025		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	04/09/2025		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	FORD	Registration Number	HH35CTGP
Model	FIESTA 1.6 ST 3-DR [2013-2018]	Register Number	XYW534W
VIN	WF0CXXGAKCHM87676	Date Of First Licensing	
Engine Number	HM87676	Last COR	04/09/2025
Doors	2	License Expiry Date	
Color	WHITE	Power / Displacement	134KW/1596CCM
Year Model	2018	Paint Finish	C - COMMON
Km Reading	91,408 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

4 airbags; 2x electrical windows; ABS; Airconditioning auto.; Alarm system; Alloy Wheels; Central locking; Cruise control; El. fold-away mirrors; ESP (el. stability progr.); Fog lights; Handsfree car kit; Leather steering wheel; Multifunction steering wheel; Park sensor; Power steering; Radio cd; Traction control system; Xenon headlights;



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.6	2.5	-	
Rear	1.5	1.7	-	
Emergency / Parking	1.2	1.4	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/40ZR17	84W	Nexen	Nfera	V	4424	4 mm
Front Right	205/40ZR17	84W	Nexen	Nfera	V	4424	4 mm
Rear Left	205/40ZR17	84W	Nexen	Nfera	V	4424	4 mm
Rear Right	205/40ZR17	84W	Nexen	Nfera	V	4024	4 mm
Spare	T 125/80R15	95M	Continental	CST17	V	0000	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Vehicle Dirty

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ON EXTERIOR, INTERIOR, AND MECHANICAL PARTS. Body • Exterior: Cosmetic spraywork done to some body panels. The windscreen had minor chips.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Sparewheel




Oil cap and dipstick




Expansion bottle



Chassis 2

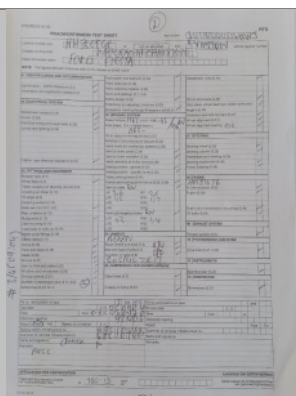

Roadworthy test sheet

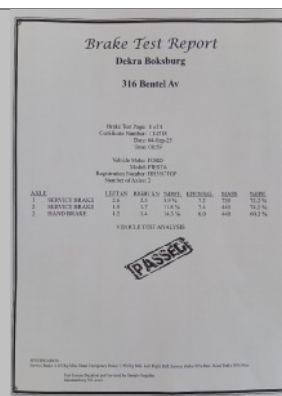

AXLE	LEFT	RIGHT	MAX	MIN	DIFF
1. SERVICE BRAKE	2.8	3.1	3.1%	2.8%	0.3%
2. SERVICE BRAKE	1.8	1.7	1.8%	1.7%	0.1%
3. PARKING BRAKE	1.2	1.1	1.2%	1.1%	0.1%

VEHICLE TEST ANALYSIS

PASSED

Brake test report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT




90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

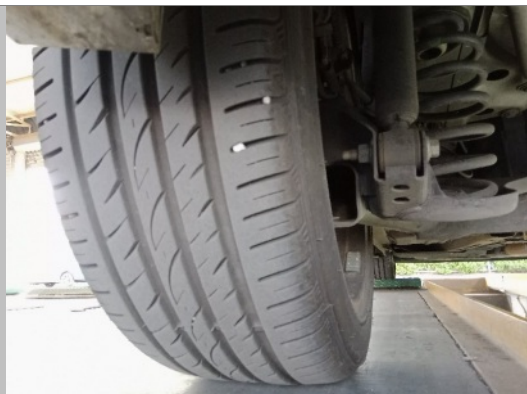

LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



CHASSIS



ENGINE 2



ENGINE 1