



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	27/08/2025		573 Trichard Road - 1459
Inspection Date	27/08/2025		Boksburg - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS
Manufacturer	VOLKSWAGEN	Registration Number	CNP884L
Model	TIGUAN 2.0 TDI TREND&FUN BLUEMOTION DSL [2011-2015]	Register Number	FFN515K
VIN	WVGZZZ5NZDW001656	Date Of First Licensing	
Engine Number		Last COR	27/08/2025
Doors	4	License Expiry Date	
Color	WHITE	Power / Displacement	81kw 1968ccm
Year Model	2012	Paint Finish	C - COMMON
Km Reading	137,465 KM	Fuel	DIESEL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

10 airbags; 4x electrical windows; ABS; Airconditioning; Alarm system; Alloy Wheels; Central locking; Cruise control; El. mirrors; Fog lights; Handsfree car kit; Leather steering wheel; Multifunction steering wheel; Power steering; Radio cd; Rain sensor; Traction control system;



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.5	2.3	-	
Rear	2.1	1.9	-	
Emergency / Parking	1.4	1.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/65R16	98H	Fromway	Ecogreen	V	1925	5 mm
Front Right	215/65R16	98H	Kumho	Ecowing	V	1718	2 mm
Rear Left	215/65R16	98V	Kumho	Ecowing	V	3119	3 mm
Rear Right	215/65R16	98H	Kumho	Ecowing	V	1718	4 mm
Spare	T 145/80R18	99M	Continental	CST17	V	0000	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Engine and gearbox mostly covered underneath.
Body • Exterior: Minor dents, scratches and stone chips on some body panels. Cosmetical spraywork done to some body panels.
Undercarriage: Lower gearbox mounting slightly perished.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER




REAR LEFT CORNER



90 DEGREE REAR



90 DEGREE FRONT

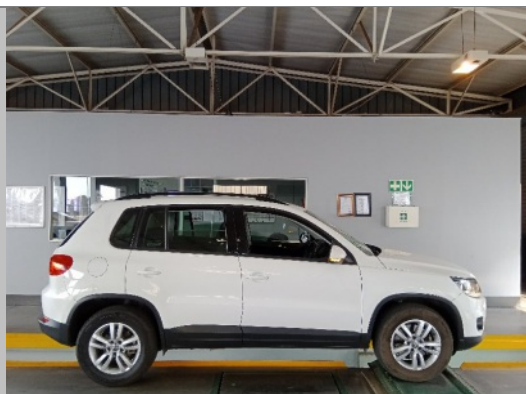

90 DEGREE RIGHT



90 DEGREE LEFT



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



Expansion bottle



Oil cap and dipstick



Chassis 2




CHASSIS




ENGINE 2




ENGINE 1

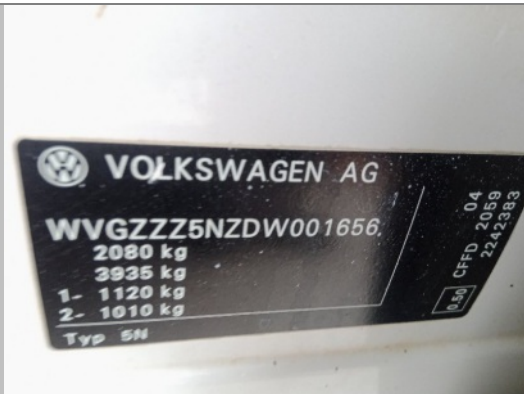


VIN PLATE OR STICKER

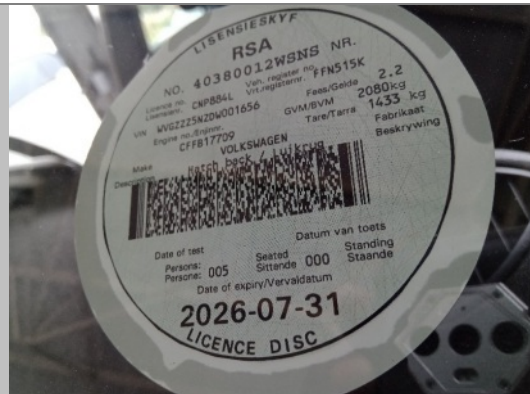

LICENSE DISC

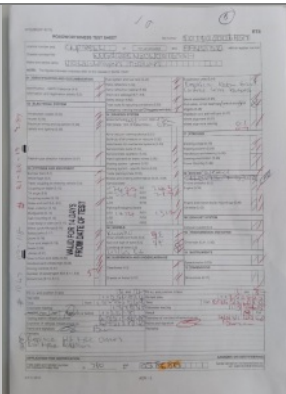

ROADWORTHY TEST SHEET

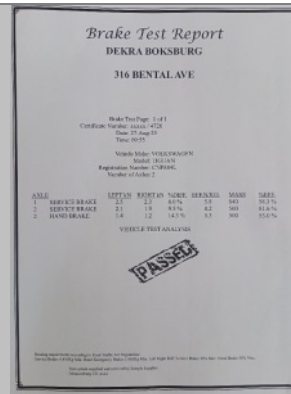

BRAKE TEST REPORT