



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	23/07/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	23/07/2026		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS
Manufacturer	MERCEDES-BENZ	Registration Number	TLZ163GP
Model	E200 K ELEGANCE AT [2004-2006]	Register Number	GYT715S
VIN	WDB2110422A959080	Date Of First Licensing	
Engine Number	27194130755941	Last COR	23/07/2026
Doors	4	License Expiry Date	
Color	SILVER	Power / Displacement	120kw 1797ccm
Year Model	2006	Paint Finish	M - METALLIC
Km Reading	164,591 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items


6 airbags; 4x electrical windows; ABS; Airconditioning auto.; Alarm system; Alloy Wheels; Central locking; Cruise control; El. mirrors; Fog lights; Leather interior; Leather steering wheel; Multifunction steering wheel; Power steering; Radio cd;

VEHICLE INSPECTION



Damage

Repair Way

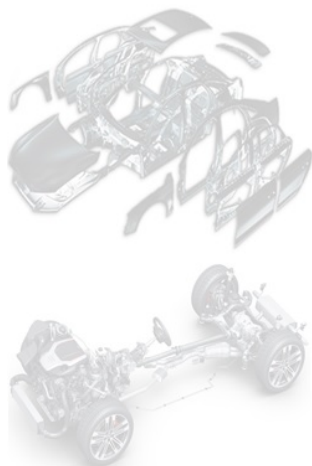

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.9	2.5	-	
Rear	3.3	2.7	-	
Emergency / Parking	2.1	1.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/55R16	95W	Bridgestone	Potenza	V	1617	5 mm
Front Right	225/55R16	95W	Bridgestone	Potenza	V	1617	5 mm
Rear Left	225/55R16	99W	Dunlop	SP Sport	V	3819	5 mm
Rear Right	225/55R16	99W	Dunlop	SP Sport	V	0320	4 mm
Spare	225/55R16	95V	Michelin	Primacy	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Inspection conditions for the vehicle inspection were sufficient



Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Lights: Right side headlight bracket partly broken. Headlight secure.

Body • Exterior: Minor dents, scratches and stone chips on some body panels. Residual traces of cosmetic repairs done to some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE LEFT



90 DEGREE RIGHT



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



Coolant bottle



Warning triangle



Oil cap and dipstick



Chassis 2



CHASSIS



ENGINE 1




ENGINE 2




VIN PLATE OR STICKER



LICENSE DISC MISSING

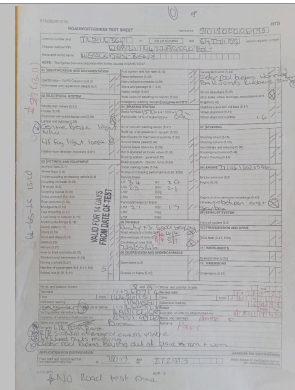

ROADWORTHY TEST SHEET

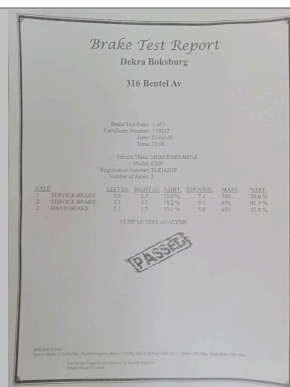

BRAKE TEST REPORT



Air cleaner



Bonnet stay and shocks



Rim Rear Left



Rim Front Right



Rim Rear Right



Belly plates



Belly plates

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDB2110422A959080