



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	25/08/2026		316 Bentel Ave - 1459
Inspection Date	25/08/2026		DEKRA Boksburg - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK CBK MOTORS
Manufacturer	MERCEDES-BENZ	Registration Number	MB93VHGP
Model	SLK 350 ROADSTER 7-SP AT [2004-2008]	Register Number	HPH489S
VIN	WDB1714562F138771	Date Of First Licensing	
Engine Number		Last COR	25/08/2026
Doors	2	License Expiry Date	
Color	BLACK	Power / Displacement	200KW/3498CCM
Year Model	2006	Paint Finish	M - METALLIC
Km Reading	27,117 KM	Fuel	PETROL
Cab / Body Type	COUPE	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items


2 airbags; 2x electrical windows; ABS; Airconditioning auto.; Alarm system; Alloy Wheels; Central locking; Convertible electric roof; Cruise control; Driver's seat with memory; El. mirrors; ESP (el. stability progr.); Fog lights; Handsfree car kit; Headlamp washer; Leather interior; Leather steering wheel; Multifunction steering wheel; Navigation system; On-board computer; Park sensor; Power steering; Radio cd; Rain sensor; Traction control system; Xenon headlights;

VEHICLE INSPECTION



Damage

Repair Way

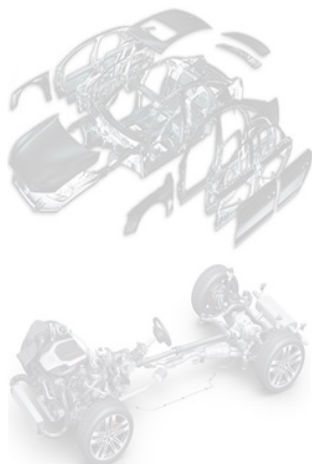

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.7	2.4	-	
Rear	2.0	1.8	-	
Emergency / Parking	1.6	1.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/45R17	91W	Continental	Contact 5	V	0523	5 mm
Front Right	225/45R17	91W	Continental	Contact 5	V	0523	5 mm
Rear Left	245/40R17	91Y	Continental	Contact 5	V	1323	5 mm
Rear Right	245/40R17	91Y	Continental	Contact 5	V	1323	5 mm
Spare	145/70R17	92P	Vredestein	Spacemaster	V	0008	3 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Electrical Components and Instruments: Aircon blower working. Not cooling at time of inspection.
Brakes: Front brake discs slightly dished and ridged.
Undercarriage: Engine, transmission and undercarriage mostly covered underneath.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Oil cap. No sparewheel




Coolant bottle




Sparewheel




AC Blower working

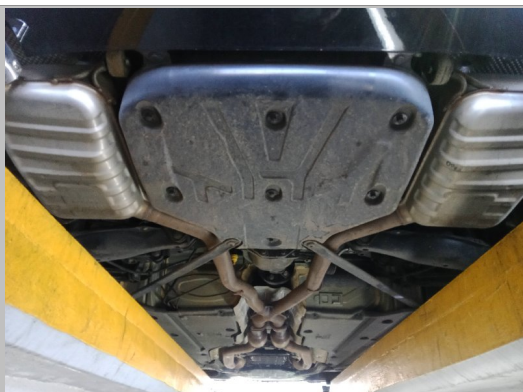



Chassis 2

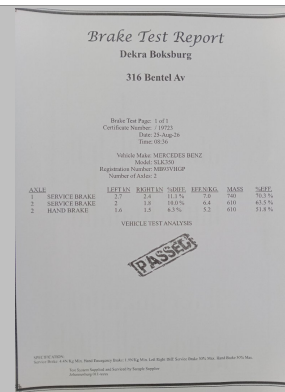

Brake test report

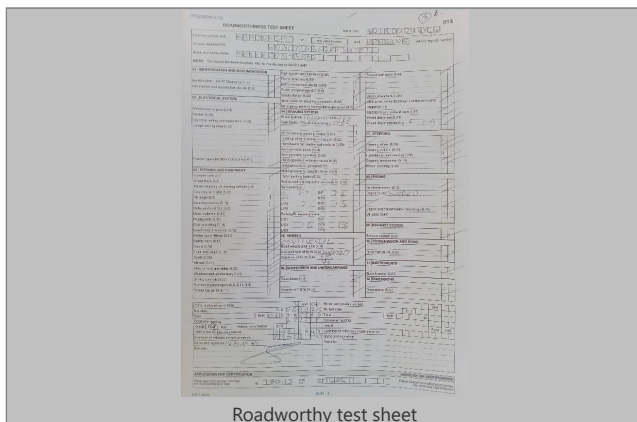Roadworthy test sheet



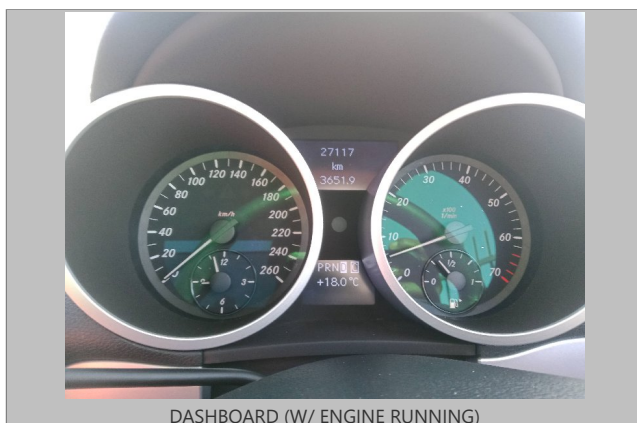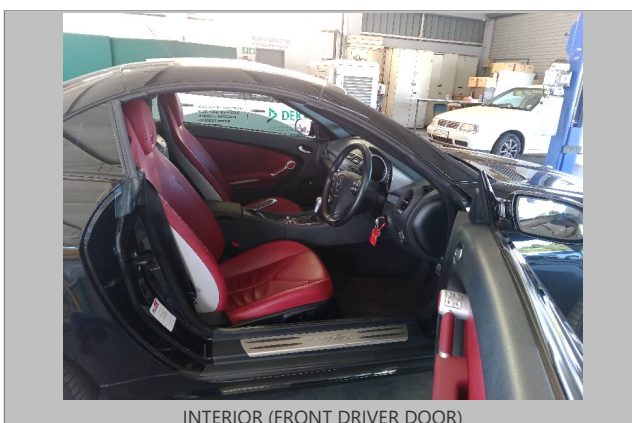

90 DEGREE FRONT




90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

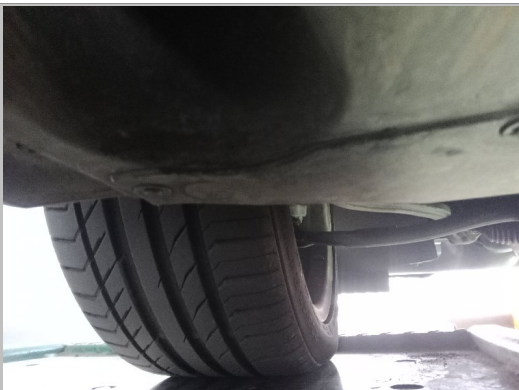

LF TYRE TREAD



LR TYRE TREAD




RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

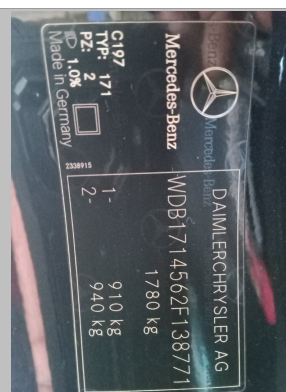

VIN PLATE OR STICKER



ENGINE 1



CHASSIS



ENGINE 2



Door Front Left



Fog Light Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDB1714562F138771