



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	29/06/2026		316 Bentel Ave - 1459
Inspection Date	29/06/2026		DEKRA Boksburg - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	CBK MOTORS
Manufacturer	ISUZU	Registration Number	KZ91CYGP
Model	KB300 DTEQ D-CAB LX DSL PU AT [2007-2010]	Register Number	CRL721K
VIN	ADM2RD85D73446275	Date Of First Licensing	
Engine Number	4JJ1600251	Last COR	30/06/2026
Doors	4	License Expiry Date	
Color	SILVER	Power / Displacement	120kw 2999ccm
Year Model	2008	Paint Finish	M - METALLIC
Km Reading	363,172 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

(Fixed) tow bar; 2 airbags; 4x electrical windows; ABS; Airconditioning; Alarm system; Alloy Wheels; Central locking; Cruise control; El. mirrors; Fog lights; Handsfree car kit; On-board computer; Power steering;

VEHICLE INSPECTION



Damage

Repair Way



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.7	4.0	-	
Rear	4.4	4.1	-	
Emergency / Parking	2.5	2.8	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	245/70R16	107T	Hankook	Dynapro	V	4319	4 mm
Front Right	245/70R16	107T	Hankook	Dynapro	V	4319	3 mm
Rear Left	245/70R16	111S	Nexen	Roadian	V	2522	10 mm
Rear Right	245/70R16	107T	Hankook	Dynapro	V	4219	7 mm
Spare	245/60R16C	111/100T	Continental	Worldcontact	V	00000	1 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Engine wet, not dripping.

Body • Exterior: Minor dents, scratches and stone chips on some body panels. Cosmetical enhancements done to some body panels. Some body panels

Options & Accessories

BULL BAR S TONNEAU COVER MUD FLAPS IDE STEPS LOADING BIN RUBBERIZED ROLL BAR

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

IAN WHITTAKER

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE REAR



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE LEFT



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare tyre



Oil cap and dipstick



Chassis 2



Coolant level



CHASSIS




ENGINE 1



ENGINE 2




VIN PLATE OR STICKER

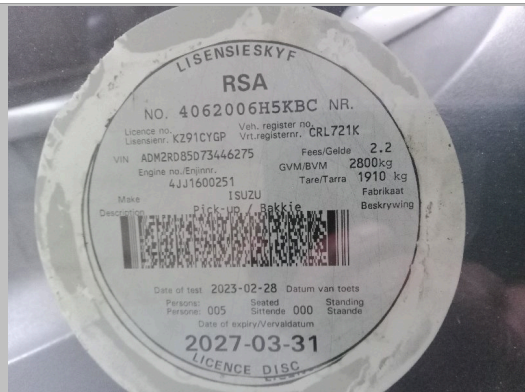

LICENSE DISC



ROADWORTHY TEST SHEET

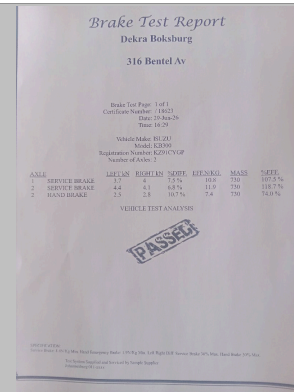

BRAKE TEST REPORT