



## CONDITION REPORT



Report No:  
2017223899  
DATE  
21/04/2026

Private Client

DEKRA Boksburg  
Bentel Ave - 1459  
BOKSBURG - GT  
011 826 4386



## Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	21/04/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	21/04/2026		BOKSBURG - GT

## Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS
Manufacturer	BMW	Registration Number	BZ81ZBGP
Model	320D DSL AT [2012-2016]	Register Number	RNJ519W
VIN	WBA3D36080NP69565	Date Of First Licensing	
Engine Number	76688193	Last COR	
Doors	4	License Expiry Date	30/06/2026
Color	WHITE	Power / Displacement	135KW/1995CCM
Year Model	2013	Paint Finish	C - COMMON
Km Reading	285,621 KM	Fuel	DIESEL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

## Vehicle Options &amp; Accessories

## Items

(Fixed) tow bar; 6 airbags; 4x electrical windows; ABS; Airconditioning auto.; Alarm system; Alloy Wheels; Central locking; Cruise control; El. mirrors; ESP (el. stability progr.); Fog lights; Front armrest; Handsfree car kit; Leather interior; Leather steering wheel; Multifunction steering wheel; On-board computer; Park sensor; Power steering; Rain sensor; Sun roof; Traction control system;

## VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: WBA3D36080NP69565



CONDITION REPORT



Report No:  
2017223899  
DATE  
21/04/2026

Damage

Repair Way



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
Front	2.9	2.8	-	
Rear	3.2	3.3	-	
Emergency / Parking	1.5	1.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/50R17	94W	Bridgestone	Turanza	V	4723	4 mm
Front Right	225/50R17	94W	Bridgestone	Turanza	V	4723	4 mm
Rear Left	225/50R17	94W	Bridgestone	Turanza	V	1418	1 mm
Rear Right	225/50R17	94W	Bridgestone	Turanza	V	0418	1 mm

\* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: WBA3D36080NP69565

**CONDITION REPORT**

Report No:  
2017223899  
DATE  
21/04/2026

**Comments**

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKINGS ARE VISIBLE ON THE EXTERIOR, INTERIOR, ELECTRICAL, AND MECHANICAL PARTS. Lights: Reset fault display on cluster light failures.

Body • Exterior: Minor dents, stone chips, and or scratches on various body panels. Bonnet shocks worn. Cosmetic spray work on various body panels.

**Options & Accessories**

TINTED WINDOWS, CENTRE BRAKE LIGHT,

**Concluding Remarks**

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

**Technician**

Bianca Gleave

This document was created electronically and is valid without signature.

**General Remarks:**

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: WBA3D36080NP69565




CONDITION REPORT




Report No: 2017223899  
DATE 21/04/2026

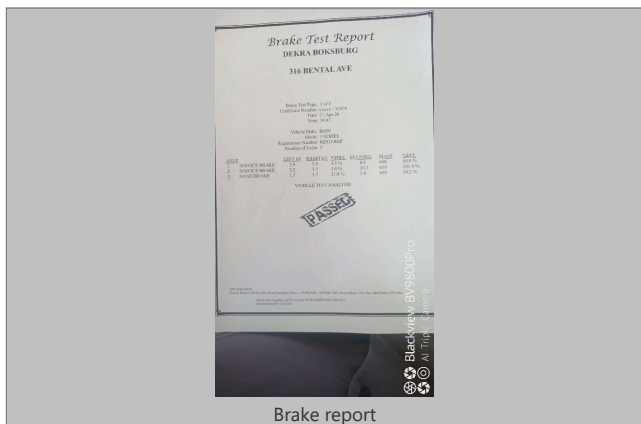


Brake report

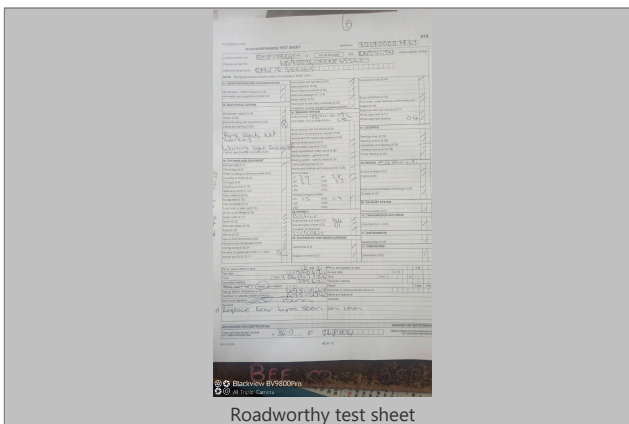

Roadworthy test sheet

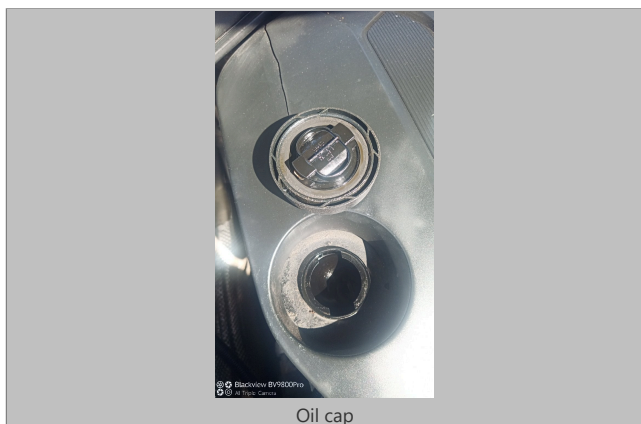

Oil cap

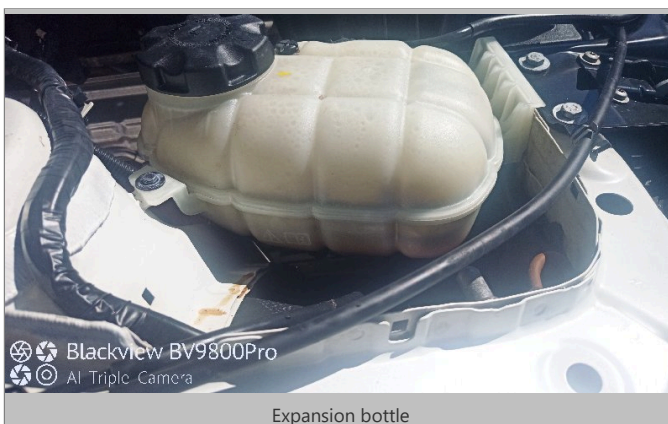

Expansion bottle



No Spare wheel



Partly covered

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: WBA3D36080NP69565



CONDITION REPORT



Report No: 2017223899  
DATE 21/04/2026

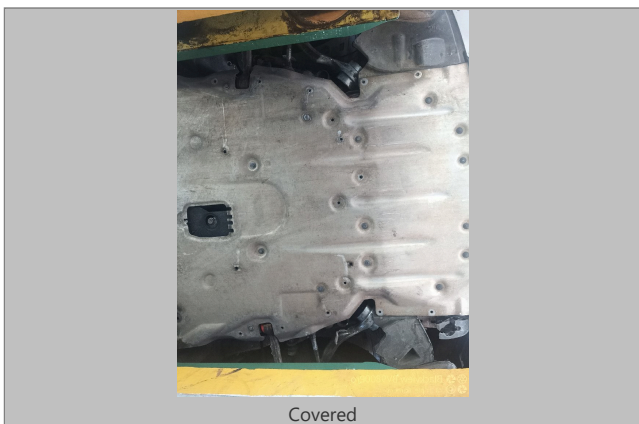


Covered



Chassis 2



FRONT RIGHT CORNER

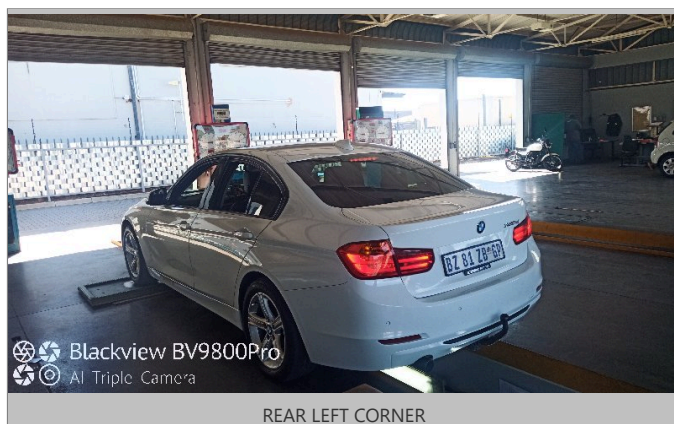

REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: WBA3D36080NP69565




CONDITION REPORT




Report No: 2017223899  
DATE 21/04/2026

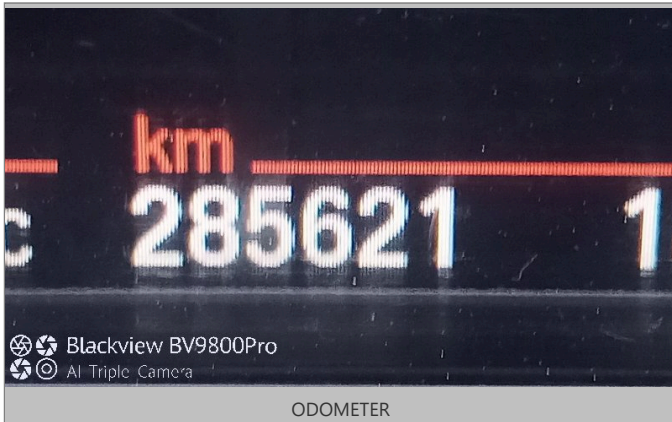


ODOMETER

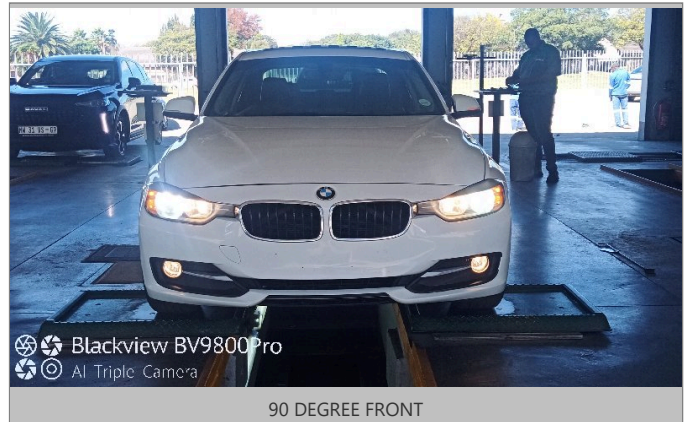


90 DEGREE FRONT

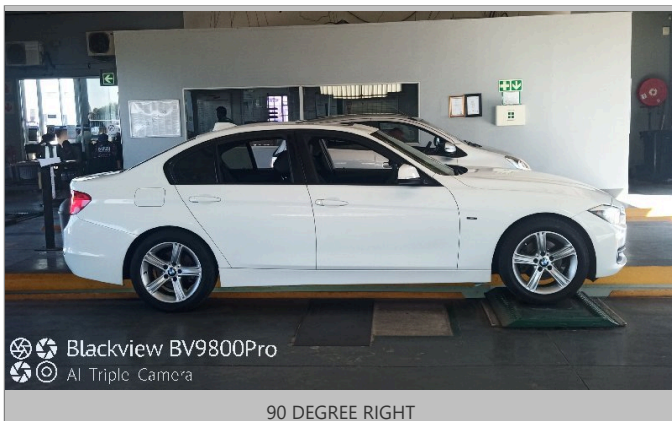

90 DEGREE RIGHT

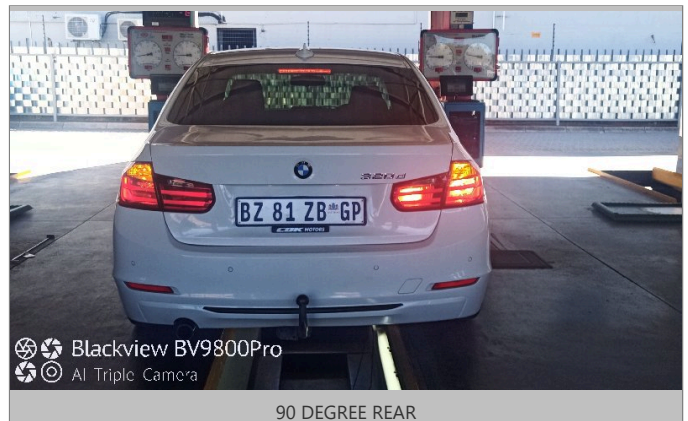

90 DEGREE REAR

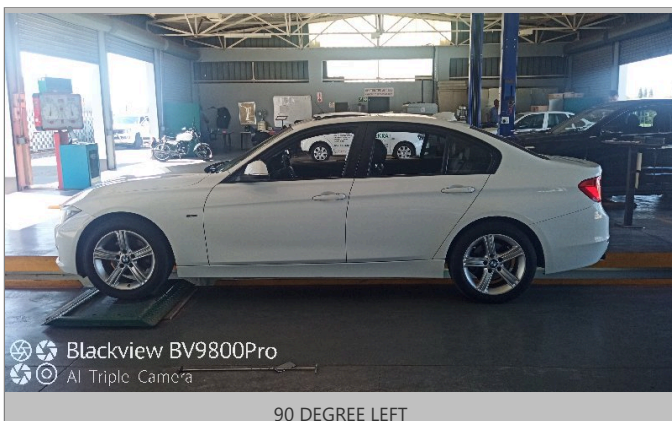

90 DEGREE LEFT



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: WBA3D36080NP69565




CONDITION REPORT



Report No: 2017223899  
DATE 21/04/2026

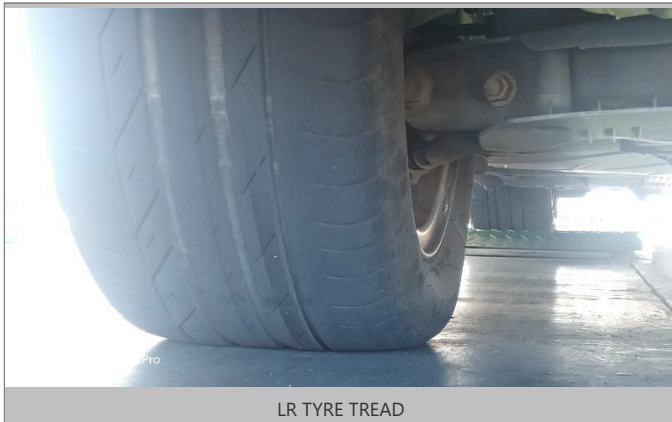

LR TYRE TREAD

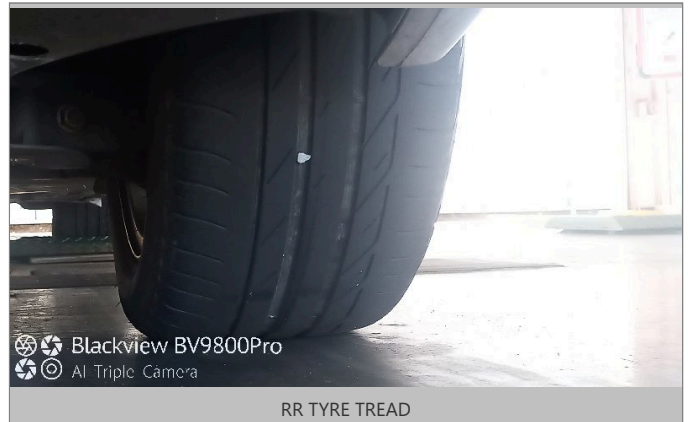

RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: WBA3D36080NP69565



CONDITION REPORT




Report No: 2017223899  
DATE 21/04/2026




Dim Light Right




Fog Light Rear Left

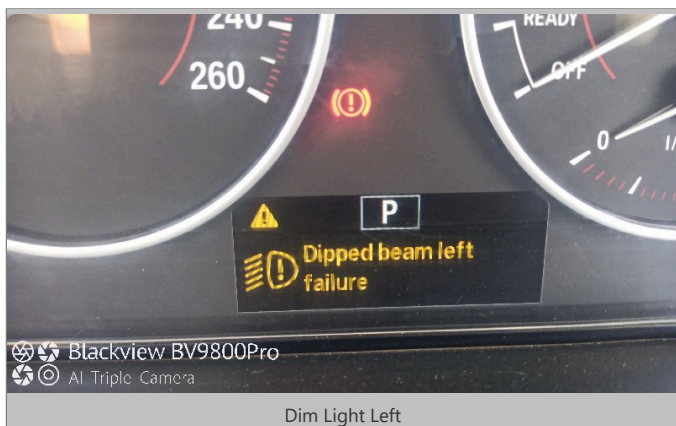

Dim Light Left

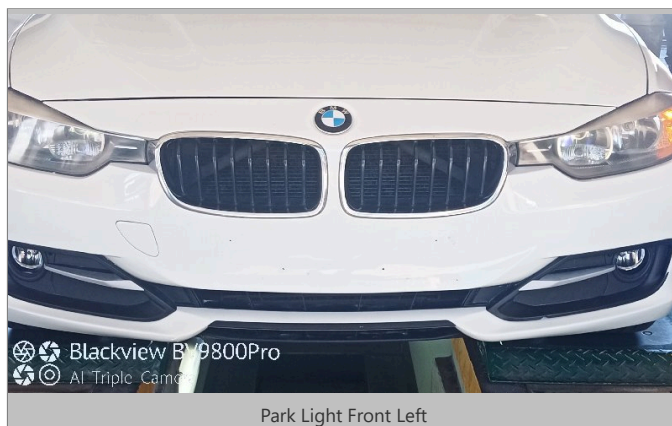

Park Light Front Left

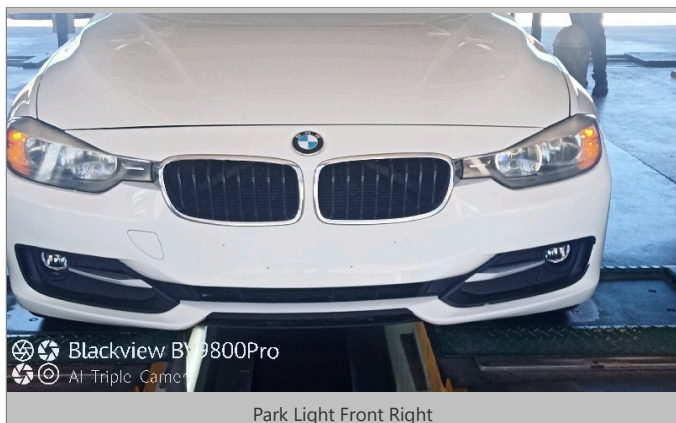

Park Light Front Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: WBA3D36080NP69565