



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	31/08/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	31/08/2026		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	AUDI	Registration Number	CS40VXGP
Model	A6 2.0 TDI MULTITRONIC DSL [2011-2014]	Register Number	FRT479K
VIN	WAUZZZ4G2EN017298	Date Of First Licensing	
Engine Number		Last COR	31/08/2026
Doors	4	License Expiry Date	31/12/2025
Color	SILVER	Power / Displacement	130kw 1968ccm
Year Model	2013	Paint Finish	M - METALLIC
Km Reading	204,203 KM	Fuel	DIESEL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

(Fixed) tow bar; 6 airbags; 4x electrical windows; ABS; Airconditioning auto.; Alarm system; Alloy Wheels; Central locking; Cruise control; El. mirrors; ESP (el. stability progr.); Handsfree car kit; Headlamp washer; Leather interior; Leather steering wheel; Multifunction steering wheel; On-board computer; Park sensor; Power steering; Radio cd; Rain sensor; Sliding roof el.; Traction control system; Xenon headlights;


VEHICLE INSPECTION



Damage

Repair Way

Belly plates Damaged

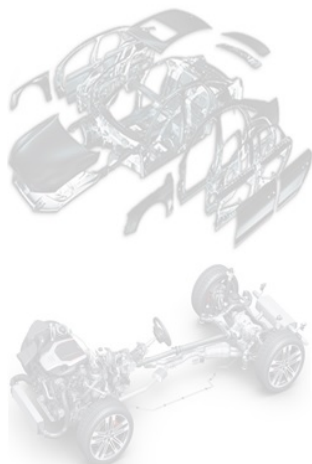

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.0	2.6	-	
Rear	2.2	2.0	-	
Emergency / Parking	1.8	1.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	245/45R18	100Y	Goodyear	Efficient	V	4522	3 mm
Front Right	245/45R18	100Y	Goodyear	Efficient	V	4422	4 mm
Rear Left	245/45R18	100Y	Goodyear	Efficient	V	4921	3 mm
Rear Right	245/45ZR18	100W	Anchee	AC 818	V	4025	5 mm
Spare	T145/60R20	105M	Pirelli	Spare tyre	V	1913	3 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Engine mostly covered underneath.

Body • Exterior: Minor dents, scratches and stone chips on some body panels. Cosmetical enhancements done to some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE


Technician

Tumelo Molekoa


This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

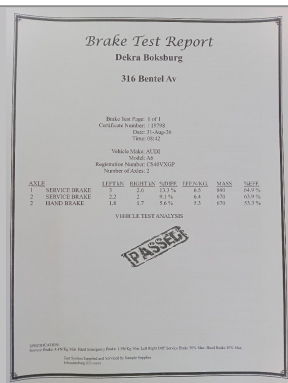

Brake test report

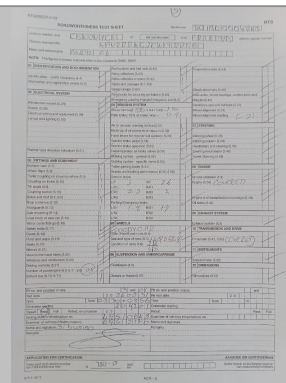

Roadworthy test sheet



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD




RF TYRE TREAD



Sparewheel




LICENSE DISC

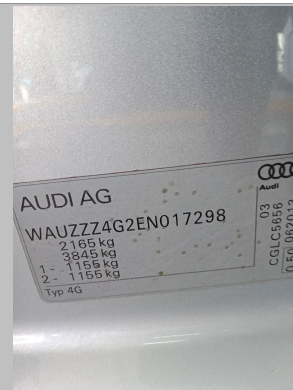

VIN PLATE OR STICKER



ENGINE 1

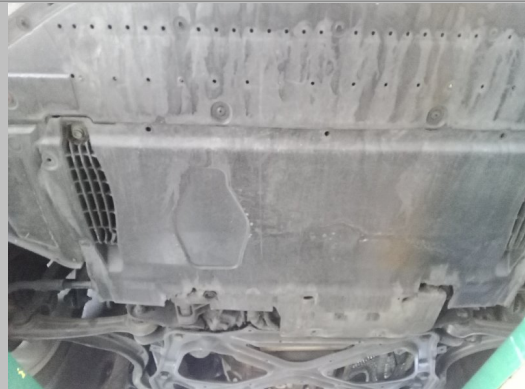

ENGINE 2



CHASSIS



Chassis 2



Warning triangle



Coolant bottle



Aircon working



Oil cap no dipstick



Belly plates

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WAUZZZ4G2EN017298