



Private Client

DEKRA Boksburg  
Bentel Ave - 1459  
BOKSBURG - GT  
011 826 4386



**Assignment**

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	26/03/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	26/03/2026		BOKSBURG - GT

**Vehicle Data**

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS
Manufacturer	HYUNDAI	Registration Number	MH28PSGP
Model	I10 1.1 MOTION 5-DR [2011-2018]	Register Number	SMG343W
VIN	MALAN51BLDM387247	Date Of First Licensing	
Engine Number	G4HGDM647104	Last COR	26/03/2026
Doors	5	License Expiry Date	30/06/2026
Color	WHITE	Power / Displacement	49Kw/1086Cc
Year Model	2013	Paint Finish	C - COMMON
Km Reading	126,438 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

**Vehicle Options & Accessories**

**Items**


2 airbags; 4x electrical windows; Airconditioning; Alarm system; Central locking; El. mirrors; Fog lights; Handsfree car kit; Multifunction steering wheel; On-board computer; Park sensor; Power steering; Radio cd;

**VEHICLE INSPECTION**



Damage

Repair Way

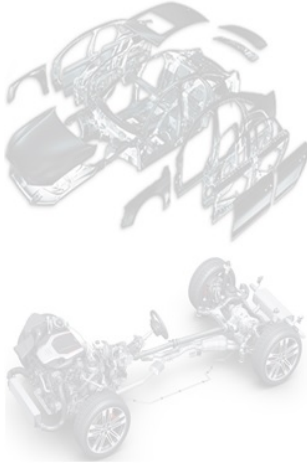

**Brakes**

**Brake Test Results**

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
Front	2.3	1.8	-	
Rear	1.3	1.0	-	
Emergency / Parking	1.2	1	-	

**Tyres and Rims**

**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/60R14	75H	Goodyear	Dura Grip	V	2222	3 mm
Front Right	165/60R14	75H	Goodyear	Dura Grip	V	2222	3 mm
Rear Left	165/60R14	75H	Goodyear	Dura Grip	V	2222	6 mm
Rear Right	165/60R14	75H	Goodyear	Dura Grip	V	2917	3 mm
Spare	165/60R14	75H	Goodyear	Dura Grip	V	0000	6 mm

\* Tyre Legend: V=Virgin, R=Recap

**Diagnostic**

A vehicle diagnostic has not been conducted.

**Inspection Conditions**

Inspection conditions for the vehicle inspection were sufficient



### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Electrical Components and Instruments: Wiper fluid low.  
Body • Exterior: Minor dents stone chips and or scratches on various body panels

### Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician


IAN WHITTAKER

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

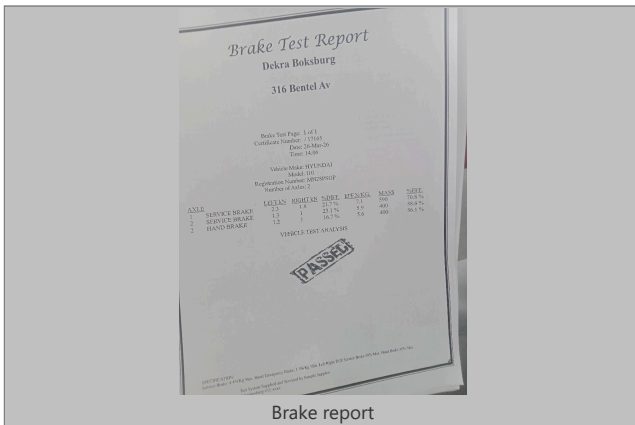


Brake report

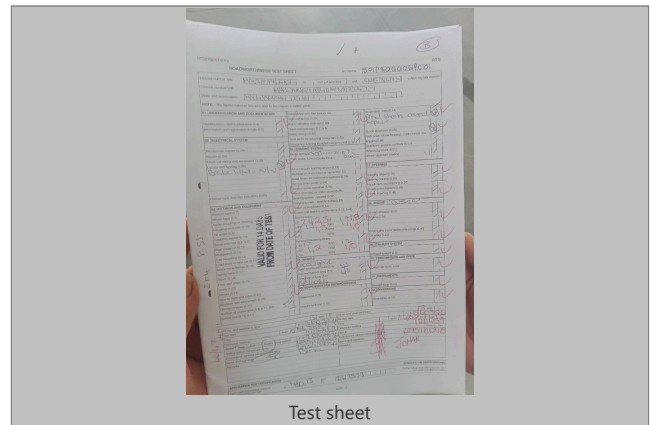

Test sheet



FRONT RIGHT CORNER

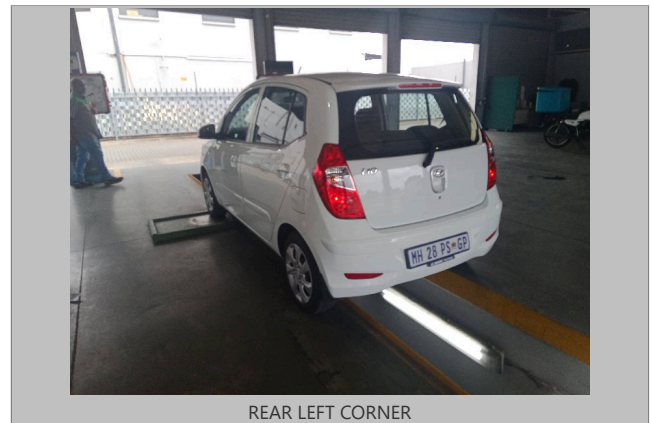

REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD




RR TYRE TREAD



RF TYRE TREAD



Spare tyre

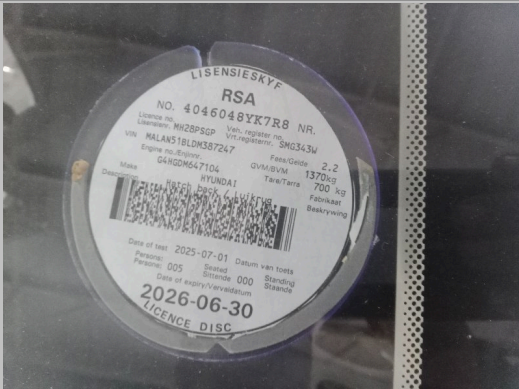

LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Chassis 2



Oil cap and dipstick



Expansion bottle