



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	07/05/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	07/05/2026		BOKSBURG - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	NISSAN	Registration Number	CG22VJGP
Model	NAVARA 2.5 DCI LE 4X4 D-CAB PU DSL AT [2011-2016]	Register Number	RXG136W
VIN	VSKCVND40Z0497244	Date Of First Licensing	
Engine Number		Last COR	07/05/2026
Doors	4	License Expiry Date	31/08/2026
Color	BLUE	Power / Displacement	140KW/2488CCM
Year Model	2012	Paint Finish	M - METALLIC
Km Reading	141,645 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

6 airbags; 4x electrical windows; 4x4; ABS; Airconditioning auto.; Alarm system; Alloy Wheels; Central locking; Cruise control; Detachable tow bar; El. fold-away mirrors; Fog lights; Handsfree car kit; Leather steering wheel; Multifunction steering wheel; Park sensor; Power steering; Radio cd;


VEHICLE INSPECTION



Damage

Repair Way

Tailgate Dented

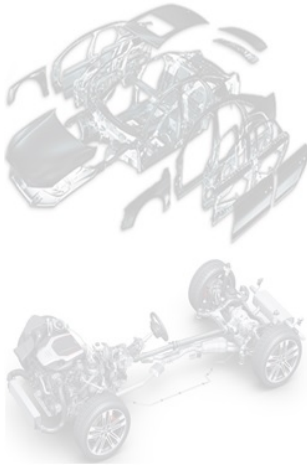

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.3	3.4	-	
Rear	2.6	2.9	-	
Emergency / Parking	2.3	2.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	255/65R17	110H	Dunlop	Grandtrek	V	0922	5 mm
Front Right	255/65R17	110H	Dunlop	Grandtrek	V	0922	5 mm
Rear Left	255/65R17	110H	Dunlop	Grandtrek	V	1122	6 mm
Rear Right	255/65R17	110H	Dunlop	Grandtrek	V	3822	6 mm
Spare	255/65R17	110H	Goodyear	Wrangler	V	0000	8 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL, AND MECHANICAL PARTS. Body • Exterior: Cosmetic enhancements done to some body panels.
Road Test: 4x4 Function not tested

Options & Accessories

ROOF RAILS, SIDESTEPS

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician


Tumelo Molekoa

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

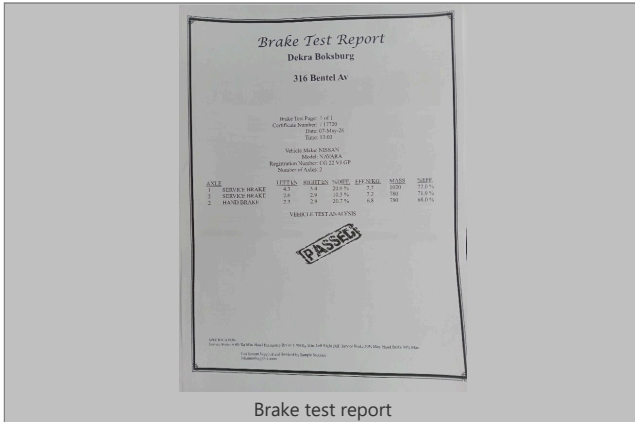

Brake test report

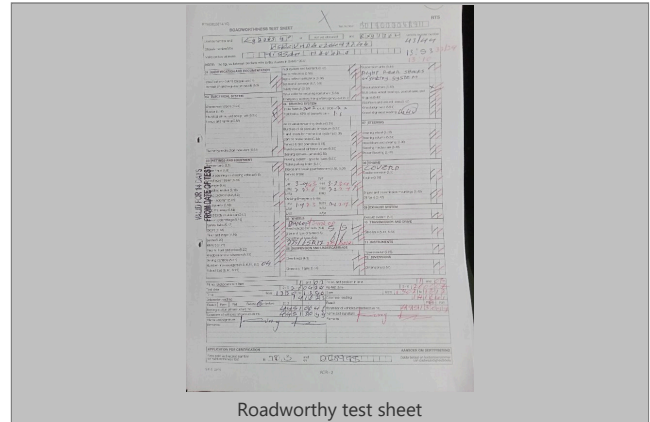

Roadworthy test sheet

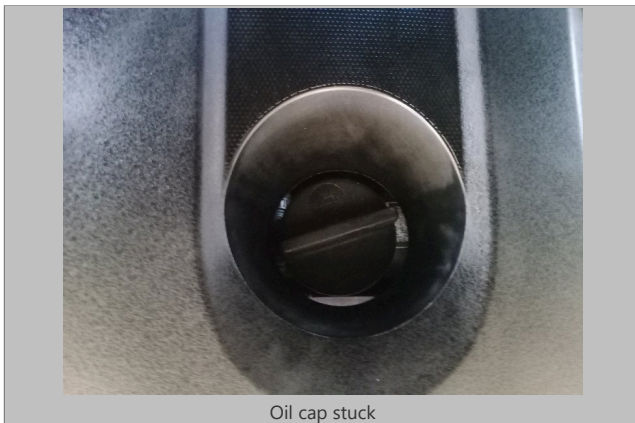

Oil cap stuck



Coolant bottle



Sparewheel



Chassis 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT




90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

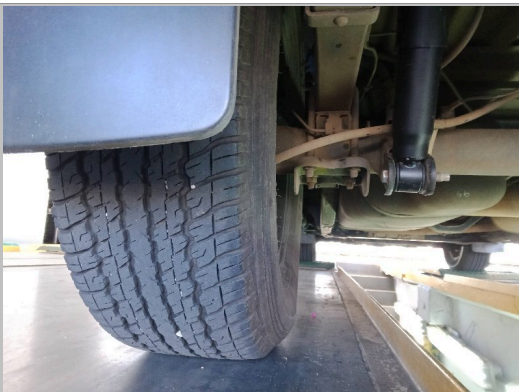


LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

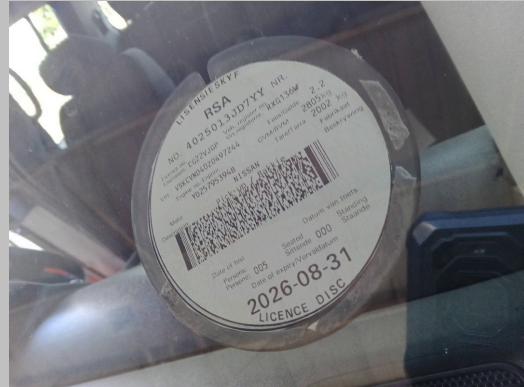

LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



CHASSIS



ENGINE 2



Tailgate

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VSKCVND40Z0497244