



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	17/08/2026		573 TRICHARD ROAD - 1459
Inspection Date	17/08/2026		BOKSBURG DEKRA -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	Z STRYDOM
Manufacturer	SUZUKI	Registration Number	BJ39NZZN
Model	JIMNY 1.3 4X4 [2012-2014]	Register Number	SBB462W
VIN	JSAFJB43V00567583	Date Of First Licensing	
Engine Number	M13A2316121	Last COR	17/08/2026
Doors	3	License Expiry Date	
Color	WHITE	Power / Displacement	62kw 1328ccm
Year Model	2013	Paint Finish	C - COMMON
Km Reading	141,430 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items


2 airbags; 2x electrical windows; 4x4; ABS; Airconditioning; Alarm system; Alloy Wheels; Central locking; Detachable tow bar; El. mirrors; Fog lights; Handsfree car kit; Radio / Cassette;

VEHICLE INSPECTION



Damage

Repair Way

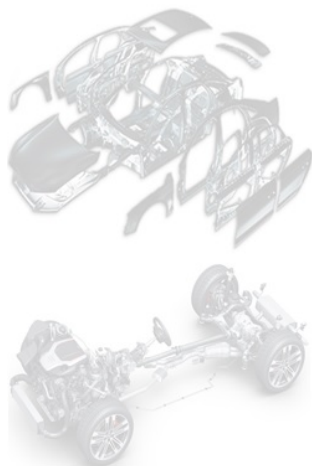

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.1	2.3	-	
Rear	1.9	1.7	-	
Emergency / Parking	1.7	1.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/75R15	102T	Goodyear	Wrangler	V	1719	4 mm
Front Right	205/75R15	102T	Goodyear	Wrangler	V	1719	4 mm
Rear Left	205/75R15	102T	Goodyear	Wrangler	V	1719	2 mm
Rear Right	205/75R15	102T	Goodyear	Wrangler	V	2618	3 mm
Spare	205/75R15	102T	Goodyear	Wrangler	V	1719	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Inspection conditions for the vehicle inspection were sufficient



Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE NORMAL WEAR AND TEAR MARKS ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Dipstick handle repaired.

Body • Exterior: Windscreen chipped. Not in direct view. Minor dents, scratches and stone chips on some body panels. Cosmetical enhancements done to some body panels.

Undercarriage: Chassis sprayed with chassis black.

Road Test: 4x4 Function not tested. Drivetrain whining noise during road test.

Options & Accessories

NUDGE BAR, ROOF RAILS

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Oil cap and dipstick



Coolant bottle




Sparewheel




Chassis 2



Aircon working

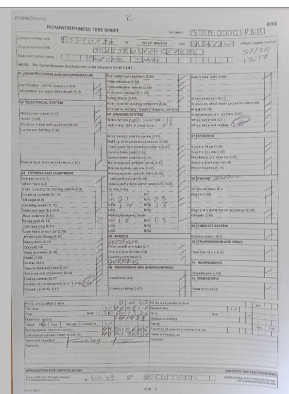


ADDITIONAL 11

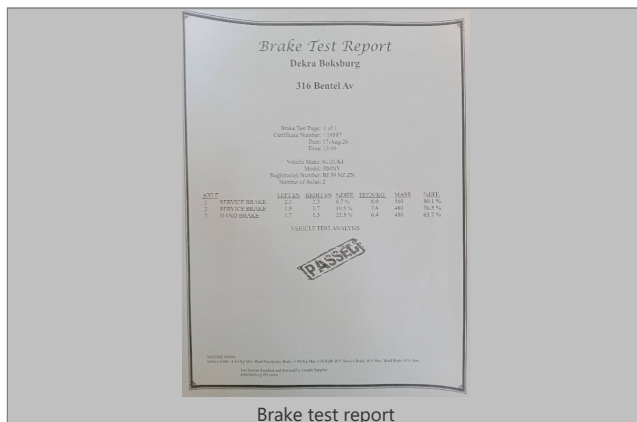


Brake test report




FRONT RIGHT CORNER

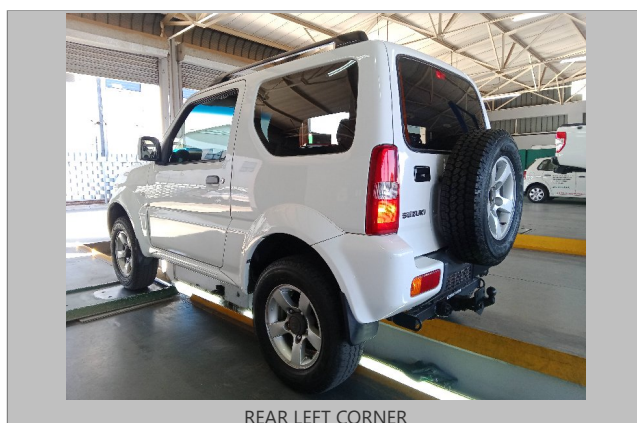


REAR LEFT CORNER

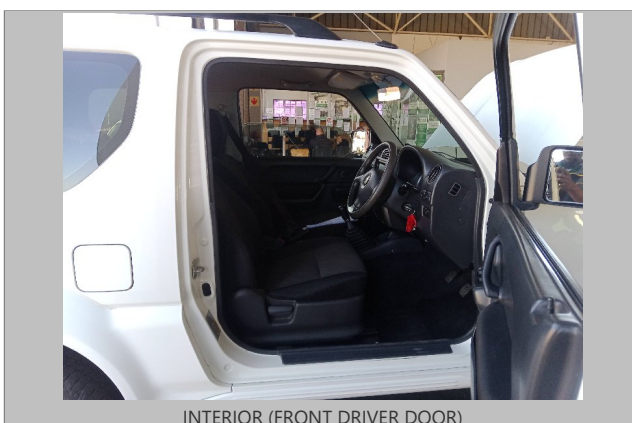

INTERIOR (FRONT DRIVER DOOR)

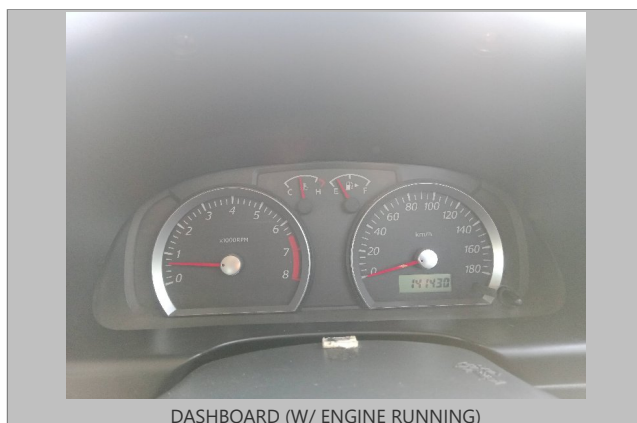

DASHBOARD (W/ ENGINE RUNNING)

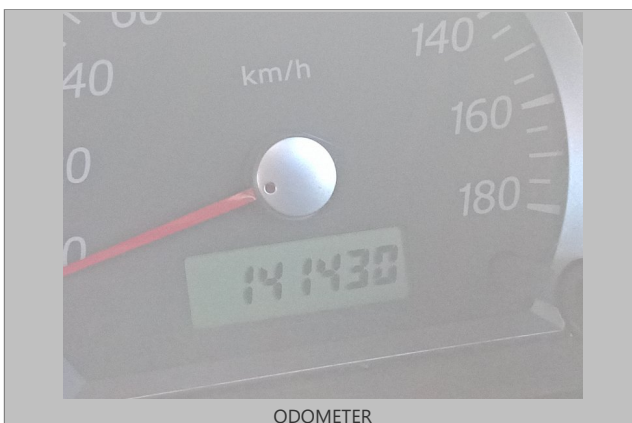

ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT




LF TYRE TREAD




LR TYRE TREAD



RR TYRE TREAD

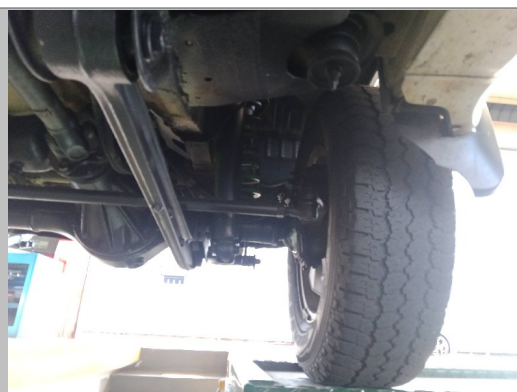

RF TYRE TREAD

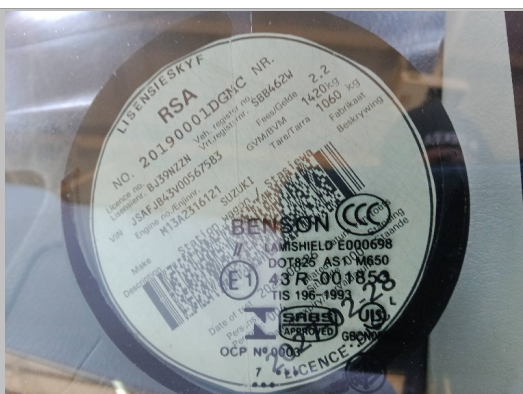

LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



CHASSIS



ENGINE 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JSAFJB43V00567583