



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	27/08/2026		316 Bentel Ave - 1459
Inspection Date	27/08/2026		DEKRA Boksburg - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	MERCEDES-BENZ	Registration Number	CY58SZZN
Model	CLA 180 [2013-2014]	Register Number	VDP953W
VIN	WDD1173422N117569	Date Of First Licensing	
Engine Number		Last COR	27/08/2026
Doors	4	License Expiry Date	
Color	WHITE	Power / Displacement	90kw 1595ccm
Year Model	2014	Paint Finish	C - COMMON
Km Reading	123,959 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items


6 airbags; 4x electrical windows; ABS; Airconditioning; Alarm system; Alloy Wheels; Central locking; Cruise control; El. mirrors; ESP (el. stability progr.); Handsfree car kit; Leather interior; Leather steering wheel; Multifunction steering wheel; Park sensor; Radio / Cassette; Radio cd; Rain sensor; Sliding roof el.; Xenon headlights;

VEHICLE INSPECTION



Damage

Repair Way

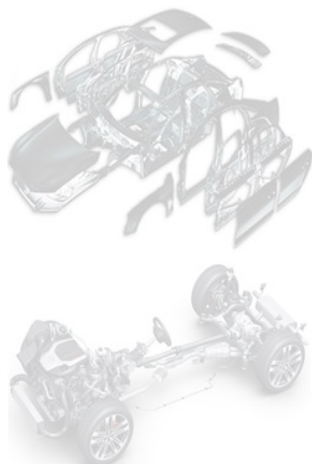

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.6	3.5	-	
Rear	2.5	2.6	-	
Emergency / Parking	1.9	2.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/40R18	92W	I Link	L Zeal	V	1326	5 mm
Front Right	225/40R18	92W	I Link	L Zeal	V	1826	5 mm
Rear Left	225/40R18	92W	I Link	L Zeal	V	1326	5 mm
Rear Right	225/40R18	92W	I Link	L Zeal	V	1326	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient



Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE NORMAL WEAR AND TEAR MARKS ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Top right side engine mounting rubber perished and soft. Splash cover wet not dripping. Electrical Components and Instruments: Driver airbag malfunction warning, intermittent illumination. Body • Exterior: Minor dents, scratches and stone chips on some body panels. Cosmetical enhancements done to some body panels. Brakes: Rear brake discs dished. Undercarriage: Engine, transmission and undercarriage mostly covered underneath.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Chassis 2



Oil cap and dipstick




Coolant bottle




No sparewheel



Triangle

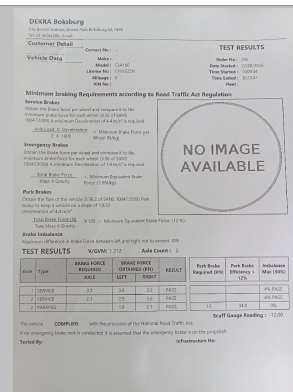

Brake report

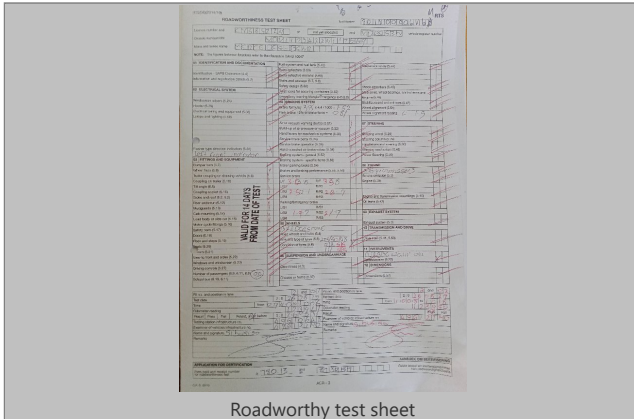

Roadworthy test sheet



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC




VIN PLATE OR STICKER



CHASSIS



ENGINE 2

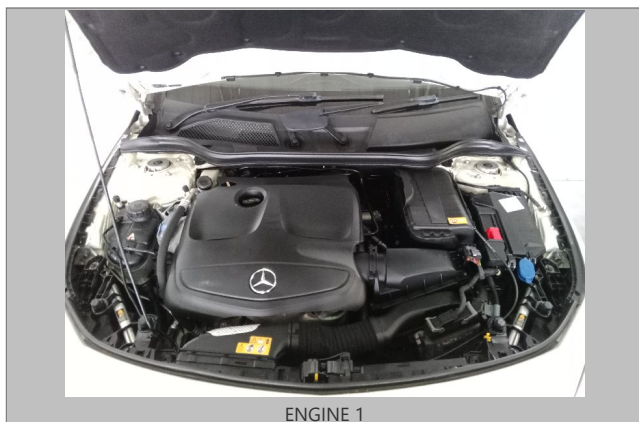

ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDD1173422N117569