



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	31/08/2026		316 Bentel Ave - 1459
Inspection Date	31/08/2026		DEKRA Boksburg - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS
Manufacturer	LEXUS	Registration Number	FC59BSGP
Model	LEXUS IS	Register Number	GGK022L
VIN	JTHBA1D2605010671	Date Of First Licensing	
Engine Number	8ARZ013174	Last COR	31/08/2026
Doors	4	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2016	Paint Finish	C - COMMON
Km Reading	93,531 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items


(Fixed) tow bar; 1 airbag; 8 airbags; 4x electrical windows; ABS; Airconditioning auto.; Alarm system; Alloy Wheels; Central locking; Cruise control; Driver's seat elec.; El. fold-away mirrors; ESP (el. stability progr.); Fog lights; Handsfree car kit; Headlamp washer; Leather interior; Leather steering wheel; Multifunction steering wheel; Park sensor; Power steering; Radio cd; Rain sensor; Seat heating; Traction control system;

VEHICLE INSPECTION



Damage

Repair Way

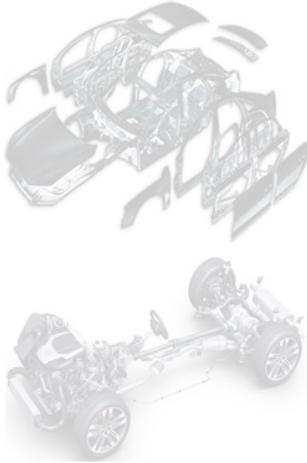

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.1	3.4	-	
Rear	3.3	3.1	-	
Emergency / Parking	2.3	2.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/45R17	94Y	Dunlop	Sportmax	V	2024	2 mm
Front Right	225/45R17	94Y	Dunlop	Sportmax	V	2024	2 mm
Rear Left	225/45R17	94Y	Dunlop	Sportmax	V	2024	3 mm
Rear Right	225/45R17	94Y	Dunlop	Sportmax	V	2024	2 mm
Spare	T125/70D17	98M	Yokohama	Temporary	V	3315	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Inspection conditions for the vehicle inspection were sufficient



Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE NORMAL WEAR AND TEAR MARKS ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Engine and transmission mostly covered underneath. Electrical Components and Instruments: Tyre pressure warning illuminated at time of inspection.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE RIGHT




90 DEGREE LEFT



90 DEGREE FRONT



90 DEGREE REAR

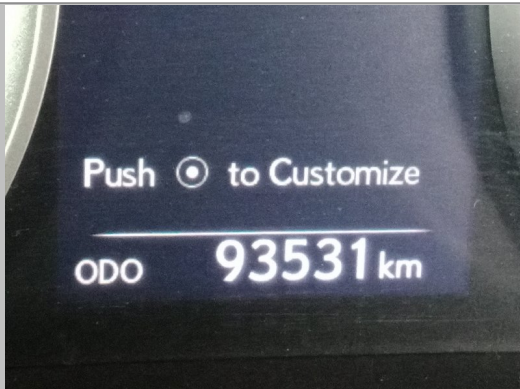

ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



LF TYRE TREAD



RF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



Sparewheel



Coolant bottle



Oil cap stuck



Airconditioning working



Chassis 2




ENGINE 1




ENGINE 2




CHASSIS

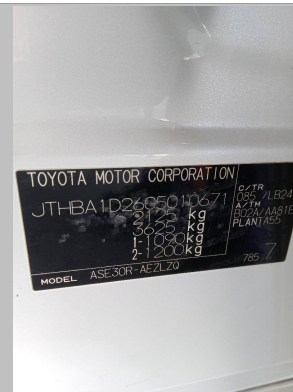


VIN PLATE OR STICKER

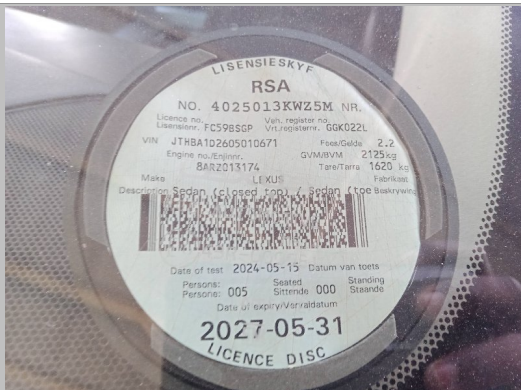

LICENSE DISC

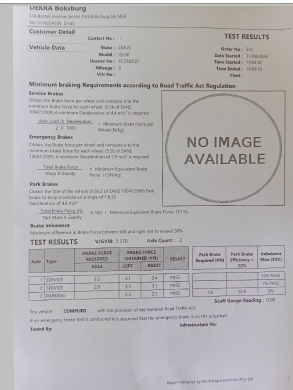

BRAKE TEST REPORT

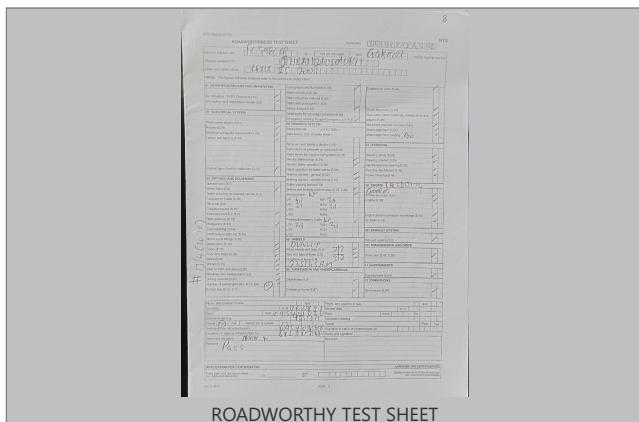The image shows a detailed roadworthy test sheet from DEKRA. It includes sections for vehicle identification, inspection details, and a comprehensive checklist of components to be inspected. Handwritten notes and signatures are visible throughout the form, indicating a completed inspection.

ROADWORTHY TEST SHEET

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTHBA1D2605010671