



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	24/07/2026		316 Bentel Ave - 1459
Inspection Date	24/07/2026		DEKRA Boksburg - GT

Vehicle Data


Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK CBK MOTORS
Manufacturer	RENAULT	Registration Number	FS70NJGP
Model	CLIO	Register Number	WYH071W
VIN	VF15R5A0H55024146	Date Of First Licensing	
Engine Number	H4BA400D249041	Last COR	24/07/2026
Doors	4	License Expiry Date	31/03/2027
Color	WHITE	Power / Displacement	66kw 898ccm
Year Model	2016	Paint Finish	C - COMMON
Km Reading	31,604 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

4 airbags; 2x electrical windows; ABS; Airconditioning; Alarm system; Alloy Wheels; Central locking; Cruise control; El. mirrors; Fog lights; Handsfree car kit; Leather steering wheel; Multifunction steering wheel; Power steering; Radio / Cassette;

VEHICLE INSPECTION

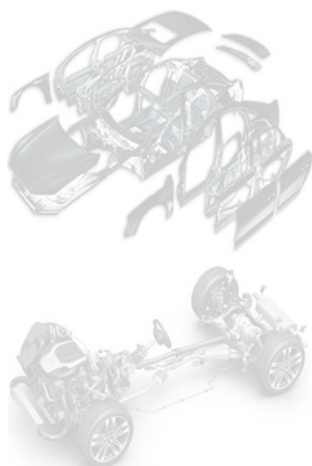

Damage

Repair Way

Rim Front Left Scratched
Rim Front Right Scratched
Rim Rear Left Scratched
Rim Rear Right Scratched

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.9	2.4	-	
Rear	1.8	1.3	-	
Emergency / Parking	1.3	1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/55R16	87H	Continental	Contact 5	V	1216	2 mm
Front Right	195/55R16	87H	Continental	Contact 5	V	1216	2 mm
Rear Left	195/55R16	87H	Continental	Contact 5	V	1216	5 mm
Rear Right	195/55R16	87H	Continental	Contact 5	V	1116	5 mm
Spare	185/65R15	88T	Barum	Brillantis	V	1016	6 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Inspection conditions for the vehicle inspection were sufficient



Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Engine, gearbox and undercarriage mostly covered underneath.
Electrical Components and Instruments: Service warning light illuminated at time of inspection.
Body • Exterior: Cosmetical enhancements done to some body panels.

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician


Tumelo Molekoa

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

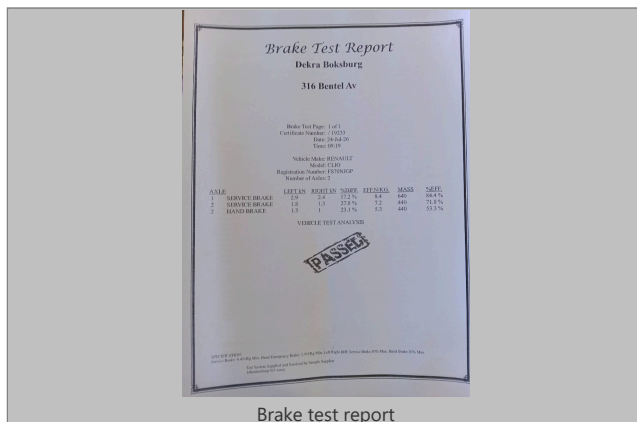

Brake test report

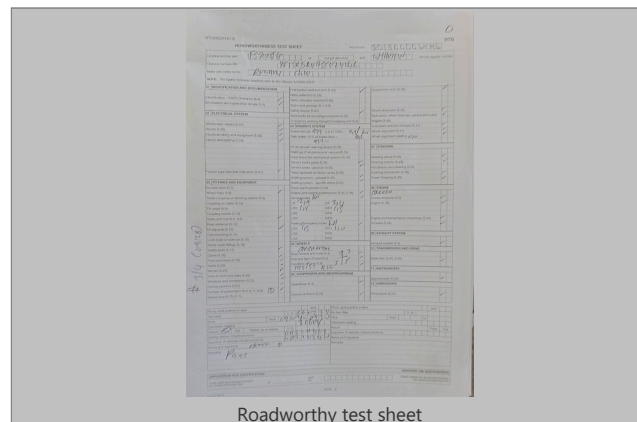


Roadworthy test sheet

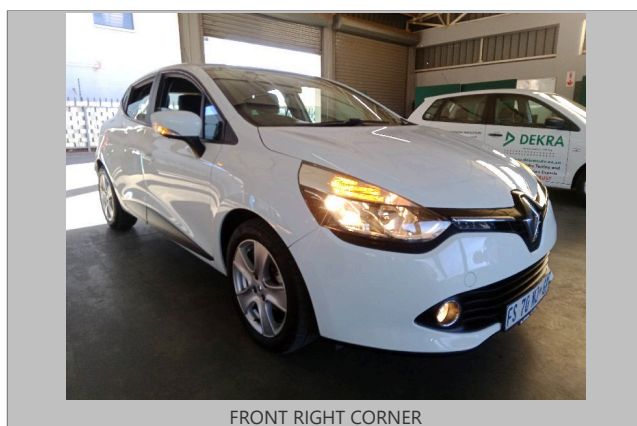


FRONT RIGHT CORNER



REAR LEFT CORNER

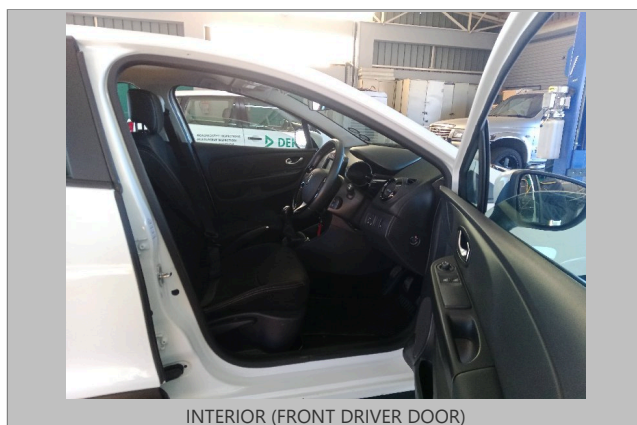

INTERIOR (FRONT DRIVER DOOR)

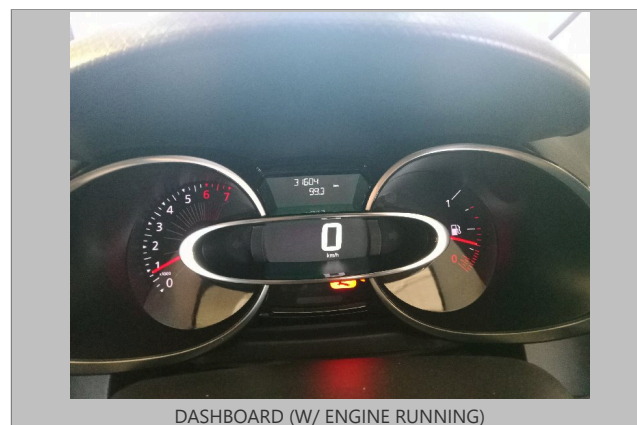

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LR TYRE TREAD



LF TYRE TREAD




RR TYRE TREAD




RF TYRE TREAD



Sparewheel

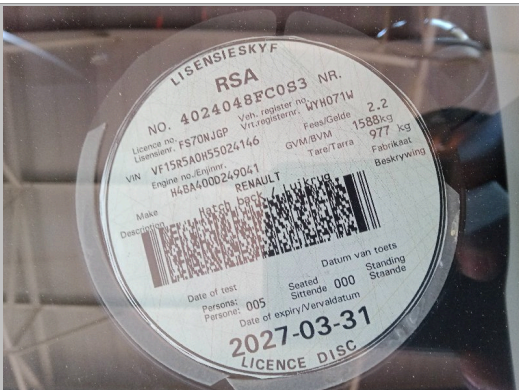

LICENSE DISC

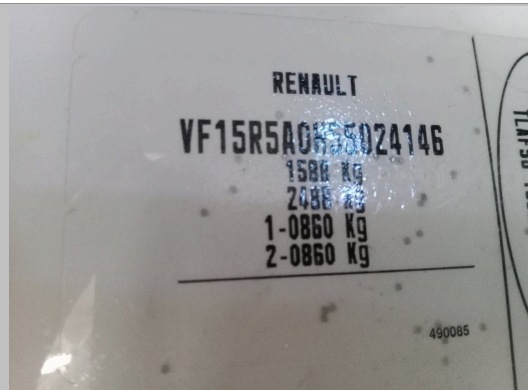

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS




Chassis 2



Aircon working



Coolant bottle

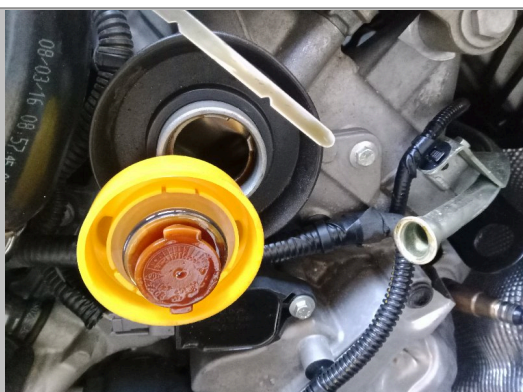

Oil cap and dipstick



Rim Front Left



Rim Rear Left



Rim Rear Right



Rim Front Right