



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	13/07/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	13/07/2026		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	VOLKSWAGEN	Registration Number	NANAS7GP
Model	TIGUAN 2.0 TSI HIGHLINE 4MOTION 162KW DSG [2016-2019]	Register Number	HFX903K
		Date Of First Licensing	
VIN	WVGZZZ5NZJW841392	Last COR	13/07/2026
Engine Number	CHH231022	License Expiry Date	30/11/2026
Doors	5	Power / Displacement	162Kw/1984Cc
Color	WHITE	Paint Finish	C - COMMON
Year Model	2017	Fuel	PETROL
Km Reading	105,488 KM	Transmission	AUTOMATIC
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

6 airbags; 4x electrical windows; 4x4; ABS; Airconditioning; Airconditioning auto.; Alarm system; Alloy Wheels; Car phone preparation; Central locking; Cruise control; Driver's seat elec.; Driver's seat with memory; El. fold-away mirrors; El. mirrors; ESP (el. stability progr.); Fog lights; Front armrest; Handsfree car kit; Leather interior; Leather steering wheel; Multifunction steering wheel; Navigation system; On-board computer; Park sensor; Power steering; Radio / Cassette; Seat heating; Sliding roof el.; Sun roof; Traction control system; Xenon headlights;

VEHICLE INSPECTION



Damage

Repair Way



Brakes

Brake Test Results

Brake efficiency tested during road test.

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	255/40R20	101Y	Black Hawk	Hiscend	V	1622	4 mm
Front Right	255/40R20	101Y	Black Hawk	Hiscend	V	2622	4 mm
Rear Left	255/40R20	101Y	Black Hawk	Hiscend	V	2622	5 mm
Rear Right	255/40R20	101Y	Black Hawk	Hiscend	V	0320	5 mm
Spare	T145/85R18	103M	Continental	Temp	V	0000	4 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents stone chips and or Scratches on various body panels.

Brakes: 4 Motion AWD, brakes tested on road test and incline test on park brake Bonnet insulation lose replace clips

Axle and Suspension: Control arm bushings on left and right front Control arms are Slightly perished.

Undercarriage: Mostly covered

Options & Accessories

TINTED WINDOWS, CENTRE BRAKE LIGHT, ROOF RAILS, BOOT SPOILER,

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE


Technician

Bianca Gleave

This document was created electronically and is valid without signature.

General Remarks:


The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

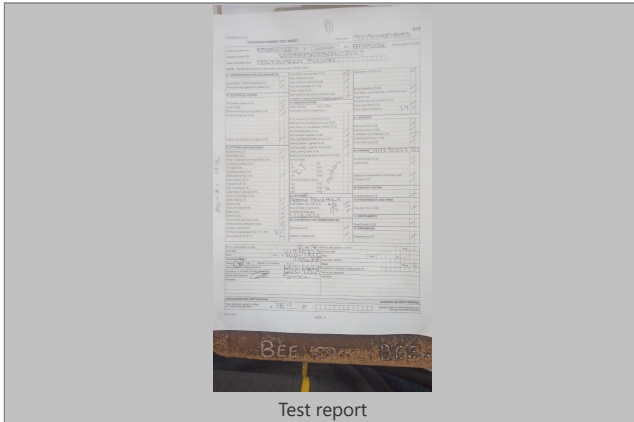

Test report



FRONT RIGHT CORNER

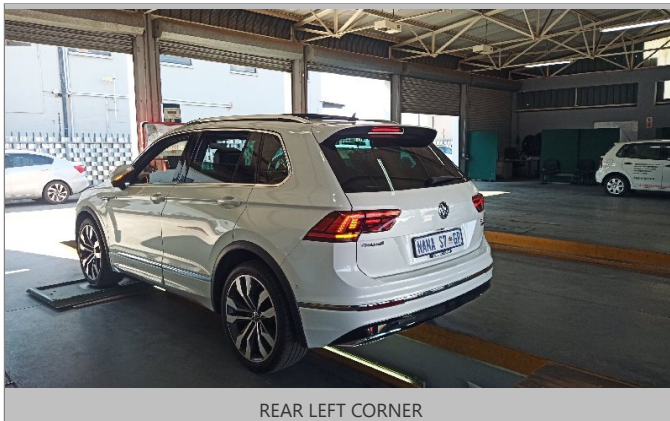


REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

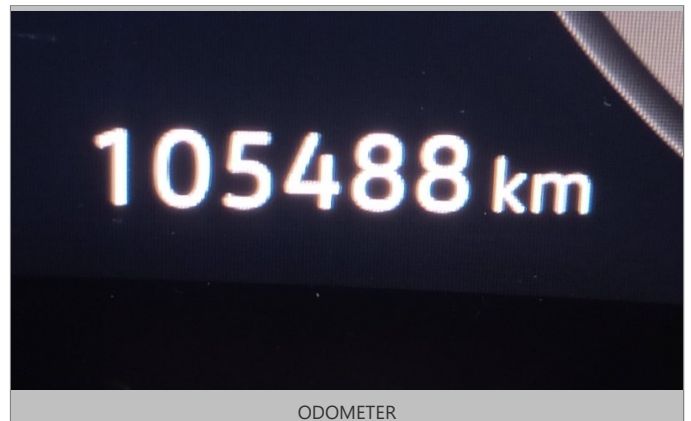

ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT




LF TYRE TREAD



LR TYRE TREAD



RF TYRE TREAD

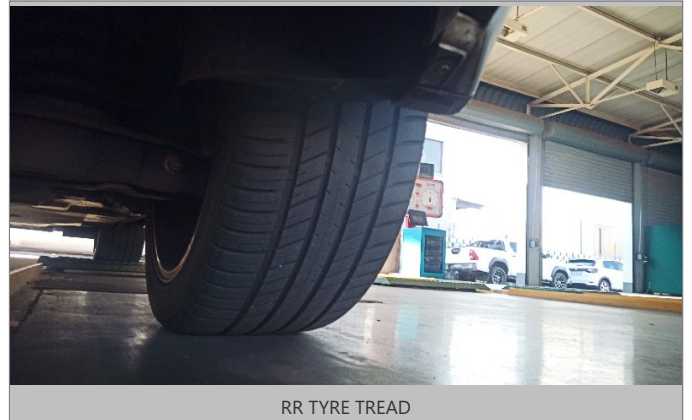

RR TYRE TREAD



Spare wheel




LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

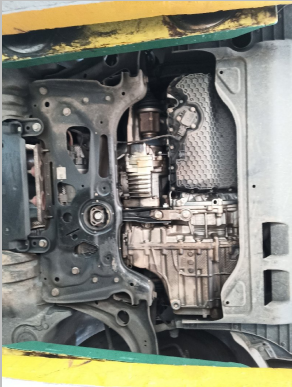

ENGINE 2



CHASSIS



Chassis 2



Expansion bottle



Oil cap and dipstick



Bonnet insulation 1



Bonnet insulation 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZJW841392