




Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386

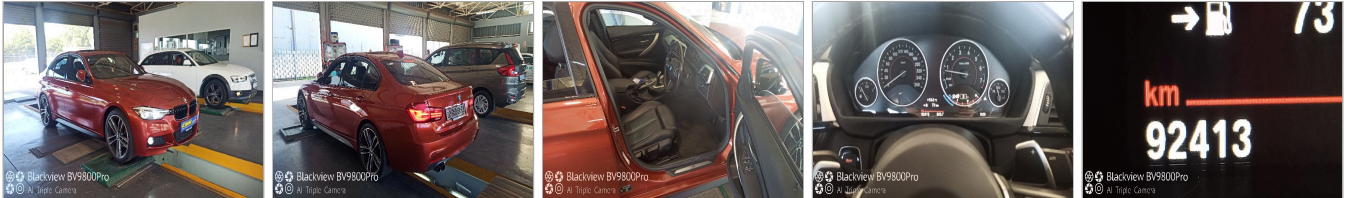

Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA 573 TRICHARDT ROAD - 1459 BOKSBURG DEKRA - GT
Requested Date	10/03/2026		
Inspection Date	10/03/2026		

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS
Manufacturer	BMW	Registration Number	CA859000
Model	320I	Register Number	YKR668W
VIN	WBA8A16010NU77534	Date Of First Licensing	
Engine Number		Last COR	2026/03/10
Doors	4	License Expiry Date	
Color	ORANGE	Power / Displacement	135Kw/1998Cc
Year Model	2018	Paint Finish	M - METALLIC
Km Reading	92,413 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items


6 airbags; 4x electrical windows; ABS; Airconditioning auto.; Alarm system; Alloy Wheels; Central locking; Cruise control; El. fold-away mirrors; El. mirrors; ESP (el. stability progr.); Fog lights; Front armrest; Handsfree car kit; Leather interior; Leather steering wheel; Multifunction steering wheel; Navigation system; On-board computer; Park sensor; Power steering; Radio cd; Rain sensor; Sliding roof el.; Traction control system; Xenon headlights;

VEHICLE INSPECTION



Damage

Repair Way

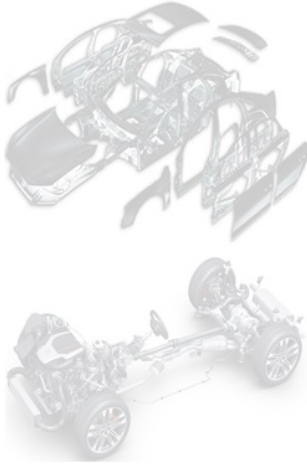

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.7	2.7	-	
Rear	2.7	2.6	-	
Emergency / Parking	1.8	2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/40R19	89Y	Bridgestone	Potenza	V	4621	3 mm
Front Right	225/40R19	89Y	Bridgestone	Potenza	V	4821	3 mm
Rear Left	255/35R19	92Y	Bridgestone	Potenza	V	2423	3 mm
Rear Right	255/35R19	92Y	Bridgestone	Potenza	V	3425	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient



Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents stone chips and or scratches on various body panels

Options & Accessories

TINTED WINDOWS, CENTRE BRAKE LIGHT,

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Bianca Gleave


This document was created electronically and is valid without signature.

General Remarks:


The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Spare wheel

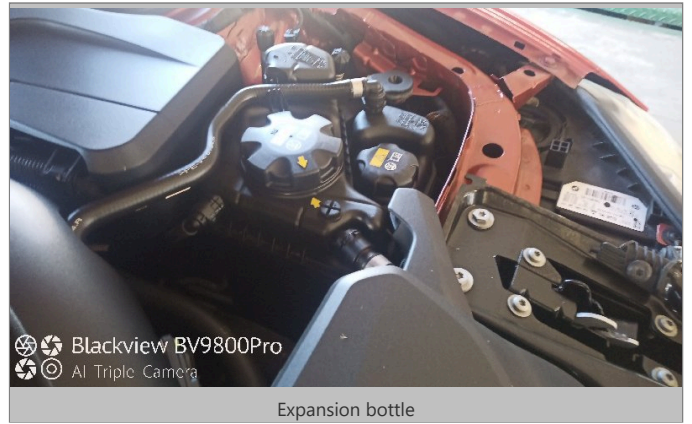

Expansion bottle

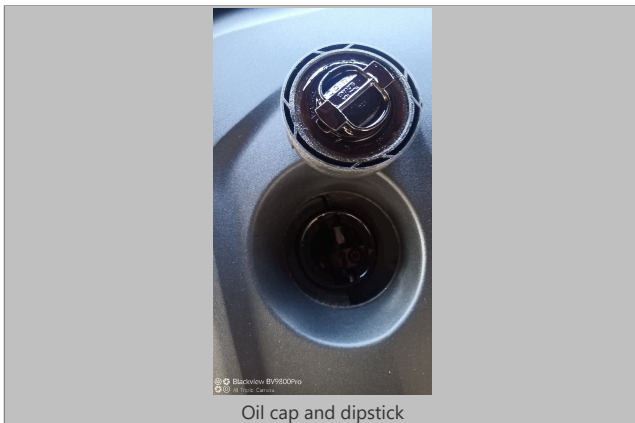


Oil cap and dipstick




Covered




Covered

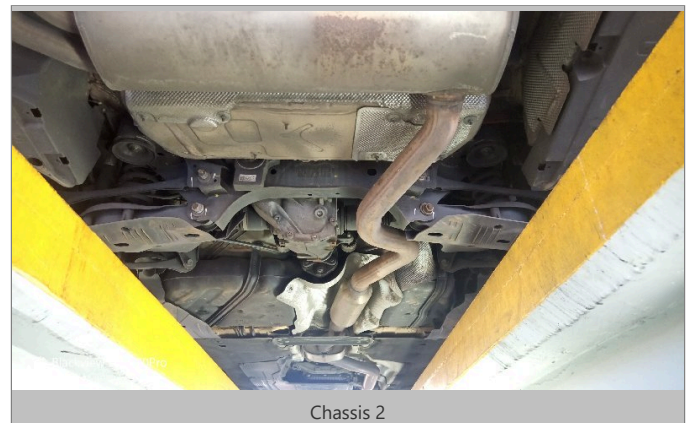


Chassis 2

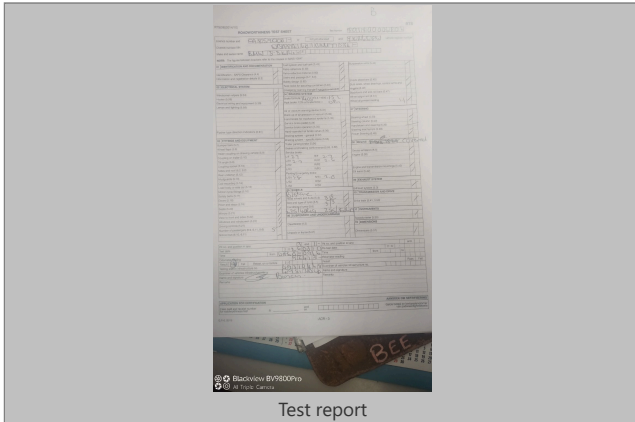


Test report

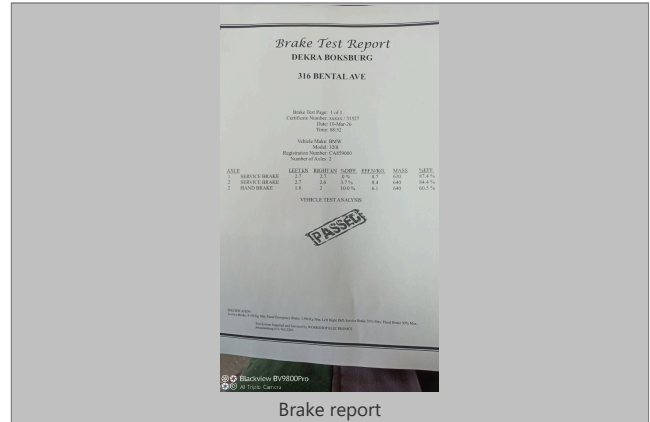


Brake report

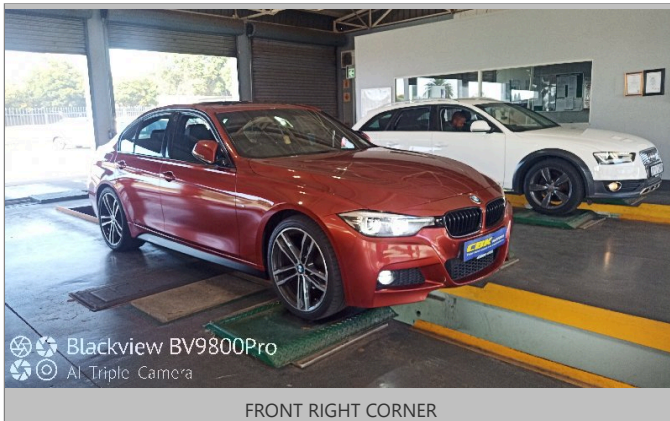

FRONT RIGHT CORNER

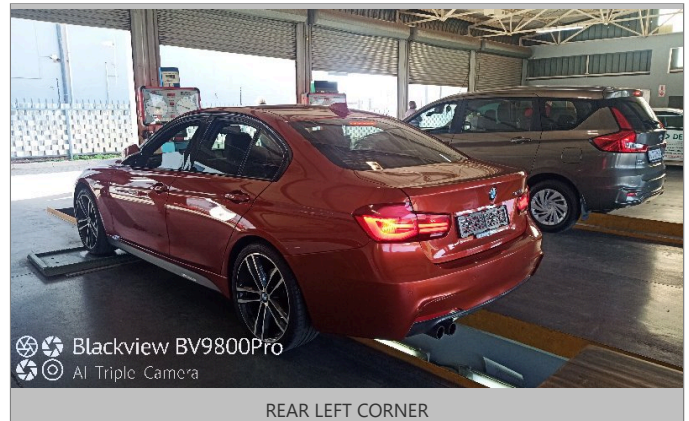





REAR LEFT CORNER

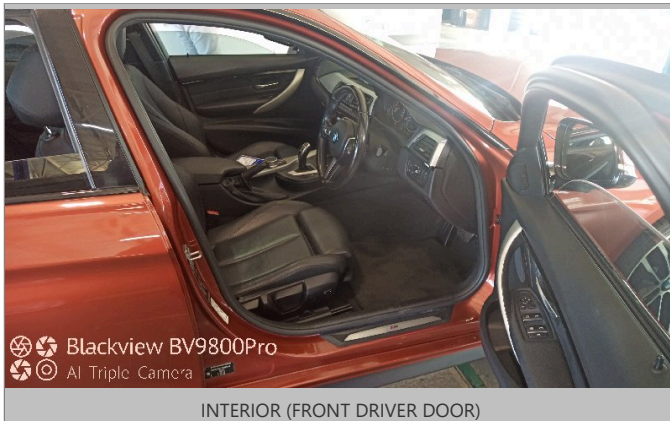

INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

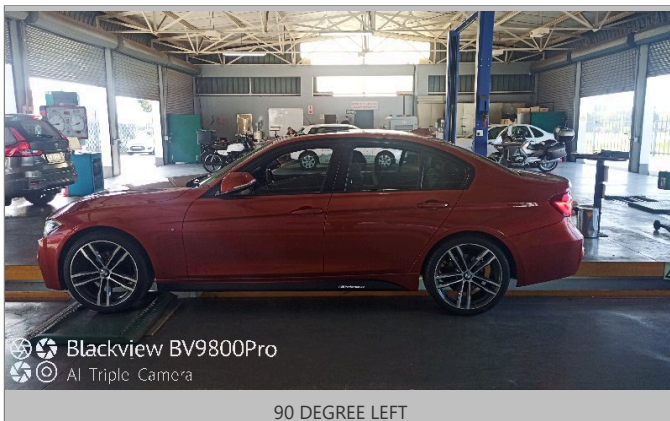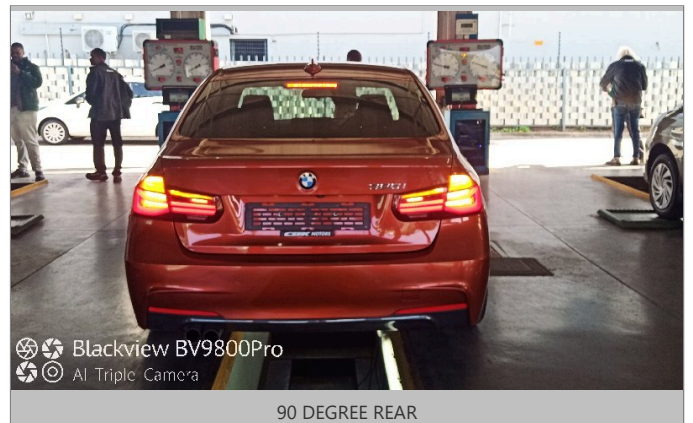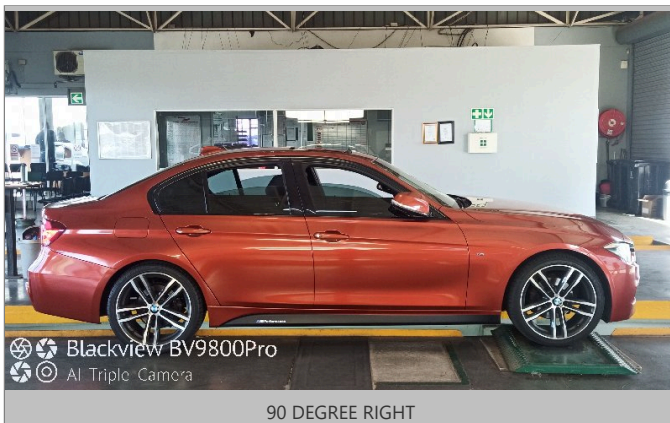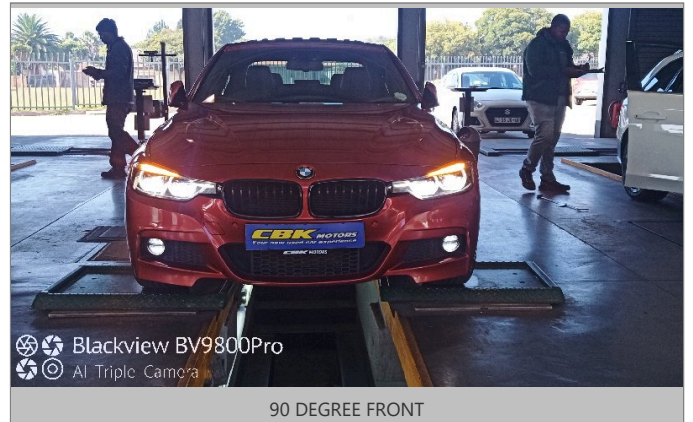



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1