



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	20/08/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	20/08/2026		BOKSBURG - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	CBK MOTORS
Manufacturer	MERCEDES BENZ	Registration Number	MY46JRGF
Model	X CLASS	Register Number	YTX256W
VIN	WDF4702312G006568	Date Of First Licensing	
Engine Number	699301C0020412	Last COR	2026/08/20
Doors	4	License Expiry Date	
Color	WHITE	Power / Displacement	150Kw/2298Cc
Year Model	2018	Paint Finish	C - COMMON
Km Reading	151,947 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items


(Fixed) tow bar; 6 airbags; 4x electrical windows; 4x4; ABS; Airconditioning auto.; Alarm system; Central locking; Cruise control; Driver's seat elec.; El. mirrors; ESP (el. stability progr.); Fog lights; Front armrest; Handsfree car kit; Multifunction steering wheel; Navigation system; On-board computer; Park sensor; Power steering; Radio cd; Rain sensor; Traction control system; Xenon headlights;

VEHICLE INSPECTION



Damage

Repair Way

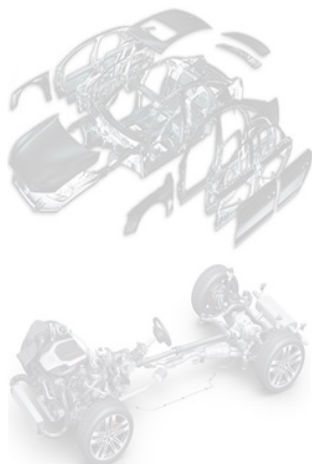

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.1	3.1	-	
Rear	4.2	3.6	-	
Emergency / Parking	1.7	2.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/60R18	110H	Bridgestone	Dueler	V	4513	5 mm
Front Right	265/65R18	110H	Hilo	Sport XV1	V	1121	4 mm
Rear Left	265/60R18	110H	Hilo	Sport XV1	V	1121	4 mm
Rear Right	265/60R18	110H	Bridgestone	Dueler	V	2319	6 mm
Spare	265/60R18	110H	Bridgestone	Dueler	V	////	9 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents stone chips and or scratches on various body panels.

Options & Accessories

TINTED WINDOWS, ROLL BAR, ROOF RAILS. CENTRE BRAKE LIGHT.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Bianca Gleave

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE REAR

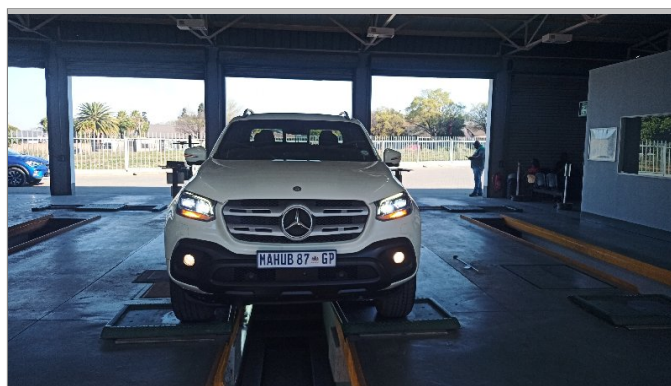

90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE LEFT




ODOMETER




DASHBOARD (W/ ENGINE RUNNING)




INTERIOR (FRONT DRIVER DOOR)

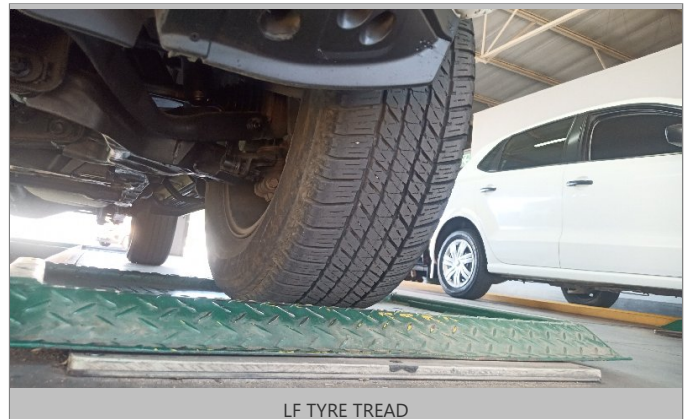

LF TYRE TREAD

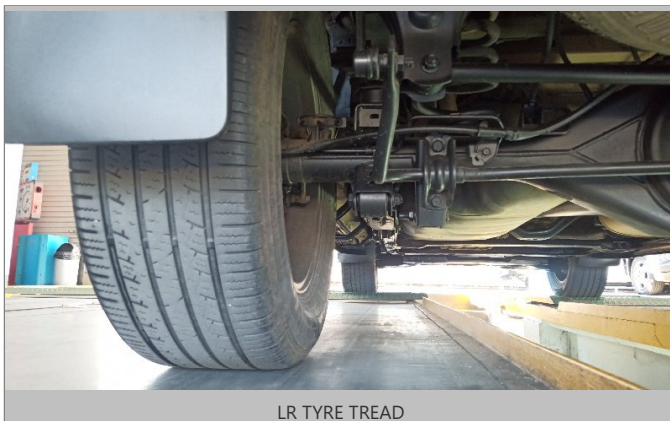

LR TYRE TREAD

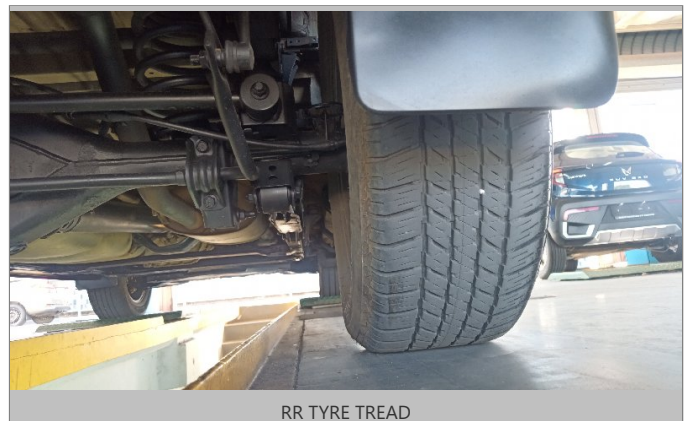


RR TYRE TREAD




RF TYRE TREAD



Spare wheel

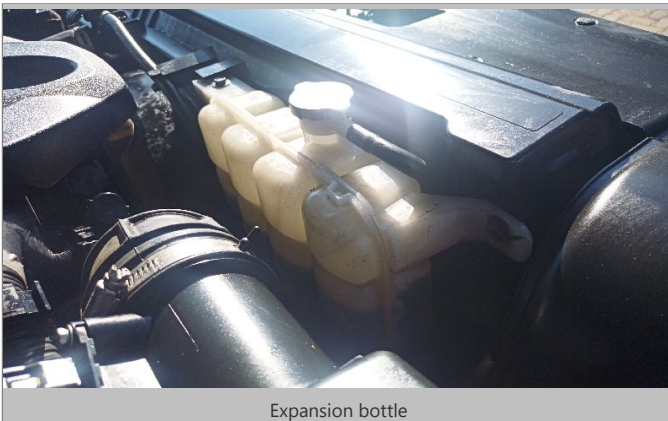

Expansion bottle

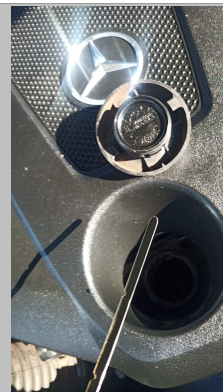

Oil cap and dipstick



Chassis 2



CHASSIS



ENGINE 1




ENGINE 2




VIN PLATE OR STICKER



LICENSE DISC

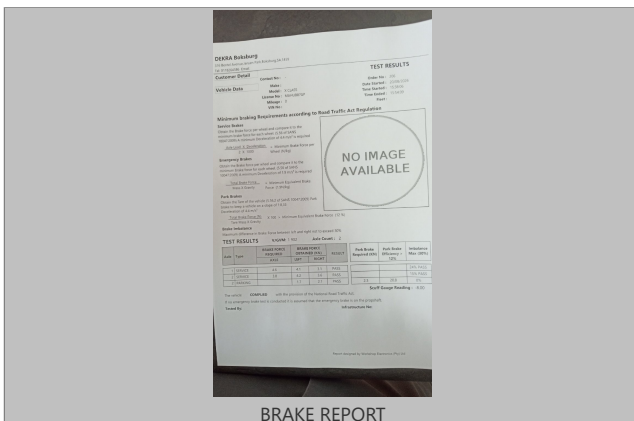

BRAKE REPORT

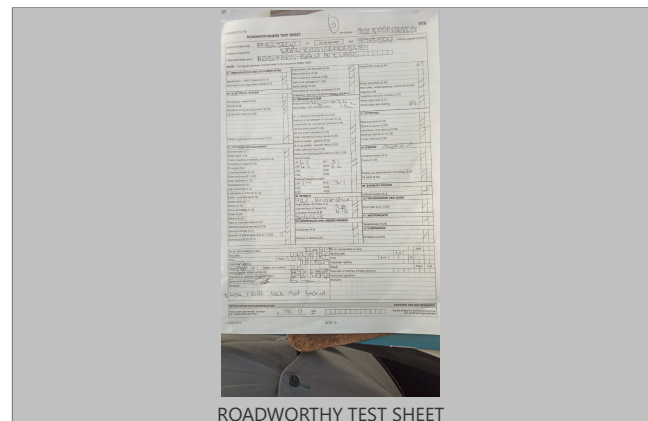

ROADWORTHY TEST SHEET



Air Conditioner

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WDF4702312G006568