



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	21/07/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	21/07/2026		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	VOLKSWAGEN	Registration Number	JX12YWGP
Model	TIGUAN 1.4 P	Register Number	HJL980K
VIN	WVGZZZ5NZJW422898	Date Of First Licensing	
Engine Number	CZE678790	Last COR	21/07/2026
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	110kw 1395ccm
Year Model	2018	Paint Finish	C - COMMON
Km Reading	85,439 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items


(Fixed) tow bar; 6 airbags; 4x electrical windows; ABS; Airconditioning auto.; Alarm system; Alloy Wheels; Central locking; Cruise control; Driver's seat with memory; El. fold-away mirrors; ESP (el. stability progr.); Fog lights; Handsfree car kit; Leather interior; Leather steering wheel; Multifunction steering wheel; Park sensor; Power steering; Radio cd; Seat heating; Sliding roof el.; Traction control system; Xenon headlights;

VEHICLE INSPECTION



Damage

Repair Way

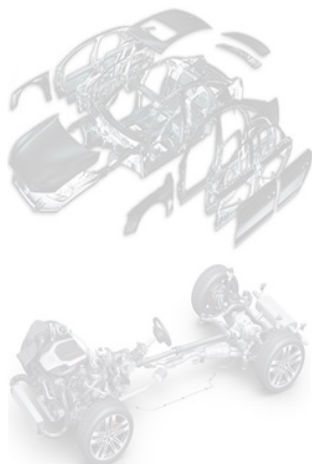

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.1	2.8	-	
Rear	2.9	2.5	-	
Emergency / Parking	2.1	1.8	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	255/45R19	104Y	Nexen	Nfera	V	4523	3 mm
Front Right	255/45ZR19	104Y	Nexen	Nfera	V	1223	3 mm
Rear Left	255/45ZR19	104Y	Nexen	Nfera	V	4523	4 mm
Rear Right	255/45ZR19	104Y	Nexen	Nfera	V	1223	4 mm
Spare	215/65R17	99V	Falken	Ziex	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Inspection conditions for the vehicle inspection were sufficient



Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Electrical Components and Instruments: Tyre pressure warning light illuminated at time of inspection.
Body • Exterior: Minor dents, scratches and stone chips on some body panels. Cosmetical enhancements done to some body panels.
Axle and Suspension: Front lower control arm bushes slightly perished.
Undercarriage: Engine, transmission and undercarriage mostly covered underneath.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Sparewheel



Warning triangle




Oil cap and dipstick




Coolant bottle



Chassis 2

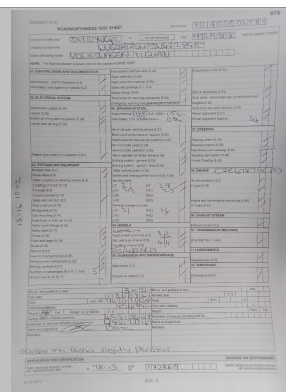

Roadworthy test sheet

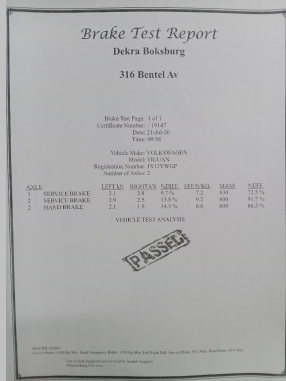

Brake test report



Aircon working



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



CHASSIS



ENGINE 2



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZJW422898