



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	03/08/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	03/08/2026		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	RENAULT	Registration Number	CAA445422
Model	SANDERO	Register Number	ZWB338W
VIN	VF15SRAAC62697189	Date Of First Licensing	
Engine Number		Last COR	03/08/2026
Doors	4	License Expiry Date	31/10/2026
Color	WHITE	Power / Displacement	66kw 898ccm
Year Model	2019	Paint Finish	C - COMMON
Km Reading	88,815 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

2 airbags; 2x electrical windows; ABS; Airconditioning; Alarm system; Central locking; ESP (el. stability progr.); Fog lights; Handsfree car kit; Power steering; Radio cd; Traction control system;


VEHICLE INSPECTION



Damage

Repair Way

Spare Tyre Smooth

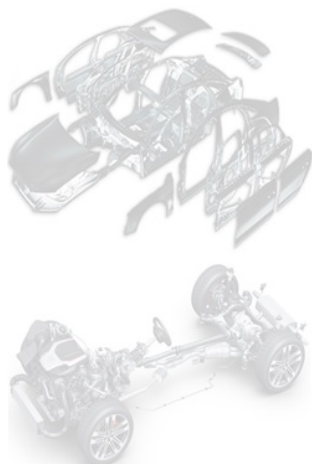

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	1.8	2.1	-	
Rear	1.3	1.3	-	
Emergency / Parking	1.3	1.4	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55R16	91V	Dunlop	SP Sport	V	2425	4 mm
Front Right	205/55R16	91V	Dunlop	SP Sport	V	2425	4 mm
Rear Left	205/55R16	91H	Continental	Contact 5	V	0619	3 mm
Rear Right	205/55R16	91H	Continental	Contact 5	V	0619	3 mm
Spare	185/65R14	86H	Lanvigator	Comfort	V	2221	0 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents, scratches and stone chips on some body panels. Cosmetic enhancements done to some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE


Technician

Tumelo Molekoa


This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

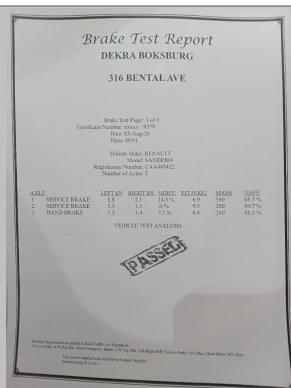

Brake test report

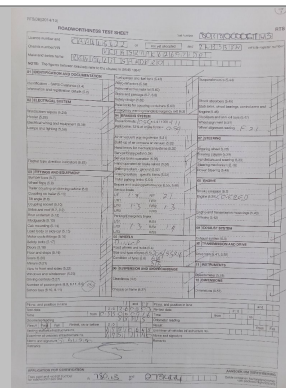

Roadworthy test sheet



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



LF TYRE TREAD



Sparewheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Chassis 2



Aircon working



Oil cap and dipstick



Coolant bottle



Spare Tyre

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VF15SRAAC62697189