



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	11/05/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	11/05/2026		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	VOLKSWAGEN	Registration Number	LB02KGGP
Model	POLO 1.0 TSI 70KW COMFORTLINE 5-DR [2020-2022]	Register Number	HYG360K
VIN	AAVZZAWZMU025955	Date Of First Licensing	
Engine Number	CHZD55535	Last COR	
Doors	5	License Expiry Date	
Color	GREY	Power / Displacement	70Kw. 999Ccm
Year Model	2020	Paint Finish	M - METALLIC
Km Reading	111,499 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items


6 airbags; 4x electrical windows; ABS; Airconditioning auto.; Alarm system; Alloy Wheels; Car phone preparation; Central locking; Cruise control; El. mirrors; ESP (el. stability progr.); Fog lights; Front armrest; Handsfree car kit; Leather steering wheel; Multifunction steering wheel; On-board computer; Power steering; Radio / Cassette; Sliding roof el.; Sun roof; Traction control system;

VEHICLE INSPECTION



Damage

Repair Way

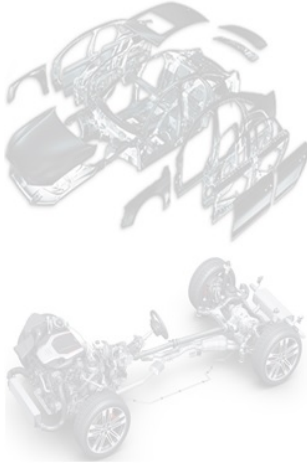

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.7	2.7	-	
Rear	1.8	1.6	-	
Emergency / Parking	1.3	1.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/45R17	91Y	Apollo	Aspire	V	3223	4 mm
Front Right	215/45R17	91Y	Apollo	Aspire	V	3223	4 mm
Rear Left	215/45R17	91W	Continental	Contact 5	V	0721	4 mm
Rear Right	215/45R17	91W	Continental	Contact 5	V	2621	4 mm
Spare	185/65R15	86/H	Falken	Sincere	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Inspection conditions for the vehicle inspection were sufficient



Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents scratches and stone chips
Undercarriage: Under carriage mostly covered

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

IAN WHITTAKER

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Oil cap and dipstick



Coolant level

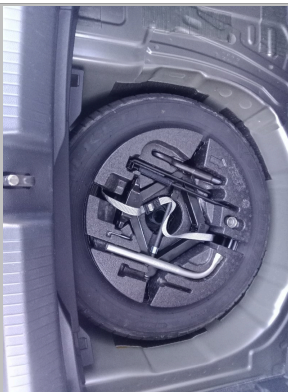


Spare tyre




Engine covered



Chassis 2

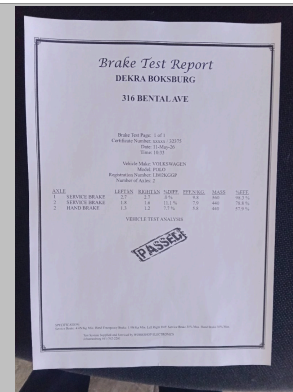

Brake report

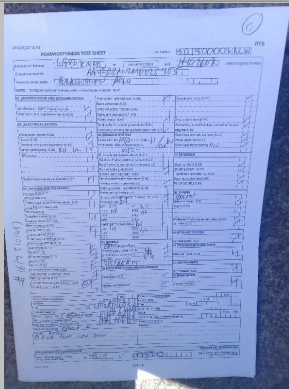

Test sheet



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD




RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

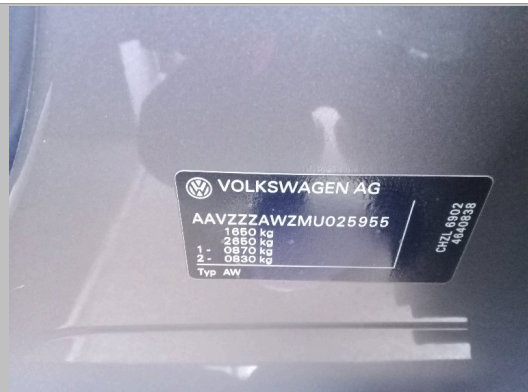

VIN PLATE OR STICKER



ENGINE 1



CHASSIS



Dim Light Left



Rim Rear Left



Rim Front Left



Rim Front Right



Rim Rear Right