



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	22/06/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	22/06/2026		BOKSBURG - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	CBK MOTORS
Manufacturer	TOYOTA	Registration Number	HGP675L
Model	HILUX 2.4 GD-6 RB RAIDER DSL D-CAB PU AT [2020-2022]	Register Number	JCM806L
		Date Of First Licensing	
VIN	AHTJB3DD004523916	Last COR	22/06/2026
Engine Number		License Expiry Date	
Doors	4	Power / Displacement	110kw 2393ccm
Color	WHITE	Paint Finish	C - COMMON
Year Model	2021	Fuel	DIESEL
Km Reading	91,512 KM	Transmission	AUTOMATIC
Cab / Body Type	DOUBLE CAB		

Vehicle Options & Accessories

Items


8 airbags; 4x electrical windows; ABS; Airconditioning; Alarm system; Alloy Wheels; Central locking; Cruise control; Detachable tow bar; El. fold-away mirrors; ESP (el. stability progr.); Fog lights; Handsfree car kit; Multifunction steering wheel; Park sensor; Power steering; Traction control system;

VEHICLE INSPECTION



Damage

Repair Way

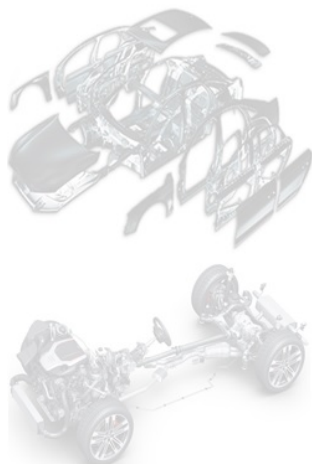

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.3	3.7	-	
Rear	3.3	3.9	-	
Emergency / Parking	1.9	1.6	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/70R17	112T	Continental	Crosscontact	V	4125	8 mm
Front Right	225/70R17	112T	Continental	Crosscontact	V	4125	8 mm
Rear Left	225/70R17	112T	Continental	Crosscontact	V	3925	7 mm
Rear Right	255/70R17	112T	Continental	Crosscontact	V	2925	7 mm
Spare	265/65R17	112S	Dunlop	Grandtrek	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Cosmetical enhancements done to some body panels.

Undercarriage: Undercarriage dirty at time of test.

Options & Accessories

NUDGBAR, RADIO USB, REARVIEW CAMERA

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks:


The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER



REAR LEFT CORNER

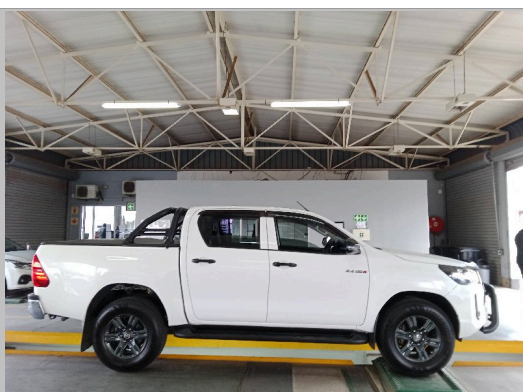

90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE FRONT



90 DEGREE REAR



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)




LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

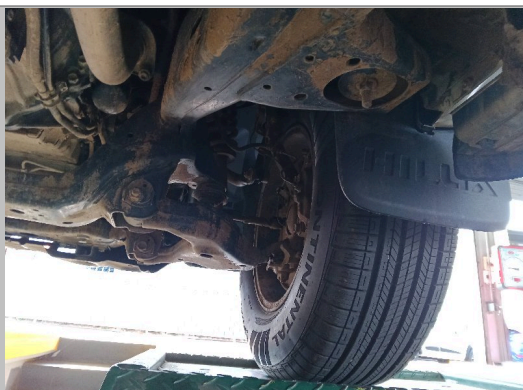

RF TYRE TREAD



Sparewheel



Chassis 2



Oil cap and dipstick



Coolant bottle



CHASSIS



ENGINE 2



ENGINE 1




VIN PLATE OR STICKER



LICENSE DISC

ROADWORTHY TEST SHEET

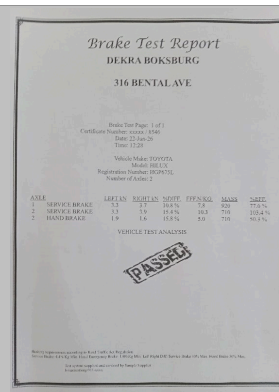

BRAKE TEST REPORT



Spare Tyre



Roof



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTJB3DD004523916