



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	08/09/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	08/09/2026		BOKSBURG - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	ISUZU	Registration Number	LX47TTGP
Model	D-MAX 1.9 DDI X-RIDER HR DSL D-CAB PU AT [2023-2026]	Register Number	GTK224X
		Date Of First Licensing	
VIN	ACVTFR87JPD159152	Last COR	08/09/2026
Engine Number	RZ4EESG083	License Expiry Date	31/07/2027
Doors	4	Power / Displacement	110kw 1898ccm
Color	GREY	Paint Finish	M - METALLIC
Year Model	2024	Fuel	DIESEL
Km Reading	64,435 KM	Transmission	AUTOMATIC
Cab / Body Type	DOUBLE CAB		

Vehicle Options & Accessories

Items


(Fixed) tow bar; 6 airbags; 4x electrical windows; ABS; Airconditioning; Alarm system; Alloy Wheels; Central locking; Cruise control; El. mirrors; ESP (el. stability progr.); Fog lights; Handsfree car kit; Leather interior; Leather steering wheel; Multifunction steering wheel; Park sensor; Power steering; Radio / Cassette; Traction control system; Xenon headlights;

VEHICLE INSPECTION



Damage

Repair Way

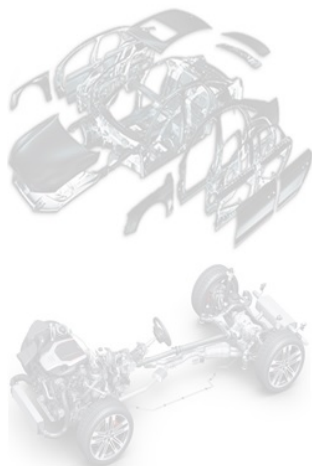

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.9	3.5	-	
Rear	2.8	3.0	-	
Emergency / Parking	2.4	2.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/60R18	110H	General	Grabber	V	2124	7 mm
Front Right	265/60R18	110H	General	Grabber	V	2124	7 mm
Rear Left	265/60R18	110H	General	Grabber	V	2124	6 mm
Rear Right	265/60R18	110H	General	Grabber	V	2124	6 mm
Spare	265/60R18	110H	General	Grabber	V	0000	8 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Inspection conditions for the vehicle inspection were sufficient



Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Engine and gearbox mostly covered underneath.

Body • Exterior: Minor dents, scratches and stone chips on some body panels. Cosmetical enhancements done to some body panels

Options & Accessories

SIDESTEPS, TOURNEAU COVER

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE


Technician

Tumelo Molekoa


This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

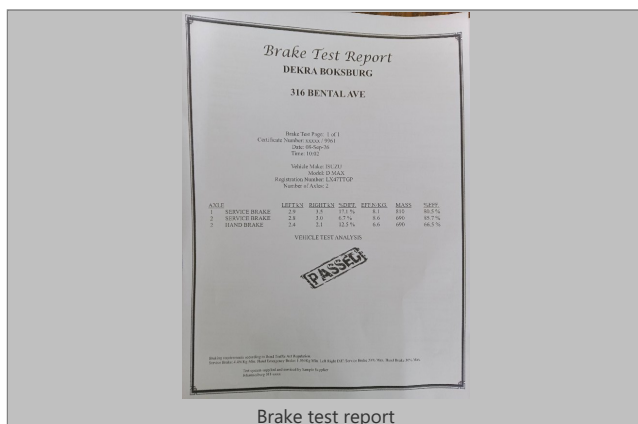


Brake test report

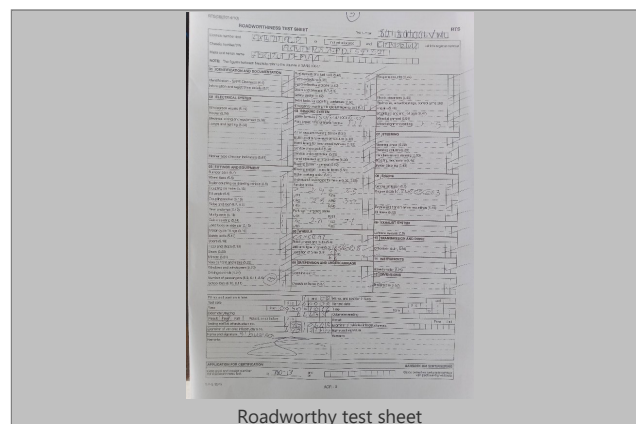


Roadworthy test sheet




FRONT RIGHT CORNER

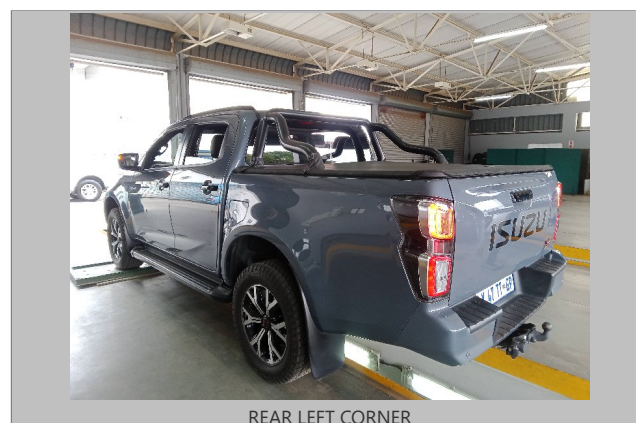

REAR LEFT CORNER

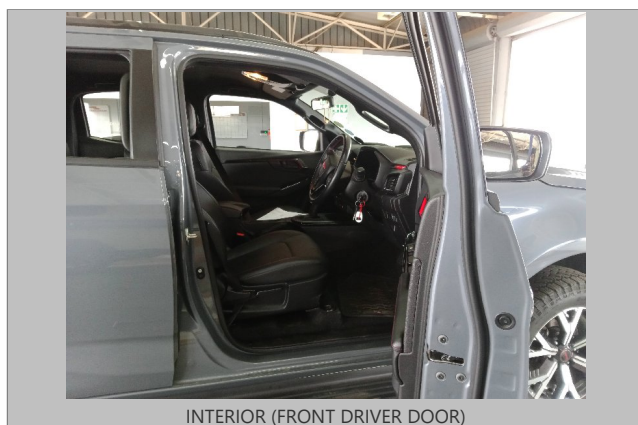

INTERIOR (FRONT DRIVER DOOR)

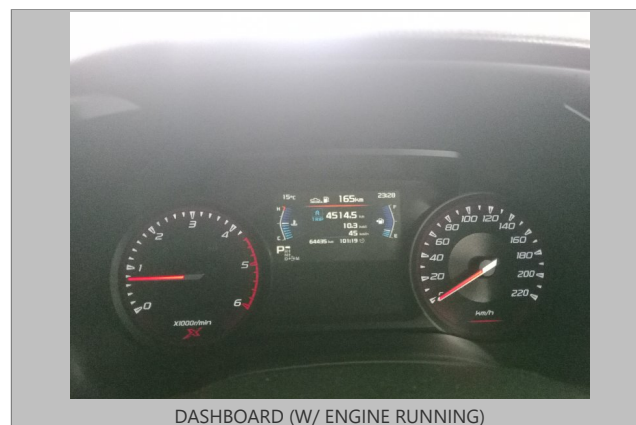

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT




LF TYRE TREAD



LR TYRE TREAD




RR TYRE TREAD

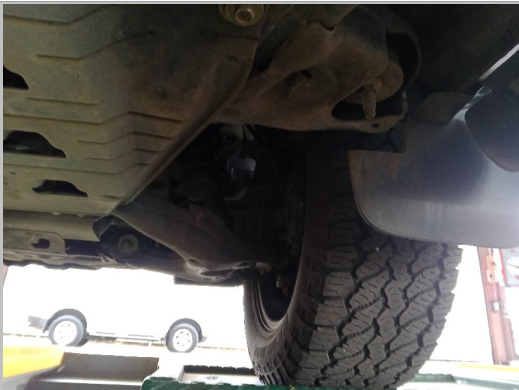


RF TYRE TREAD



Sparewheel

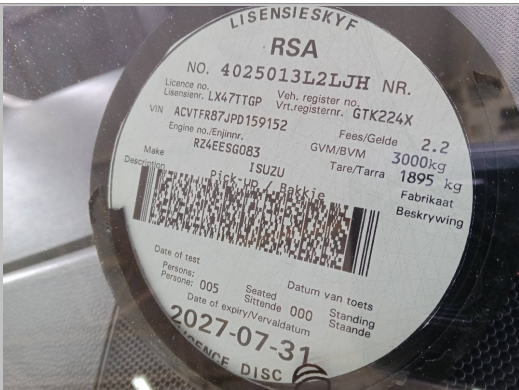

LICENSE DISC

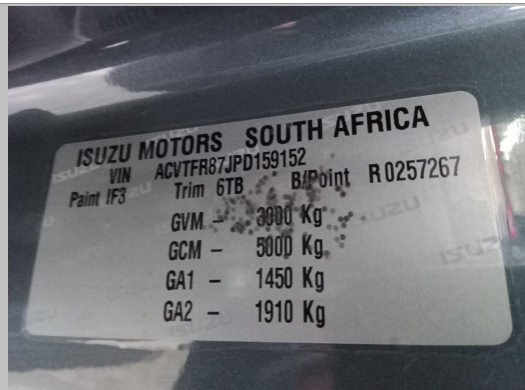

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Chassis 2



Oil cap and dipstick



Coolant bottle