



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	03/09/2025		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	03/09/2025		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	AUDI	Registration Number	CAA464893
Model	TTS COUPE 2.0T FSI 210KW QUATTRO S TRONIC [2015-2017]	Register Number	GNV035K
VIN	TRUZZZFFV4G1009332	Date Of First Licensing	
Engine Number	CJX079820	Last COR	03/09/2025
Doors	2	License Expiry Date	
Color	BLUE	Power / Displacement	
Year Model	2016	Paint Finish	C - COMMON
Km Reading	99,679 KM	Fuel	PETROL
Cab / Body Type	COUPE	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

4 airbags; 2x electrical windows; ABS; Airconditioning; Airconditioning auto.; Alarm system; Alloy Wheels; Car phone preparation; Central locking; El. mirrors; ESP (el. stability progr.); Headlamp washer; Leather steering wheel; Multifunction steering wheel; Navigation system; On-board computer; Park sensor; Power steering; Radio cd; Traction control system; Xenon headlights;



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.1	3.3	-	
Rear	2.2	2.5	-	
Emergency / Parking	1.9	2.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	245/55/R19	93W	HI FLY	HF805	V	3523	5 mm
Front Right	245/55/R19	93W	HI FLY	HF805	V	2723	5 mm
Rear Left	245/55/R19	93W	HI FLY	HF805	V	1723	5 mm
Rear Right	245/55/R19	93W	HI FLY	HF895	V	1723	5 mm
Spare	T 125/70/R19	100M	Hankook	S300	V	0000	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE: NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, AND MECHANICAL. Body • Exterior: Chipmarks , scratches and minor dents to various body panels. In accordance to the age and mileage of the vehicle.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

David Olwagen

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




Oil cap and dipstick



Expansion bottle



Chassis2

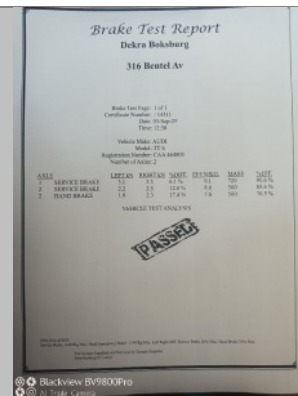

Brake Report



Spare wheel



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



CHASSIS



ENGINE 2