



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	13/08/2025		573 Trichard Road - 1459
Inspection Date	13/08/2025		DEKRA Boksburg - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK
Manufacturer	VOLKSWAGEN	Registration Number	CA824256
Model	GOLF 7 1.4 TSI COMFORTLINE 90KW 5-DR DSG [2013-2016]	Register Number	FYG154K
VIN	WVWZZZAUZEW293598	Date Of First Licensing	
Engine Number	CXS077834	Last COR	13/08/2025
Doors	5	License Expiry Date	
Color	SILVER	Power / Displacement	90Kw/1395Cc
Year Model	2014	Paint Finish	M - METALLIC
Km Reading	85,229 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

6 airbags; 4x electrical windows; ABS; Airconditioning; Alarm system; Alloy Wheels; Central locking; Cruise control; El. mirrors; ESP (el. stability progr.); Handsfree car kit; Leather steering wheel; Multifunction steering wheel; On-board computer; Power steering; Radio cd; Traction control system; Xenon headlights;



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.0	3.1	-	
Rear	1.8	1.9	-	
Emergency / Parking	1.4	1.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55ZR16	94W	Roadstone	Eurove	V	3324	4 mm
Front Right	205/55R16	91H	Giti	Gitisynergy	V	0221	4 mm
Rear Left	205/55R16	91V	Hankook	Ventus prime	V	0514	5 mm
Rear Right	205/55R16	91V	Hankook	Ventus prime	V	0000	2 mm
Spare	205/55R16	91V	Hankook	Ventus prime	V	0000	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Vehicle Dirty
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician


Bianca Gleave

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

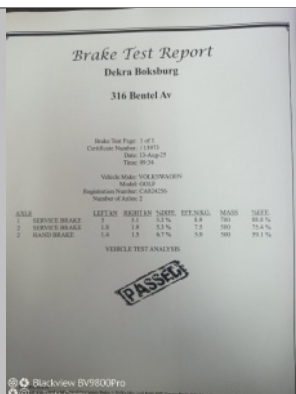

Brake report

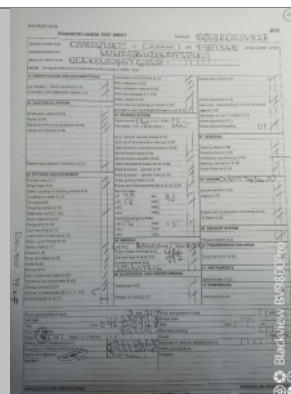

Test sheet



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)




DASHBOARD (W/ ENGINE RUNNING)




ODOMETER



90 DEGREE FRONT

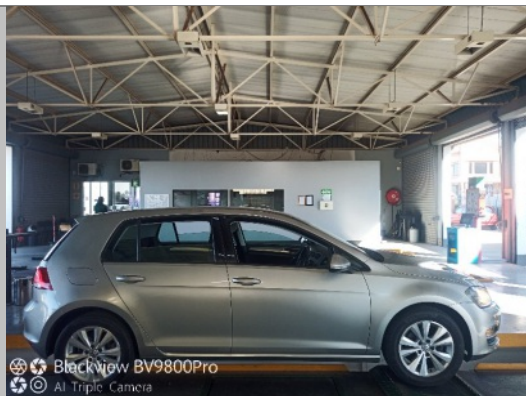

90 DEGREE RIGHT

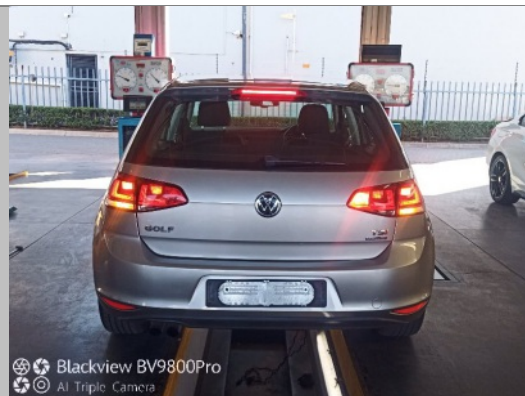

90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



LF TYRE TREAD



Spare wheel



No license disc



VIN PLATE OR STICKER



ENGINE 1



covered



CHASSIS



Chassis 2



Oil cap and dipstick



Expansion bottle