



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	01/08/2025		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	01/08/2025		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS
Manufacturer	VOLKSWAGEN	Registration Number	NU730ZN
Model	GOLF 7 1.2 TRENDLINE 77KW 5-DR [2013-2016]	Register Number	GGH420K
VIN	WVWZZZAUZFW184566	Date Of First Licensing	
Engine Number	CJZ583150	Last COR	
Doors	5	License Expiry Date	
Color	RED	Power / Displacement	77Kw. 1197Ccm
Year Model	2015	Paint Finish	C - COMMON
Km Reading	67,798 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items


6 airbags; 2x electrical windows; ABS; Airconditioning; Alarm system; Alloy Wheels; Car phone preparation; Central locking; El. mirrors; ESP (el. stability progr.); Fog lights; Handsfree car kit; Leather steering wheel; Multifunction steering wheel; On-board computer; Power steering; Radio cd; Traction control system;

VEHICLE INSPECTION



Damage

Repair Way

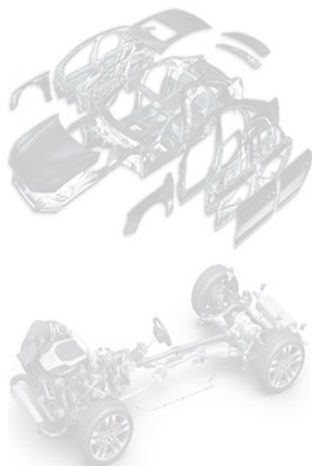

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.6	2.7	-	
Rear	1.8	2.0	-	
Emergency / Parking	1.1	1.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65R15	91H	Continental	Contact 2	V	1823	6 mm
Front Right	195//65R15	91H	Continental	Contact 2	V	1923	6 mm
Rear Left	195/65R15	91H	Continental	Contact 2	V	4922	6 mm
Rear Right	195/65R15	91H	Continental	Contact 2	V	4922	6 mm
Spare	195/65R15	91H	Continental	Contact 2	V	0000	6 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Inspection conditions for the vehicle inspection were sufficient



Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents scratches and stone chips
Undercarriage: Under carriage mostly covered

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician


IAN WHITTAKER

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER

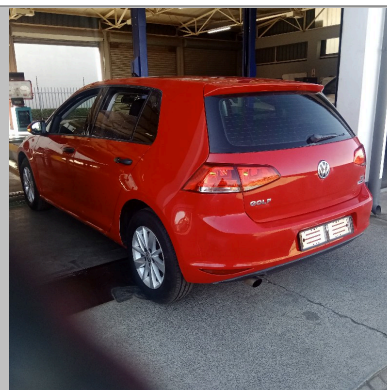

REAR LEFT CORNER




90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE FRONT

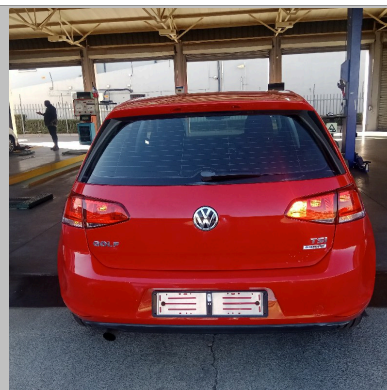

90 DEGREE REAR



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



LF TYRE TREAD



LR TYRE TREAD



RF TYRE TREAD



RR TYRE TREAD



Oil cap and dipstick



Coolant level




Spare tyre



Engine covered



Chassis 2

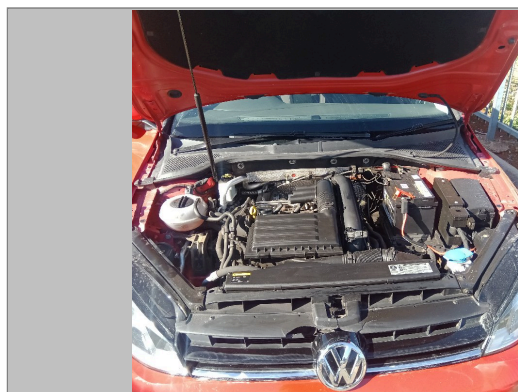

ENGINE 1




CHASSIS




VIN PLATE OR STICKER



LICENCE DISC

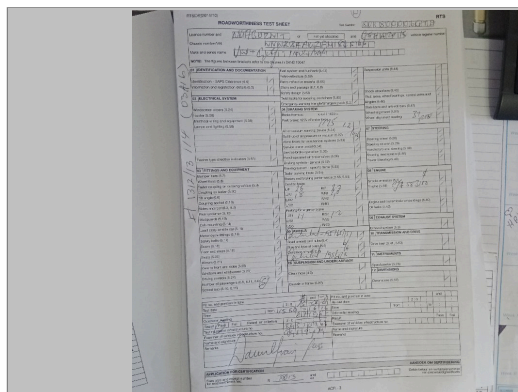

ROADWORTHY TEST SHEET

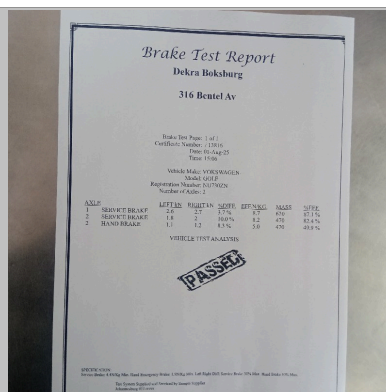

BRAKE REPORT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZAUZFW184566