



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	14/08/2025		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	14/08/2025		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK CBK MOTORS
Manufacturer	FORD	Registration Number	CAA227639
Model	EVEREST 2.2 TDCI XLT 5-DR DSL AT [2017-2018]	Register Number	XMF715W
VIN	AFAJXXMJWJGS27907	Date Of First Licensing	
Engine Number	QJ2LJGS27907	Last COR	14/08/2025
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	118KW/2200CCM
Year Model	2016	Paint Finish	C - COMMON
Km Reading	127,869 KM	Fuel	DIESEL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

6 airbags; 7-seater; 4x electrical windows; ABS; Airconditioning auto.; Alarm system; Alloy Wheels; Central locking; Cruise control; Detachable tow bar; El. fold-away mirrors; El. mirrors; ESP (el. stability progr.); Fog lights; Front armrest; Handsfree car kit; Leather interior; Leather steering wheel; Multifunction steering wheel; Navigation system; On-board computer; Park sensor; Power steering; Radio cd; Traction control system; Xenon headlights;



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.8	2.5	-	
Rear	3.5	2.9	-	
Emergency / Parking	1.6	1.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/60R18	110H	Cooper	Discover	V	4122	3 mm
Front Right	265/60R18	110H	Cooper	Discoverer	V	4122	3 mm
Rear Left	265/60R18	110H	Dunlop	Grandtrek	V	4318	2 mm
Rear Right	265/60R18	110H	Dunlop	Grandtrek	V	4381	2 mm
Spare	265/65R17	112T	Continental	Cross contac	V	3816	9 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Vehicle Dirty
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: Body • Exterior: Minor dents stone chips and or scratches on various body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Bianca Gleave

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Expansion bottle



Oil cap and dipstick

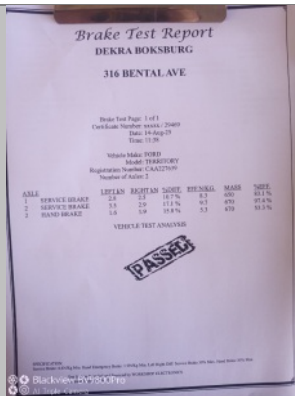

Brake report




Spare wheel



Chassis 2



Covered

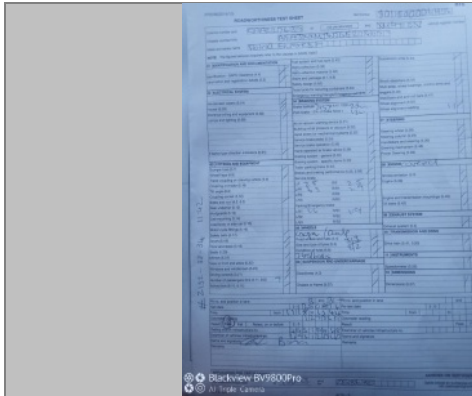

Test sheet



FRONT RIGHT CORNER




REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)




DASHBOARD (W/ ENGINE RUNNING)

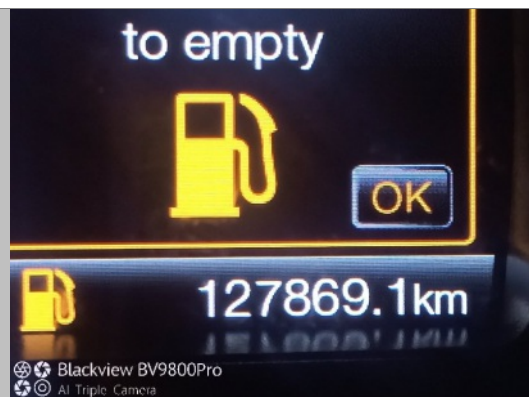

ODOMETER




90 DEGREE FRONT

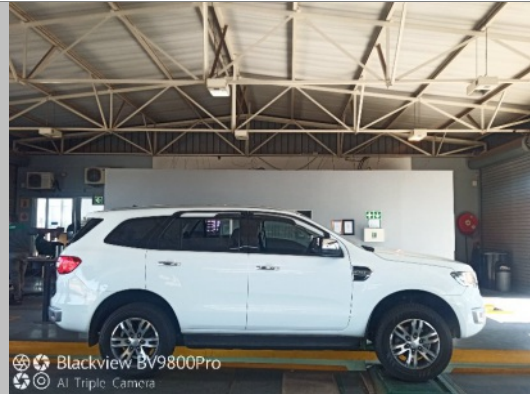

90 DEGREE RIGHT



90 DEGREE REAR

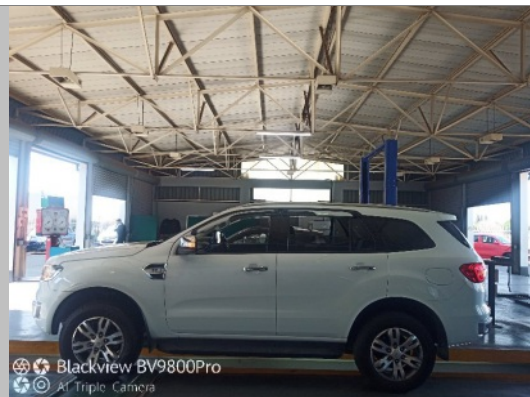

90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



CHASSIS



ENGINE 1