



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	29/07/2025		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	29/07/2025		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	BMW	Registration Number	HB40WTGP
Model	340I SPORT STEPTRONIC [2015-2019]	Register Number	XWC770W
VIN	WBA8B36040NU40762	Date Of First Licensing	
Engine Number		Last COR	25/07/2025
Doors	4	License Expiry Date	
Color	RED	Power / Displacement	240Kw. 2998Ccm
Year Model	2017	Paint Finish	C - COMMON
Km Reading	129,557 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items


6 airbags; 4x electrical windows; ABS; Airconditioning auto.; Alarm system; Alloy Wheels; Car phone preparation; Central locking; Cruise control; El. mirrors; ESP (el. stability progr.); Fog lights; Front armrest; Handsfree car kit; Leather interior; Leather steering wheel; Navigation system; On-board computer; Park sensor; Power steering; Radio cd; Rain sensor; Sliding roof el.; Sun roof; Traction control system;

VEHICLE INSPECTION

Damage

Repair Way

Catalytic converter Missing

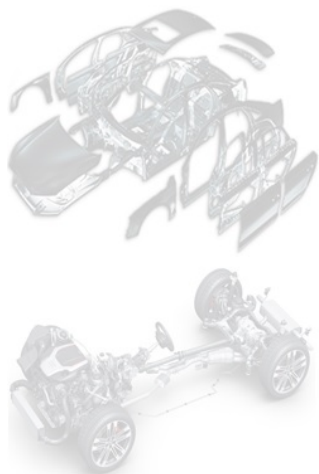



Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.9	2.9	-	
Rear	2.8	2.9	-	
Emergency / Parking	2.3	2.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/40R19	93Y	Goodyear	Eagle	V	0424	5 mm
Front Right	225/40R19	93Y	Goodyear	Eagle	V	3324	5 mm
Rear Left	255/35R19	93Y	Goodyear	Eagle	V	3324	5 mm
Rear Right	255/35R19	96Y	Goodyear	Eagle	V	3424	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

No Test Drive

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents scratches and stone chips

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Ofentse Morankwane

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

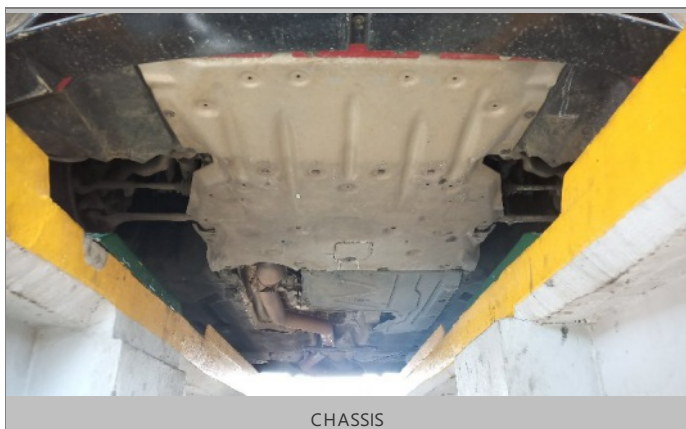


CHASSIS




CHASSIS 2

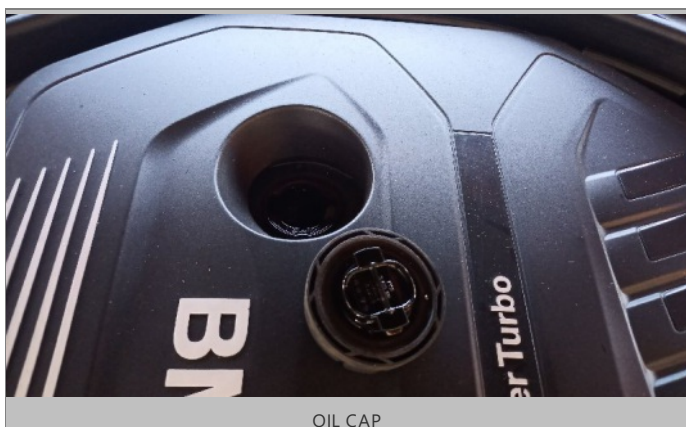

OIL CAP

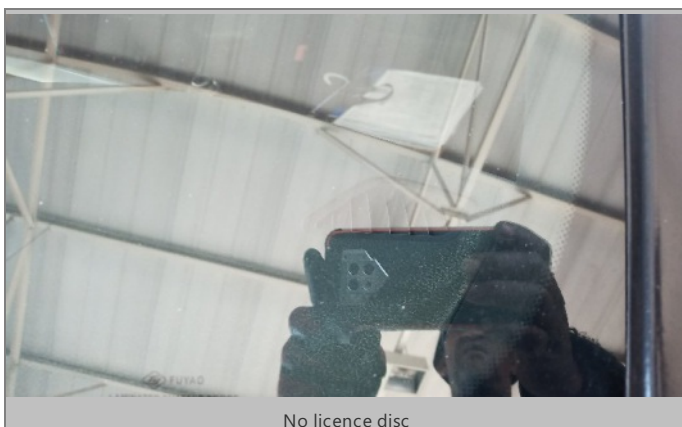

No licence disc

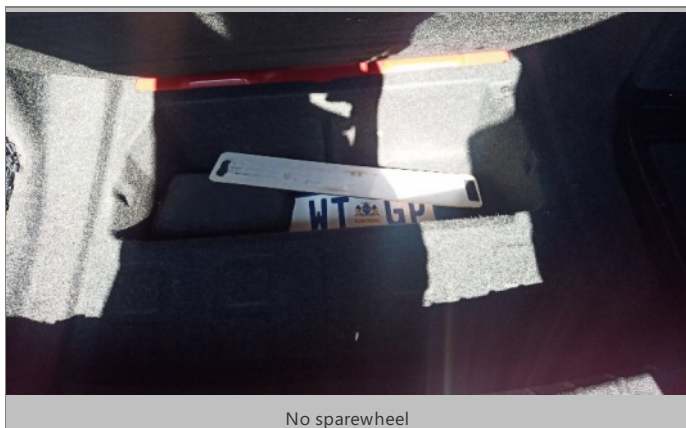


No sparewheel




COOLANT



ENGINE 2

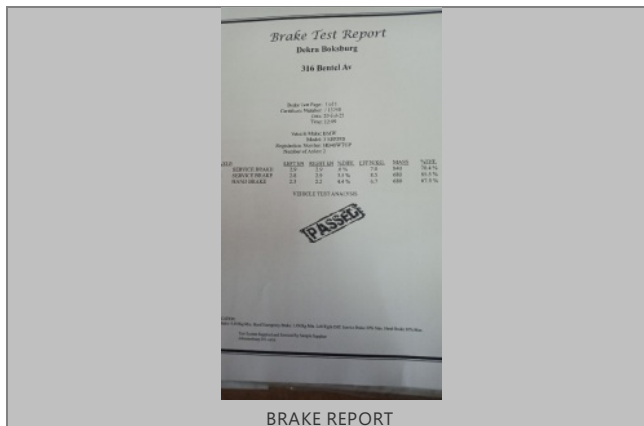

BRAKE REPORT

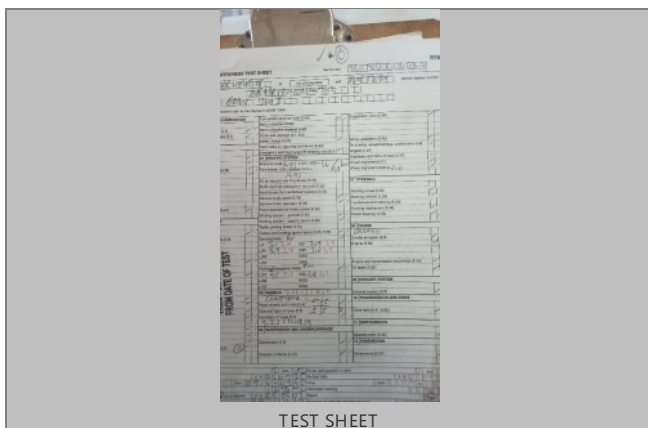


TEST SHEET



FRONT RIGHT CORNER



REAR LEFT CORNER

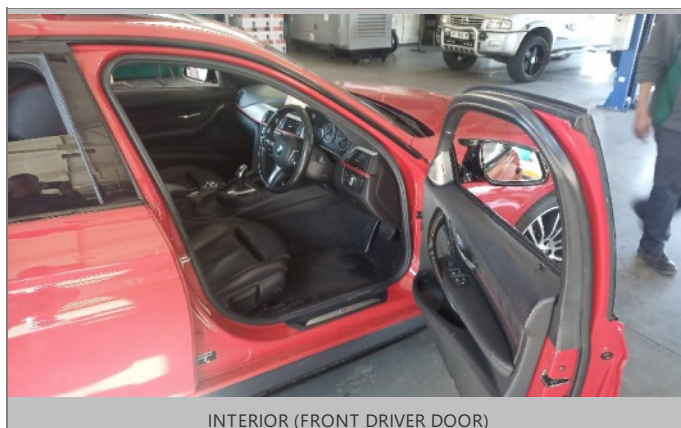

INTERIOR (FRONT DRIVER DOOR)




DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT

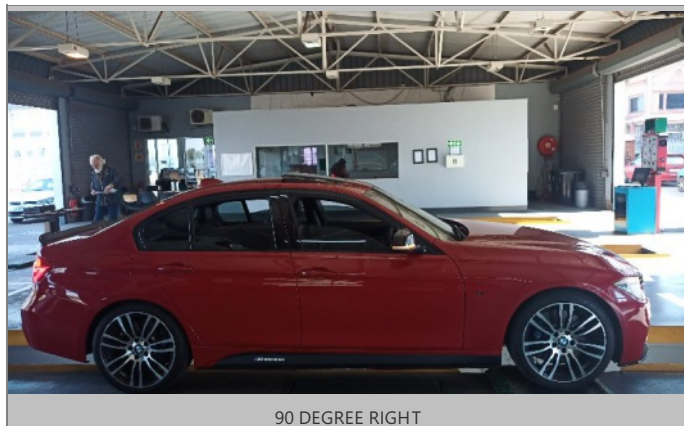

90 DEGREE RIGHT



90 DEGREE REAR




90 DEGREE LEFT



LF TYRE TREAD




LR TYRE TREAD

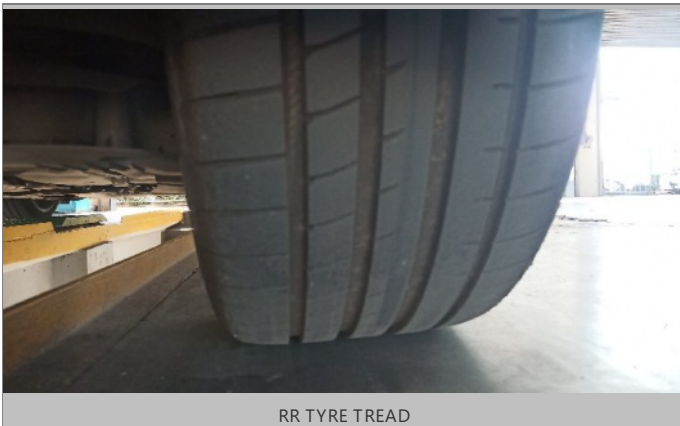

RR TYRE TREAD



RF TYRE TREAD

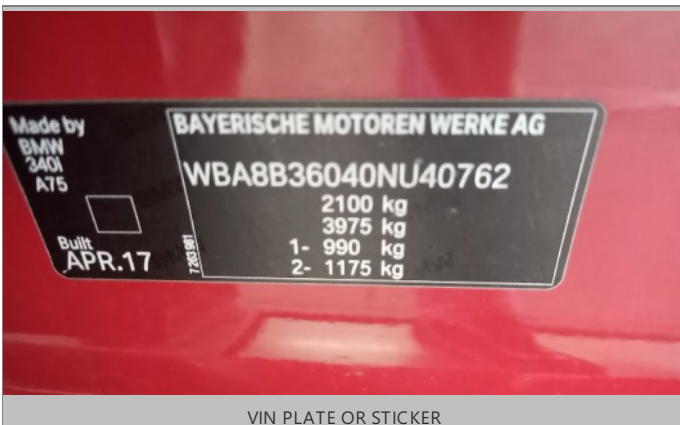

VIN PLATE OR STICKER



ENGINE 1