



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	04/09/2025		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	04/09/2025		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS
Manufacturer	TOYOTA	Registration Number	BV28ZJZN
Model	AURIS 1.6 XI 5-DR [2013-2015]	Register Number	FPT622L
VIN	JTNKP0JE60J002260	Date Of First Licensing	
Engine Number	1ZR1343614	Last COR	04/09/2025
Doors	5	License Expiry Date	31/08/2025
Color	SILVER	Power / Displacement	97KW/1598CCM
Year Model	2014	Paint Finish	M - METALLIC
Km Reading	8,971 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items


4 airbags; 4x electrical windows; ABS; Airconditioning; Alarm system; Alloy Wheels; Central locking; El. mirrors; Leather steering wheel; Multifunction steering wheel; On-board computer; Power steering; Radio cd;

VEHICLE INSPECTION



Damage

Repair Way

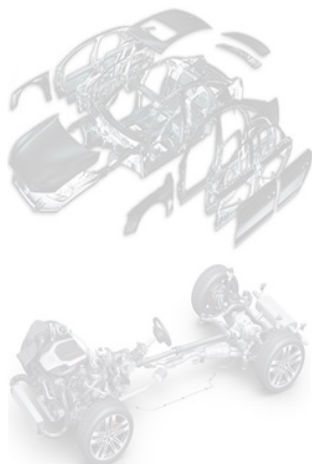

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.4	2.7	-	
Rear	1.5	1.7	-	
Emergency / Parking	1.2	1.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55R16	91V	Royal Black	Royal Mile	V	2125	6 mm
Front Right	205/55R16	91V	Royal Black	Royal Mile	V	2125	6 mm
Rear Left	205/55R16	91V	Royal Black	Royal Mile	V	2125	6 mm
Rear Right	205/55R16	91V	Royal Black	Royal Mile	V	2125	6 mm
Spare	195/60R16	89V	Ceat	Secure Drive	V	0000	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Inspection conditions for the vehicle inspection were sufficient



Comments

General Comments: Body • Exterior: Minor dents scratches and stone chips
Undercarriage: Under carriage mostly covered

Options & Accessories

ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE


Technician

IAN WHITTAKER


This document was created electronically and is valid without signature.

General Remarks:


The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

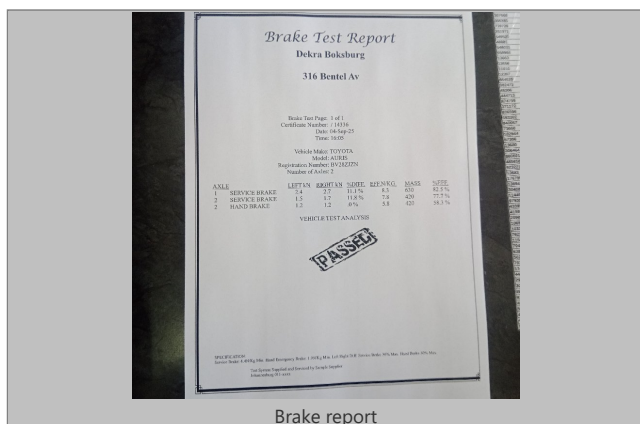

Brake report

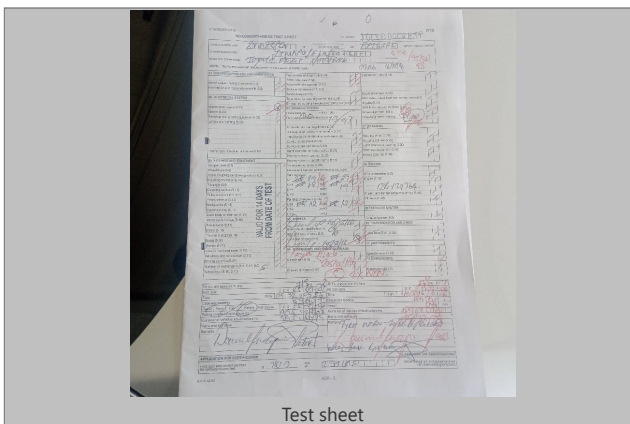

Test sheet

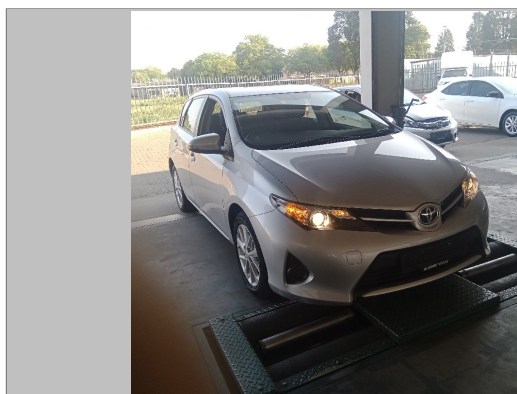

FRONT RIGHT CORNER




REAR LEFT CORNER




INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

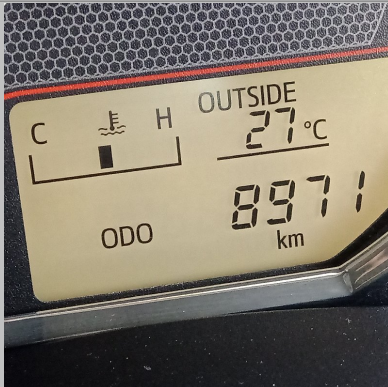

ODOMETER

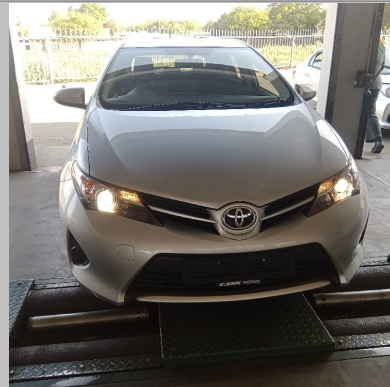

90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare tyre



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Engine covered




CHASSIS



Chassis 2



Coolant level

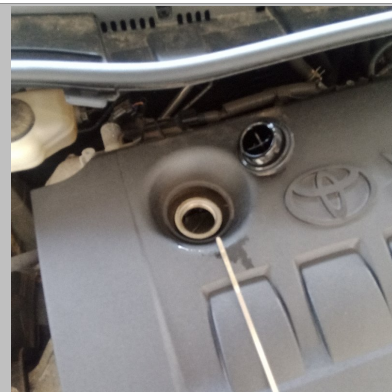

Oil cap and dipstick



Tail Light Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JTNKP0JE60J002260