



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	13/08/2025		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	13/08/2025		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS
Manufacturer	VOLKSWAGEN	Registration Number	LN11SVGP
Model	POLO VIVO	Register Number	JVZ295K
VIN	AAVZZZ6RZPU023148	Date Of First Licensing	
Engine Number	CLP421874	Last COR	13/08/2025
Doors	4	License Expiry Date	28/02/2026
Color	SILVER	Power / Displacement	55kw 1398ccm
Year Model	2023	Paint Finish	M - METALLIC
Km Reading	76,136 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items


2 airbags; 2x electrical windows; ABS; Airconditioning; Alarm system; Alloy Wheels; Central locking; ESP (el. stability progr.); Handsfree car kit; Power steering; Traction control system;

VEHICLE INSPECTION

Damage

Repair Way

Sill Panel Left Dented

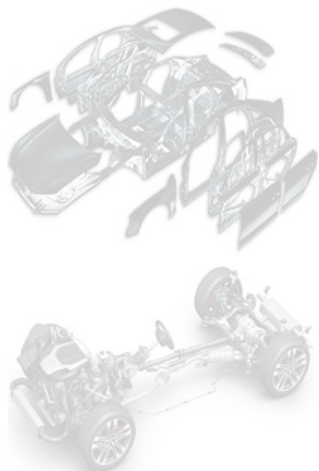



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.0	2.1	-	
Rear	1.2	1.4	-	
Emergency / Parking	0.9	0.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/45ZR17	91W	Blackhawk	Street H	V	0125	5 mm
Front Right	215/45ZR17	91W	Blackhawk	Street H	V	0125	5 mm
Rear Left	215/45ZR17	91W	Blackhawk	Street H	V	0125	5 mm
Rear Right	215/45ZR17	91W	Blackhawk	Street H	V	0125	5 mm
Spare	185/60R14	82H	Goodyear	Efficient	V	0525	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor, scratches and stone chips on some body panels. Cosmetical spray work done to some body panels.

Options & Accessories

RADIO USB

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician


Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

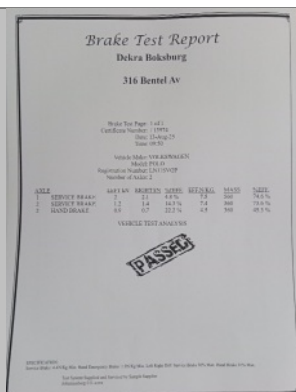

Brake test report

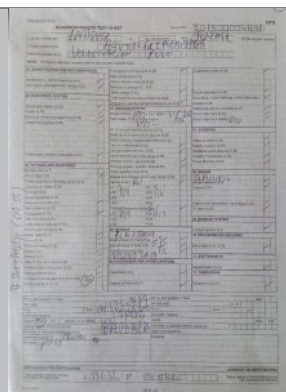

Roadworthy test sheet



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)




DASHBOARD (W/ ENGINE RUNNING)



ODOMETER




90 DEGREE FRONT

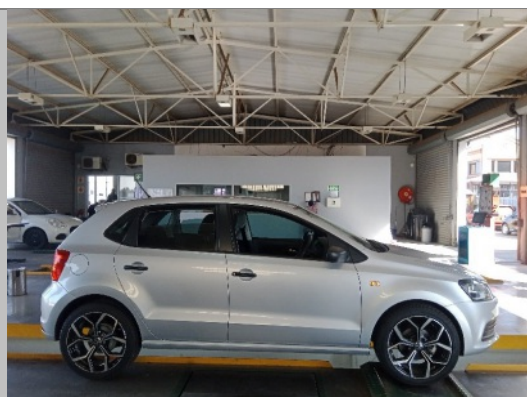


90 DEGREE RIGHT



90 DEGREE REAR

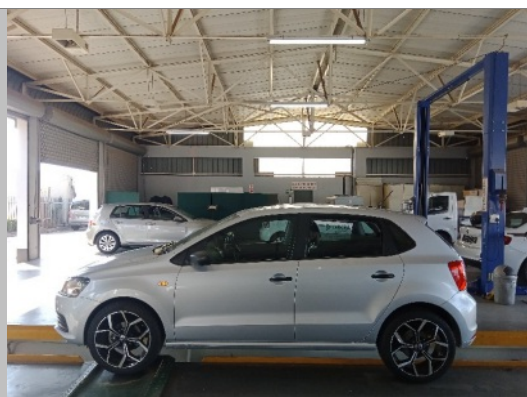

90 DEGREE LEFT

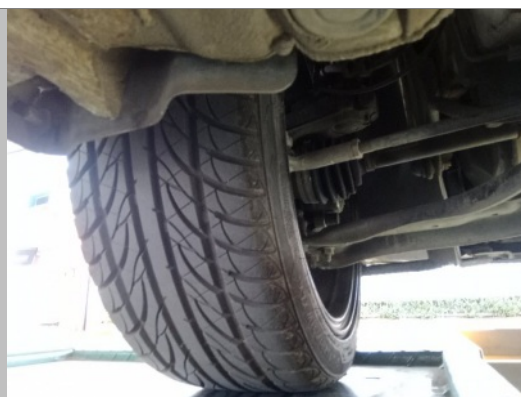

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC




VIN PLATE OR STICKER



ENGINE 1



ENGINE 2

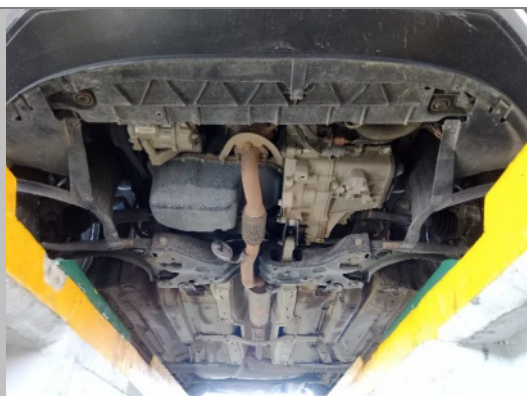

CHASSIS



Chassis 2



Oil cap and dipstick



Expansion bottle

