



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	13/08/2025		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	13/08/2025		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK CBK MOTORS
Manufacturer	FORD	Registration Number	FN67JZGP
Model	FIESTA	Register Number	XBH912W
VIN	WF0DXXGAKDGG24345	Date Of First Licensing	
Engine Number	GG24345	Last COR	13/08/2025
Doors	5	License Expiry Date	31/10/2025
Color	GREY	Power / Displacement	74kW/998cc
Year Model	2016	Paint Finish	M - METALLIC
Km Reading	17,273 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

1 airbag; 6 airbags; 4x electrical windows; ABS; Airconditioning; Alarm system; Alloy Wheels; Car phone preparation; Central locking; El. mirrors; ESP (el. stability progr.); Fog lights; Handsfree car kit; Multifunction steering wheel; Power steering; Radio cd; Traction control system;



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.4	2.7	-	
Rear	1.7	1.9	-	
Emergency / Parking	1.3	1.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/50R15	82V	DUNLOP	SPORT FM800	V	1222	5 mm
Front Right	195/50R15	82V	DUNLOP	SPORT FM 800	V	1221	5 mm
Rear Left	195/50R15	82V	DUNLOP	SPORT FM800	V	0922	5 mm
Rear Right	195/50R15	82V	DUNLOP	SPORT FM800	V	1222	5 mm
Spare	175/65R14	82T	CONTINENTAL	CONTIECOCONT	V	1218	6 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: MINOR DENTS AND SCRATCHES ON SOME BODY PANELS. COSMETICAL SPRAY WORK ON SOME BODY PANELS.

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Ofentse Morankwane

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

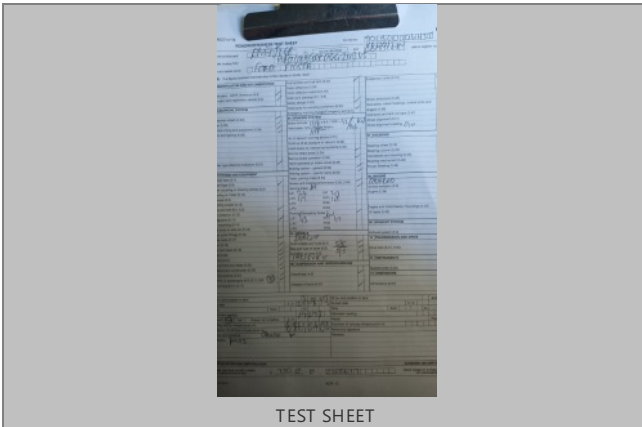

TEST SHEET



SPAREWHEEL




OIL CAP AND DIPSTICK



EXPANSION BOTTLE



CHASSIS 2

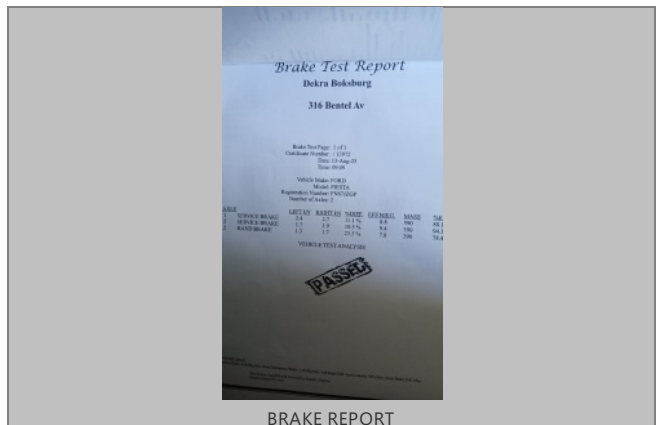

BRAKE REPORT




FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

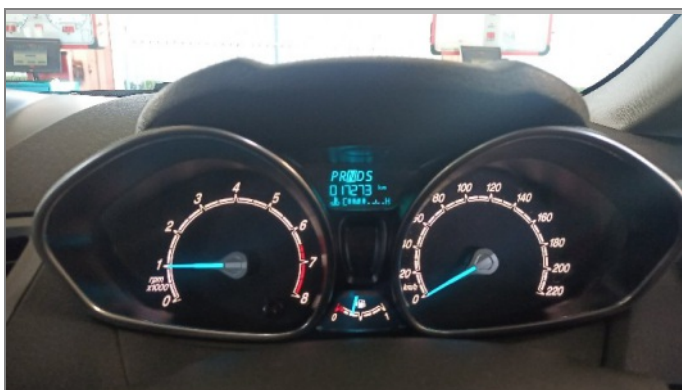


DASHBOARD (W/ ENGINE RUNNING)



ODOMETER




90 DEGREE FRONT

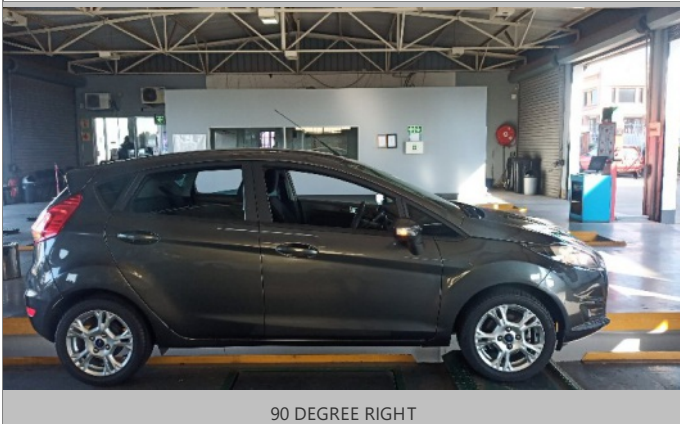

90 DEGREE RIGHT




90 DEGREE REAR

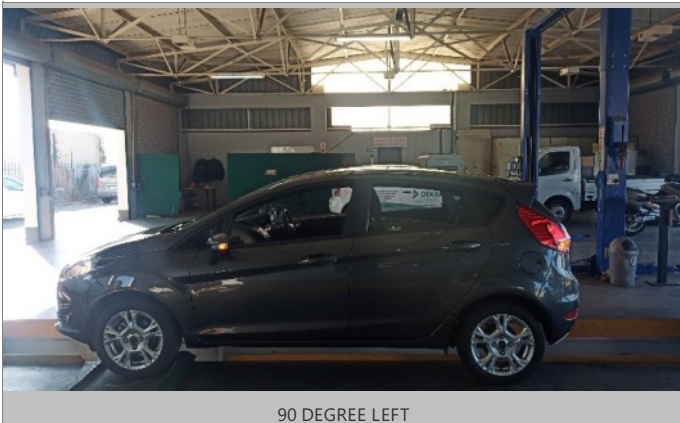


90 DEGREE LEFT



LF TYRE TREAD

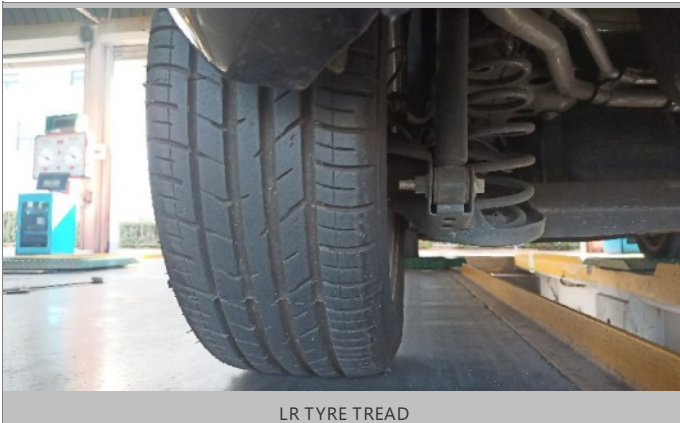

LR TYRE TREAD

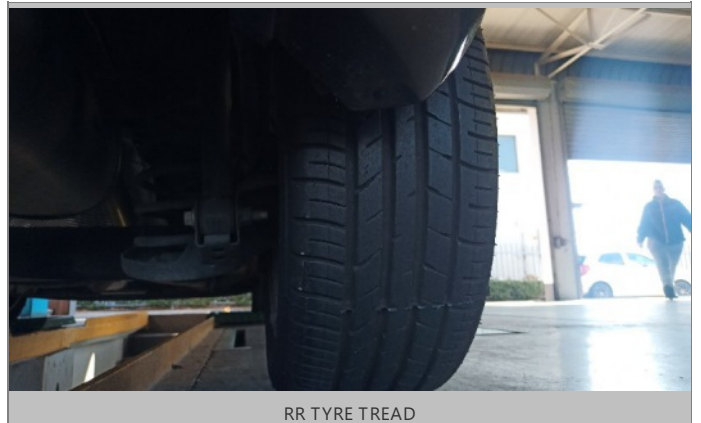

RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



CHASSIS



ENGINE 2



ENGINE 1