



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	10/09/2025		119 PRETORIA ROAD - 1459
Inspection Date	10/09/2025		DEKRA Boksburg - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	FORD	Registration Number	ND381873
Model	FIESTA 1.6 ST 3-DR [2013-2018]	Register Number	WXD748W
VIN	WF0CXXGAKCGB36056	Date Of First Licensing	
Engine Number		Last COR	10/09/2025
Doors	3	License Expiry Date	
Color	BLUE	Power / Displacement	134KW/1596CCM
Year Model	2017	Paint Finish	M - METALLIC
Km Reading	99,983 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

1 airbag; 4 airbags; 2x electrical windows; ABS; Airconditioning auto.; Alarm system; Alloy Wheels; Central locking; Cruise control; El. fold-away mirrors; ESP (el. stability progr.); Fog lights; Handsfree car kit; Leather steering wheel; Multifunction steering wheel; Park sensor; Power steering; Radio cd; Traction control system; Xenon headlights;



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.6	2.5	-	
Rear	2.0	1.8	-	
Emergency / Parking	1.3	1.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/40R17	84W	Dunlop	SP Sport	V	0321	1 mm
Front Right	205/40R17	84W	Dunlop	SP Sport	V	3820	1 mm
Rear Left	205/40R17	84W	Falken	Ziex	V	1219	3 mm
Rear Right	205/40R17	84W	Bridgestone	Potenza	V	4615	2 mm
Spare	T 125/80R15	95M	Continental	CST17	V	0000	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ON EXTERIOR, INTERIOR AND MECHANICAL PARTS. Electrical Components and Instruments: Left side mirror not folding away.
Body • Exterior: Minor dents, scratches, and stone chips on some body panels. Cosmetic spraywork done to some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Expansion bottle




Oil cap and dipstick




Sparewheel



Chassis 2

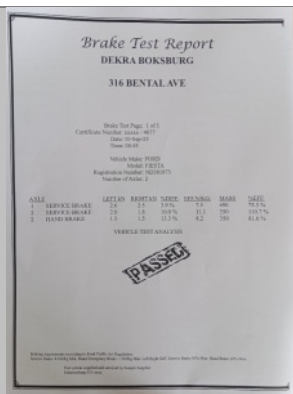

Brake test report

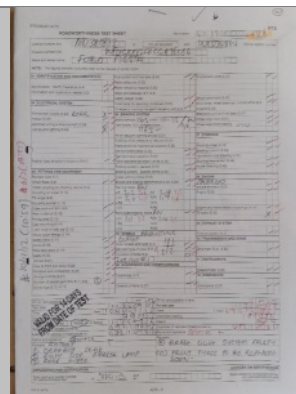

Roadworthy test sheet




FRONT RIGHT CORNER




REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

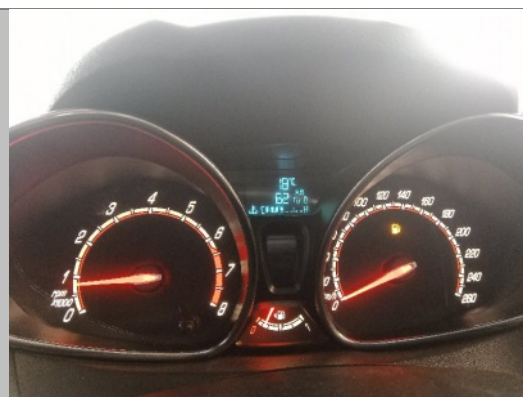

DASHBOARD (W/ ENGINE RUNNING)

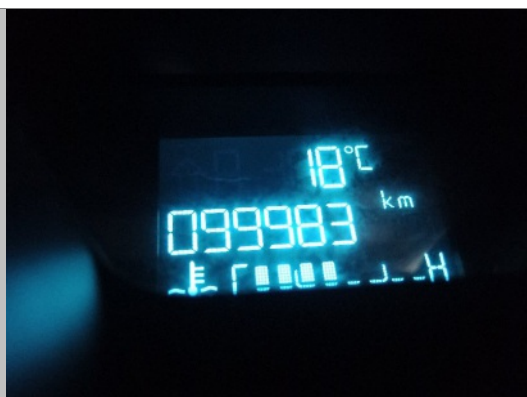

ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD




RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

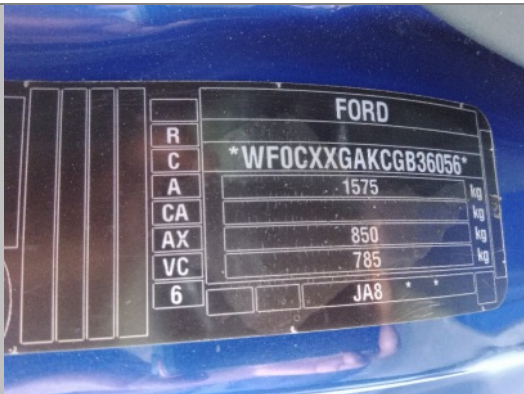

VIN PLATE OR STICKER



ENGINE 1



CHASSIS



ENGINE 2