



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	03/09/2025		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	03/09/2025		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	HYUNDAI	Registration Number	JLW359MP
Model	H-1 2.5 VGT 9-S DSL BUS AT [2015-2018]	Register Number	XDV117W
VIN	KMHW81KMHU851534	Date Of First Licensing	
Engine Number	D4CBG065962	Last COR	03/09/2025
Doors	5	License Expiry Date	
Color	SILVER	Power / Displacement	125KW/2497CCM
Year Model	2016	Paint Finish	M - METALLIC
Km Reading	156,200 KM	Fuel	DIESEL
Cab / Body Type	OTHERS	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

(Fixed) tow bar; 2 airbags; 4x electrical windows; ABS; Airconditioning; Alarm system; Alloy Wheels; Central locking; Cruise control; El. fold-away mirrors; El. mirrors; ESP (el. stability progr.); Fog lights; Leather interior; Leather steering wheel; Multifunction steering wheel; On-board computer; Power steering; Radio cd; Sliding door left; Sliding door right; Traction control system; Xenon headlights;



Brakes

Brake Test Results

Brake efficiency tested during road test.

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.6	4.2	-	
Rear	3.6	3.5	-	
Emergency / Parking	2	2.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/70R16	110S	Hankook	Vantra	V	4924	4 mm
Front Right	215/70R16 c	110S	Hankook	Vantra	V	4924	4 mm
Rear Left	215/70R16 c	110S	Hankook	Vantra	V	4924	4 mm
Rear Right	215/70R16 c	110S	Hankook	Vantra	V	4924	4 mm
Spare	215/70R16	108T	Hankook	RA08	V	0916	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Vehicle Dirty

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: Body • Exterior: Minor dents, stone chips and or scratches on various body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Bianca Gleave

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Expansion bottle




Oil cap and dipstick



Spare wheel



Chassis 2

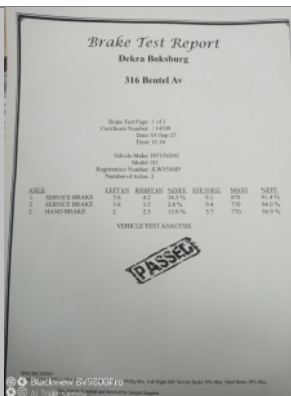

Brake report



Test sheet



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD




RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

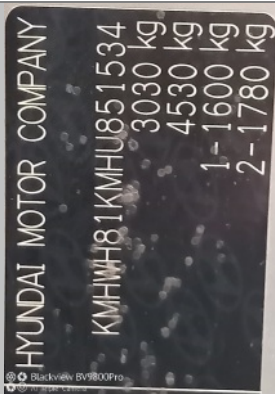

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS