



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	21/09/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	21/09/2026		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	JEEP	Registration Number	HC33WYGP
Model	WRANGLER 3.6 RUBICON 10TH ANNIVERSARY 4X4 AT [2013-2014]	Register Number	SZK008W
VIN	1C4BJWJG4DL680753	Date Of First Licensing	
Engine Number		Last COR	21/09/2026
Doors	3	License Expiry Date	30/11/2025
Color	GREY	Power / Displacement	209kw 3604ccm
Year Model	2013	Paint Finish	M - METALLIC
Km Reading	138,712 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

2 airbags; 2x electrical windows; 4x4; ABS; Airconditioning; Alarm system; Alloy Wheels; Central locking; Cruise control; El. mirrors; ESP (el. stability progr.); Fog lights; Handsfree car kit; Leather interior; Leather steering wheel; Multifunction steering wheel; Power steering; Radio / Cassette; Traction control system;

VEHICLE INSPECTION



Damage

Repair Way



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.0	3.3	-	
Rear	3.9	3.1	-	
Emergency / Parking	2.6	2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	LT285/70R17	116/113Q	I Link	Penterra	V	3625	10 mm
Front Right	LT285/70R17	116/113Q	I Link	Penterra	V	3825	10 mm
Rear Left	LT285/70R17	116/113Q	I Link	Penterra	V	3925	10 mm
Rear Right	LT285/70R17	116/113Q	I Link	Penterra	V	3925	10 mm
Spare	LT285/70R17	121/118Q	Yokohama	Geolandar	V	0919	13 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Electrical Components and Instruments: Airconditioning not cooling at time of inspection.

Body • Exterior: Non standard window tint fitted. Roof covered.

Tyres and Rims: Non standard suspension fitted.

Undercarriage: Non standard exhaust system fitted. Long range tank fitted.

Road Test: 4x4 Function not tested

Options & Accessories

ROOF RACK, REARVIEW CAMERA

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician


Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

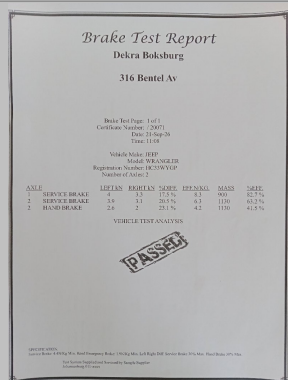

Brake test report

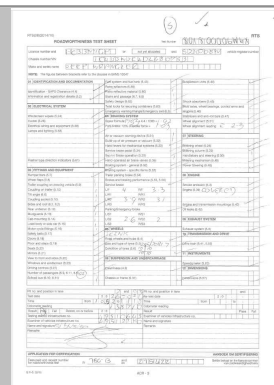

Test sheet



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT




90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

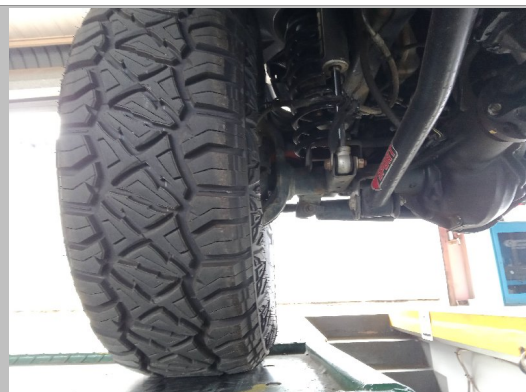

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Chassis 2



Coolant bottle



Oil cap and dipstick