



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	04/09/2025		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	04/09/2025		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	MAHINDRA	Registration Number	NRB14644
Model	XUV 500 2.2 DE W8 MHAWK DSL NEW AGE 7-S AT [2016-2019]	Register Number	XHY663W
VIN	MA1YV2VMVH6059461	Date Of First Licensing	
Engine Number		Last COR	04/09/2025
Doors	4	License Expiry Date	
Color	RED	Power / Displacement	103KW/2179CCM
Year Model	2016	Paint Finish	M - METALLIC
Km Reading	197,218 KM	Fuel	DIESEL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

(Fixed) tow bar; 8 airbags; 4x electrical windows; ABS; Airconditioning auto.; Alarm system; Alloy Wheels; Central locking; Cruise control; El. fold-away mirrors; ESP (el. stability progr.); Fog lights; Handsfree car kit; Leather interior; Leather steering wheel; Multifunction steering wheel; Power steering; Traction control system; Xenon headlights;



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.2	2.8	-	
Rear	2.1	2.0	-	
Emergency / Parking	1.1	1.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	P235/65R17	108H	Pirelli	Scorpion	V	2221	3 mm
Front Right	P235/65R17	108H	Pirelli	Scorpion	V	2221	3 mm
Rear Left	P235/65R17	108H	Pirelli	Scorpion	V	3620	5 mm
Rear Right	P235/65R17	108H	Pirelli	Scorpion	V	2221	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ON EXTERIOR, INTERIOR AND MECHANICAL PARTS. Engine Compartment: Engine area wet, not dripping.
Body • Exterior: The nudgebar mounting bracket was loose. Cosmetic spraywork was done to some body panels.
Undercarriage: Non standard exhaust system fitted.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Warning triangle



Jack and tools



Expansion bottle




Oil cap and dipstick




Chassis 2



No Sparewheel

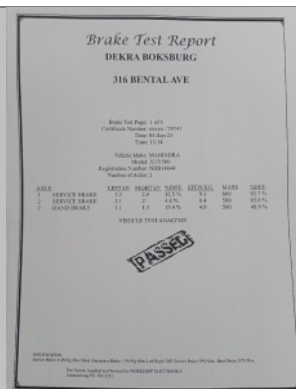

Brake test report

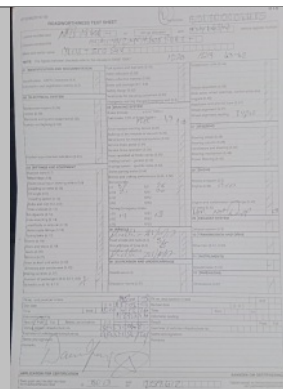

Roadworthy test sheet



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD




RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

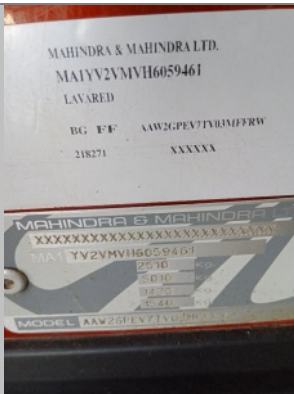

VIN PLATE OR STICKER



ENGINE 1



CHASSIS



ENGINE 2