



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	17/09/2025		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	17/09/2025		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	MITSUBISHI	Registration Number	KWG486MP
Model	PAJERO SPORT	Register Number	ZTD919W
VIN	MMBGUKS10KH009665	Date Of First Licensing	
Engine Number		Last COR	17/09/2025
Doors	4	License Expiry Date	
Color	SILVER	Power / Displacement	133KW/2442CCM
Year Model	2019	Paint Finish	M - METALLIC
Km Reading	130,885 KM	Fuel	DIESEL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

(Fixed) tow bar; 1 airbag; 6 airbags; 7-seater; 4x electrical windows; 4x4; ABS; Airconditioning auto.; Alarm system; Alloy Wheels; Central locking; Cruise control; Driver's seat elec.; El. fold-away mirrors; ESP (el. stability progr.); Fog lights; Handsfree car kit; Leather interior; Leather steering wheel; Multifunction steering wheel; Park sensor; Power steering; Traction control system; Xenon headlights;



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.3	2.5	-	
Rear	4.0	3.0	-	
Emergency / Parking	2.1	1.8	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/60R	110H	Goodyear	Wrangler	V	4321	4 mm
Front Right	265/60R18	110H	Goodyear	Wrangler	V	2222	4 mm
Rear Left	265/60R18	110H	Goodyear	Wrangler	V	4321	4 mm
Rear Right	265/60R18	110H	Goodyear	Wrangler	V	0222	4 mm
Spare	265/60R18	110H	Dunlop	Grandtrek	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Vehicle Dirty
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, EXTERIOR, AND MECHANICAL PARTS. Engine Compartment: Engine and gearbox mostly covered underneath.
Body • Exterior: Minor dents, scratches, and stone chips on some body panels. Cosmetic spray work was done on some body panels.
Road Test: Suspension soft. 4x4 function not tested.

Options & Accessories

SIDESTEPS, REARVIEW CAMERA, NUDGE BAR.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE REAR



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



LF TYRE TREAD



RF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD




ENGINE 1



ENGINE 2



CHASSIS

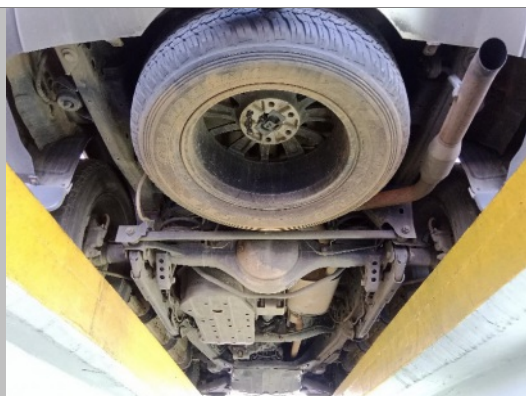

CHASSIS 2



EMERGENCY TRIANGLE



EXPANSION BOTTLE



OIL CAP AND DIPSTICK




SPARE WHEEL



NO LICENCE DISC



VIN PLATE OR STICKER

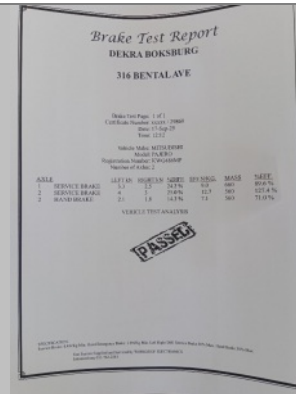

BRAKE TEST REPORT

