



Private Client

DEKRA Boksburg
Bentel Ave - 1459
BOKSBURG - GT
011 826 4386



Assignment

Client	Private Client	Inspection Location	BOKSBURG DEKRA
Requested Date	24/08/2026		316 BENTELL AVE BOKSBURG - 1459
Inspection Date	24/08/2026		BOKSBURG - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	CBK MOTORS CBK MOTORS
Manufacturer	TOYOTA	Registration Number	FN93BXGP
Model	86 2.0 SPORTS COUPE HIGH [2012-2014]	Register Number	FFZ937L
VIN	JF1ZN6K81DG010070	Date Of First Licensing	
Engine Number	G902036	Last COR	24/08/2026
Doors	2	License Expiry Date	31/01/2027
Color	WHITE	Power / Displacement	147kw 1998ccm
Year Model	2013	Paint Finish	C - COMMON
Km Reading	91,573 KM	Fuel	PETROL
Cab / Body Type	COUPE	Transmission	MANUAL

Vehicle Options & Accessories

Items

8 airbags; 2x electrical windows; ABS; Airconditioning; Alarm system; Alloy Wheels; Central locking; Cruise control; El. mirrors; ESP (el. stability progr.); Fog lights; Handsfree car kit; Leather interior; Leather steering wheel; Power steering; Radio cd; Traction control system; Xenon headlights;

VEHICLE INSPECTION



Damage

Repair Way



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.4	2.5	-	
Rear	2.9	2.5	-	
Emergency / Parking	1.6	1.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/45R17	97Y	Goodyear	Eagle	V	0322	3 mm
Front Right	235/45R17	97Y	Goodyear	Eagle	V	0322	3 mm
Rear Left	235/45R17	97Y	Goodyear	Eagle	V	0322	3 mm
Rear Right	235/45R17	97Y	Goodyear	Eagle	V	0322	3 mm
Spare	215/45R17	87W	Michelin	Primacy	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

Inspection conditions for the vehicle inspection were sufficient



Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Engine, gearbox and undercarriage mostly covered underneath.
Undercarriage: Non standard exhaust system fitted.
Road Test: Steering operation noisy during road test (Not excessive)

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician


Tumelo Molekoa

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

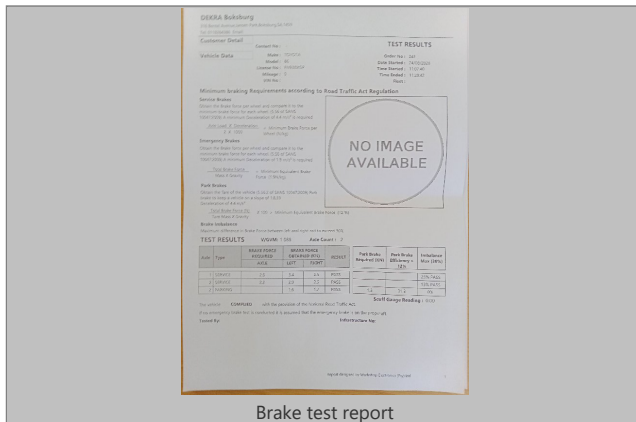


Brake test report

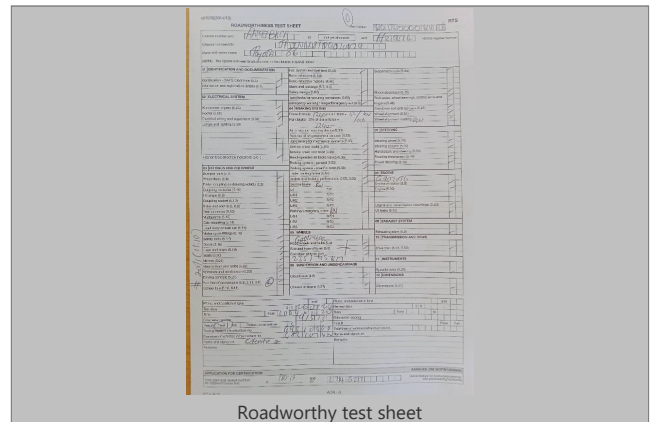

Roadworthy test sheet



FRONT RIGHT CORNER

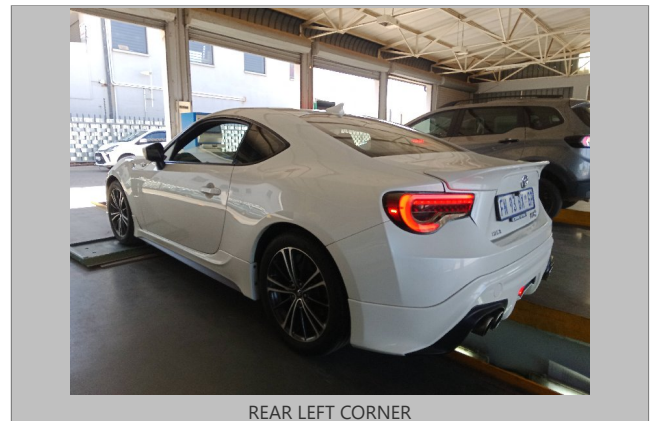

REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)




DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT

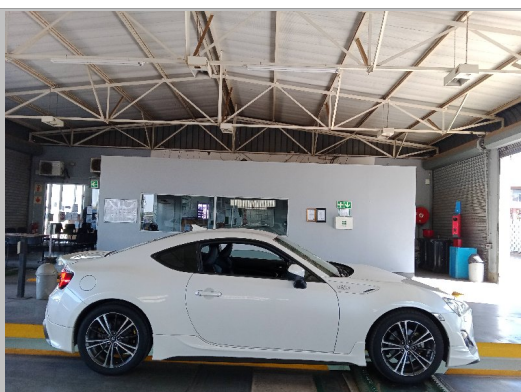


90 DEGREE RIGHT



90 DEGREE REAR




90 DEGREE LEFT

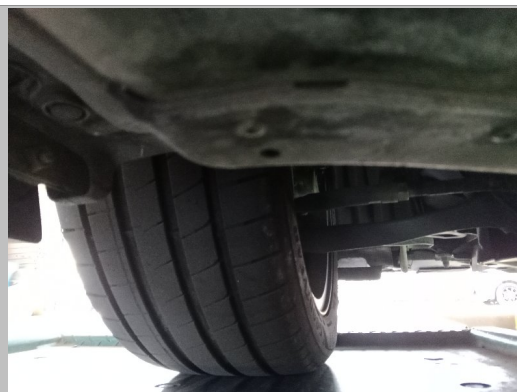

LF TYRE TREAD



LR TYRE TREAD

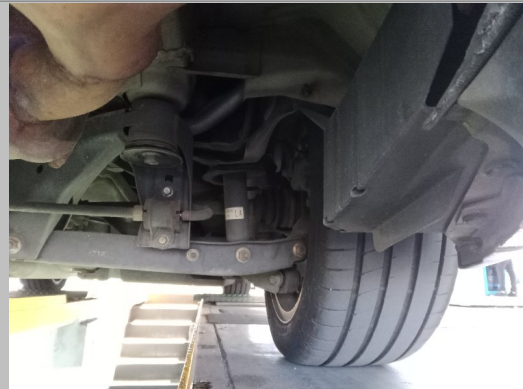

RR TYRE TREAD




LF TYRE TREAD



Sparewheel



LICENSE DISC

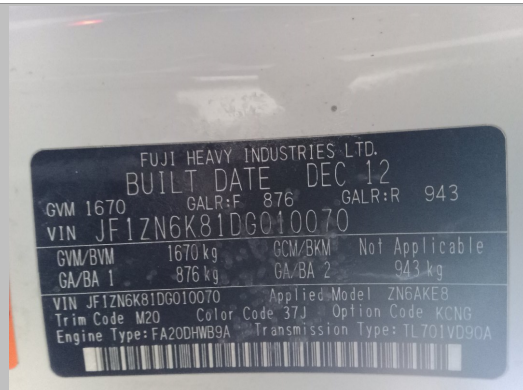

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Chassis 2



Coolant bottle



Oil cap and dipstick



Aircon working

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: JF1ZN6K81DG010070